N00217_000771
NS HUNTERS POINT, CA
SSIC 5000-33c

SUMMARY REPORT INTERIM CLEANUP OF POLYCHLORINATED BIPHENYLS (PCB) CONTAMINATED SOILS NEAR FORMER BUILDING 503

03/03/1989
ERM-WEST

Approved for public release: distribution unlimited.

SUMMARY REPORT
INTERIM CLEANUP OF PCB CONTAMINATED SOILS
NEAR FORMER BUILDING 503

NAVAL STATION, TREASURE ISLAND
HUNTERS POINT ANNEX
SAN FRANCISCO, CALIFORNIA

DEPARTMENT OF THE NAVY
WESTERN DIVISION
NAVAL FACILITIES ENGINEERING COMMAND
SAN BRUNO, CALIFORNIA 94066-0727

A Report Prepared for

United States Navy
Western Division
Naval Facility Engineering Command
P.O. Box 727
San Bruno, California 94066

SUMMARY REPORT
INTERIM CLEANUP OF PCB CONTAMINATED SOILS NEAR FORMER BUILDING 503

NAVAL STATION, TREASURE ISLAND
HUNTERS POINT ANNEX
SAN FRANCISCO, CALIFORNIA

by

ERM-WEST
1777 Botelho Drive, Suite 260
Walnut Creek, California 94596
415/946-0455

Submitted March 3, 1989

771

TABLE OF CONTENTS

	Page
SECTION 1 - INTRODUCTION	1-1
SECTION 2 - DISCOVERY AND SITE INVESTIGATIONS	2-1
DISCOVERY	2-1
CONFIRMING THE DISCOVERY	2-2
General PCB Site Survey	2-2
Groundwater Surveys	2-3
SECTION 3 - INTERIM CLEANUP SUMMARY	3-1
PROJECT ORGANIZATION AND RESPONSIBILITY	3-2
HEALTH AND SAFETY PLAN	3-3
CLEANUP GOAL	3-3
SOIL EXCAVATION	3-3
VERIFICATION SAMPLING PLAN	3-4
Sample Grid Layout Procedures	3-4
Soil Sampling and Laboratory Results	3-6
Area 1	3-7
Area 2	3-7
Area 3	3-8
Sample Tracking and Laboratory Reporting	3-8
ANALYTICAL PROCEDURES	3-8
Background and Blank Samples	3-9
INTERIM CLEANUP APPROVAL, SITE FINISHING, AND FUTURE SITE WORK	3-9
SECTION 4 - REFERENCES	4-1

APPENDIXES

APPENDIX A - FIGURES and TABLES

APPENDIX B - PRELIMINARY SURVEY - SOIL SAMPLING RESULTS

APPENDIX C - GROUND WATER STUDY - SOIL/GROUNDWATER DATA AND GEOLOGIC CROSS SECTION

APPENDIX D - VERIFICATION SOIL SAMPLING RESULTS - LABORATORY DATA REPORTS

APPENDIX E - CHAIN OF CUSTODY FORMS FOR VERIFICATION SAMPLING PROGRAMS

APPENDIX F - LABORATORY QUALITY CONTROL ASSURANCE AND QUALITY CONTROL PROCEDURES

SECTION 1

INTRODUCTION

This summary report consolidates the information pertaining to the interim cleanup of PCB soils at a site near former Building 503 at Hunters Point Annex, (HPA), Treasure Island Naval Station (Figure 1-1). It includes the discovery of the PCBs, the subsequent investigations and studies to define the extent of the PCB contaminated soils, and the resulting cleanup and soil verification reports.

The interim cleanup took approximately two years - from discovery in the fall of 1986 to final cleanup and finishing of the site in the summer of 1988. Additionally, the cleanup involved the close working relationships of the Navy, the Department of Health Services, the Regional Water Quality Control Board, consultants, and remediation contractors. The technical cleanup work was directed and coordinated by the Western Division Naval Facilities Engineering Command (WESTDIV).

The work at the PCB site focused on the interim removal of PCB contaminated surface soils. The cleanup involved excavating and disposing of PCB soils at a Class I landfill. The cleanup goal for the site was defined as 25 mg/kg of residual PCBs. Appropriate long-term remedial actions for the site will be implemented, as required, after the completion of a Remedial Investigation/Feasibility Study (RI/FS) currently in progress at HPA.

This summary report is divided into three remaining sections. Section 2 provides the background from discovery to development of a workplan for cleanup of the site. Section 3 describes the interim cleanup work including methodology, soil disposal, field sampling and field analysis, final confirmation sampling, the results of the verification sampling program, and site finishing and future work. Section 4 is a reference listing. Figures and Tables referenced in the text of the report are consolidated in Appendix A.

SECTION 2

DISCOVERY AND SITE INVESTIGATIONS

This section describes the background and the investigations to identify the extent of the PCB site contamination. The PCB site, as shown in Figure 2-1, is located at the Hunters Point Annex, Treasure Island Naval Station on the west side of the Hussey Street and near the southeast corner of the new Shore Intermediate Maintenance Activity (SIMA) building. The studies and subsequent reports prepared during the discovery phase of the project are summarized in this section.

DISCOVERY

The first indication of PCB contamination at the site was in September of 1986 when the Naval Public Works Department (PWD) was excavating soil to locate and to repair an underground utility. The location of the excavation was between the former building 503 and Sanitary Sewer (SS) Pump Station No. 1 on the western edge of Hussey Street. The location is identified as sample point 1 on Figure 2-2. After finding stained soil and odor in the excavation, the contractors notified the Naval Public Works Department (PWD). After soil samples were taken by PWD and field analysis confirmed PCB contamination, the Western Division of the Naval Facilities Engineering Command (WESTDIV) was consulted for further advice and action.

ERM-West was commissioned to assist WESTDIV to further investigate and perform the following tasks: 1) confirm the PWD results; 2) develop and complete a general survey of the SIMA site for other possible PCB soils; and 3) develop and complete a survey of ground water to assess potential contamination in the area.

Each of the three investigations resulted in reports that are summarized in the following paragraphs.

CONFIRMING THE DISCOVERY

On September 12, 1986 ERM-West collected four samples in the general area of the PWD excavation and requested testing for PCBs by a certified hazardous waste analytical laboratory (ANLAB Analytical Services, Sacramento, California). Soil samples confirmed the presence of PCBs in the soils but in concentrations that would not classify the soils as hazardous by either the State of California or the Environmental Protection Agency (results ranged from less than 0.001 ug/l to 2.3 ug/l in standing water in the excavation, to 0.02 mg/kg in soil). Results of the findings were presented to the Navy in a report dated September, 1986.[1]

General PCB Site Survey

After confirming PCBs in the soil the recommendation was to survey the SIMA site more extensively. The extent of the site survey performed on October 15 - 16, 1986 is shown in Figure 2-2.[2] Sixty borings were drilled to a depth of approximately five feet. Additionally, two borings were drilled to depths of greater than six feet to obtain groundwater samples. Soil samples were generally composited for each boring, and then analyzed for PCBs by a two step procedure: 1) a field test kit procedure to identify potentially high concentrations of PCBs, followed by 2) a certified hazardous waste laboratory analysis by gas chromatography (GC) on selected high concentration samples identified by the field test kit.

All soil samples were initially subjected to field testing in an on-site laboratory constructed and operated by ERM-West

personnel. The field test kit was manufactured by McGraw Edison Company and has been demonstrated to be an accurate in-field tool to assist in the identification of PCBs. (For further discussions for limitations and constraints of the field test kit see reference 2). Additionally, two soil samples were submitted to a certified laboratory (ANLAB) for purgable halocarbons (EPA method 8010) analysis to determine if other contaminants had leached into the soil near a separator and sump adjacent to the transformer pad.

The results of the survey confirmed that PCB soil contamination appeared to have spread from the old transformer pad, located in the southeast corner of former building 503, toward Hussey Street. In Figure 2-2, the sample points are identified by a number within a circle. Four of the sixty samples between the transformer pad and Hussey Street had high PCB soil concentrations ranging from 26 mg/kg to 910 mg/kg of Aroclor 1260. These sample locations are identified in dark blue on Figure 2-2 and are identified as sample numbers 2, 2A, 2Q, and 2R. A summary of the field kit analysis and the certified laboratory results are presented in Appendix B for reference.

No detectable contamination was reported for the remainder of the samples collected in the survey. No detectable purgable halocarbon were found in the soil. The report recommended development of a work plan to cleanup the site.

Ground Water Surveys

Ground water studies were performed in January and September, 1987. In January, 1987, an investigation[3] of soil, sediment, surface water, and groundwater was conducted to determine if PCBs were present above action levels. The field work included logging and sampling of borings; installation, development, and sampling

of seven wells; water level measurements; and sampling of sediment and water from a catch basin.

The location of the seven monitoring wells, identified as W-1 through W-7, are shown in Figure 2-3. The January, 1987 investigation indicated that groundwater gradient was non-uniform and appeared to flow in an easterly direction. Low concentrations of PCBs (0.004 mg/l) were detected in one of seven wells (W-1). Well W-1 is located at the transformer pad and, based on the water samples taken during the study, there was no indication that groundwater was spreading the PCBs.

In September, 1987, ERM-West prepared a report for a ground water monitoring plan[3A]. This study combined the data collected from the January 1987 investigation with new data collected from the existing seven monitoring wells and the drilling of four additional borings (B8 through B11 shown in Figure 2-3). The report summarized the site's soil lithology, groundwater gradient, tidal influences, aquifer characteristics, and the occurrences of PCB at various soil depths and within the groundwater. In Appendix C are tables of data summarizing the results of PCB analysis on subsurface soil and groundwater. Additionally, geologic cross sections of the site are presented in Appendix C.

Trace but detectable concentrations of PCBs in groundwater were reported in two of five wells at the site. These two wells (W-1 and W-2) are within the area where surface and subsurface PCBs had been detected and were within the "footprint" of the PCB cleanup site. The levels of PCB detected ranged from 0.0007 mg/l to 0.004 mg/l.

PCBs were found in the subsurface soils at depths as great as 27 feet. The concentrations at depths greater than 20 feet were typically trace concentrations, less than 0.1 mg/kg. The highest

concentrations, however, were detected in well W-1 located at the former transformer site (highest values ranged from 24 mg/kg to 32 mg/kg). With two of the highest concentrations (28-32 mg/kg) occurring within 5.5 feet of ground surface. This surface contamination was removed with the soil cleanup activities that occurred at the site.

Four wells were subsequently sealed and destroyed (Wells W-1, W-2, W-3, and W-5) by new construction (SIMA Building) and soil excavation during the PCB interim remediation work. Three of the wells (W-4, W-6, and W-7) remained as ground water monitoring wells.

The groundwater monitoring plan recommended the installation of two new monitoring wells. With the three existing wells at the site, the monitoring well network proposed would have incorporate data from five wells. The installation of the two additional wells was not implemented by the Navy. After a meeting between the Navy, Regional Water Quality Control Board, and Department of Health Services, an agreement was made that the information in the groundwater monitoring report would be included in the RI/FS study that is presently in progress. The decision to place monitoring wells at specific locations within the Hunters Point Annex, as well as this PCB site, would be determined as part of the overall RI/FS study.

SECTION 3

INTERIM CLEANUP SUMMARY

This section summarizes the interim cleanup work at the PCB site near former Building 503, Hunters Point Annex, Treasure Island Naval Station. The cleanup of PCB contaminated surface soils comprised site management and contractor coordination, development and preparation of a Health and Safety Plan, determination of the spill site boundary, cleanup by excavation and removal of soils to a Class I hazardous waste landfill, and verification that the cleanup goal for surface soils had been achieved by the soil excavation work.

The cleanup work was performed in three phases. A report[4,5,6] was prepared at the completion of each work phase to summarize the excavation activities, the soil sampling results, and the final verification sampling results. The Navy would authorize the cleanup activities to proceed onto the next cleanup area of the site after review and comment by the regulatory agencies of the results and recommendations of the previous work phase.

The results of the cleanup work are presented in the following paragraphs. The total yards of contaminated soil removed from the site and disposed in a Class I landfill was approximately 1500 cubic yards. Landfills used as disposal sites were Chemical Waste Management in Kettleman City, California and United States Pollution Control Inc. at Grassy Mountain, Utah.

PROJECT ORGANIZATION AND RESPONSIBILITY

Four groups were directly involved in the cleanup of the site: the Navy, an excavation and disposal contractor, an environmental engineering consultant, and an analytical laboratory. The PCB cleanup project was directed by the Western Division Naval Facilities Engineering Command (WESTDIV), San Bruno, California. WESTDIV coordinated the cleanup work using contractors and consultants, communicated with the regulatory agencies, inspected the site, and tracked work progress.

The cleanup contractor was American Environmental Management Corp., Oakland, California. The contractor was responsible for excavation and removal of soil from the PCB site, site containment, and health and safety of American Environmental personnel.

Sampling of the site was performed by ERM-WEST, Walnut Creek, California. ERM-WEST was responsible for sampling the site and reporting the PCB results to the Navy; setting-up the verification sampling grid; overviewing health and safety of ERM-West personnel; and reporting sampling results.

Central Coast Analytical Services, San Luis Obispo, California, was the laboratory used to perform the PCB analytical procedures. Central Coast Analytical Services is a certified hazardous waste laboratory and was used during all three cleanup phases.

HEALTH AND SAFETY PLAN

ERM-West prepared a Health and Safety Plan specifically tailored to the work to be performed by ERM-West personnel.[7] Since the contractor, American Environmental Management Corp, was involved in the physical removal of the soil, a separate Health and Safety Plan was prepared by American Environmental for their personnel.

CLEANUP GOAL

In a February 18, 1987 letter[8] from the Department of Health Services (DHS) to the Navy, the DHS concurred with EPA's recommended PCB cleanup level of 25 ppm. This cleanup goal for surface soils had a condition that any areas having a residual PCB concentration greater than background levels would be covered over by concrete, asphalt, or a minimum of 10 inches of clean soil.

SOIL EXCAVATION

The extent of the cleanup area is shown in Figure 3-1. The basic shape of the entire cleanup area was defined in Phase 1 when soil excavation and disposal work was performed in all three areas of the site.

In order to optimize resources and to insure adequate removal and verification of contaminated soils, the excavation area was divided into three subareas. The subdividing of the site provided several advantages: 1) the large cleanup area was divided into manageable areas, 2) dewatering of the ground water was lessened by reducing the size of the cleanup areas, 3) in-field soil

sampling could be managed more effectively, and 4) final verification sampling grids were tighter and more encompassing than if the area was treated as one large site.

VERIFICATION SAMPLING PLAN

The determination of the PCB contamination boundary and the horizontal and vertical extent of soil contamination was based on the results of field samples analyzed by the McGraw Edison PCB test-kit. Use of the test kit as a screening device to direct the field activities in all three phases of work minimized the analytical costs and expedited the clean-up activities.

The decision to implement a formal verification sampling plan in each of the three phases at the work site was based on initial soil screening by the field PCB kit. The correlation between field sample results and certified laboratory reports has been confirmed and previously discussed in both the Interim Report[4] and addendum.[4A] Comparison of split samples analyzed concurrently by the field test kit and a certified analytical laboratory consistently indicated that the field kit conservatively indicated PCB concentrations higher than the certified laboratory results.

The following paragraphs summarize the verification sampling protocol used in the three cleanup areas. Detailed laboratory reports for the verification sample analysis by area are presented in Appendix D.

Sample Grid Layout Procedures

The layout of the verification sampling grid for each the three cleanup areas is shown on Figure 3-2 (Enclosed in pocket at

end of report). The location of sampling points is based on USEPA protocol for verification sampling[9].

The sample points for each area were established as follows: the longest length of each spill area was determined (L1); at the midpoint of L1, a perpendicular line (L2) was established across the excavation; a line connected from the midpoint of L2 (center of the sample grid) to the endpoint of L1 was established as the radius of the excavation (this radius defines the extent of the spill area by the EPA protocol). Once this midpoint is established, verification sampling points are determined by creating a hexagonal grid based on equilateral triangles. The grid starts at the center of the of the sampling grid and radiates outward.

Once the radius of the sampling area was determined, the spacing of the hexagonal sample points was determined by multiplying the radius by 0.3 (Table 2[9]). To summarize, the sampling grid layouts for each area were as follows:

Cleanup Area	Sample Radius, feet	Sample spacing, feet	Number of Samples
1	50	15.0	37
2	37.5	11.3	50
3	26	7.8	56

In each phase of the clean-up work, additional grid points were identified on the outside periphery of the excavation to confirm that the extent of the surface PCB contamination had been accurately identified. Therefore, in each clean-up area, the total number of grid points sampled and analyzed equaled or exceeded the sample size referenced in Table 4[9].

As indicated on Figure 3-2, nine of the sample points were triangulated and located relative to either the existing pumping station or existing power poles. These nine points allow re-establishment of the sampling grid at a future time.

Soil Sampling and Laboratory Results

Depths of the excavation ranged from approximately 1 to 10 feet, 1 to 6 feet, and 1 to 8 feet below the existing grade in areas 1, 2, and 3, respectively. Groundwater in the area was typically 2 to 4 feet below grade.

Different sampling protocols were used to sample the interior and outside periphery of the excavations. For the interior of the excavation, groundwater seepage in the excavation was pumped into an on-site holding tank, sampled, and analyzed for PCBs. Laboratory results did not detect PCBs and the groundwater was discharged to the pumping station. At each grid point, a 6-ounce surface soil sampled was taken with a wooden disposable tongue depressor and placed in a glass jar; depth of sample was approximately 2 centimeters. The Teflon-capped sample glass jars were placed on ice for transport to the laboratory.

The periphery of the site, outside the excavation, was sampled using a hollow stem drill rig. The drill rig was used to break through the asphalt paving and to push brass tubes for retrieval of undisturbed samples at depths varying between 1.33 feet and 3.0 feet. The depth of sample was previously discussed with the DHS before drilling and follows the procedures established during the Area 1, 2, and 3 sampling programs.[4,5,6] Samples inaccessible to the drill rig were hand augered. After sample retrieval, sample tubes were covered with Teflon, capped, placed on ice, and transported to the laboratory.

In the following paragraphs, a summary of each area's verification sampling history is presented. Figure 3-2 depicts the sample locations and Tables 3-1, 3-2, and 3-3 summarize the final sampling results for each of the areas.

Area 1. On April 15, 1987, 21 samples from excavated Area 1 were composited in five groups. Three of the five composites had arithmetic averages greater than the cleanup level (25 mg/kg). Thus discrete samples were analyzed from these composite groups. Since the discretes for 75 percent of samples from the composite group of A1, A2, B1, B2, exceeded the cleanup goal, this area was included for cleanup in the Area 2 excavation work.

Of the remaining discrete samples only one sample, G4, exceeded the cleanup level. This area was further excavated following discussion between the Navy and DHS and was resampled on May 1, 1987. Additionally, sixteen samples, designated X1 through X16, were sampled from the periphery of the excavation on May 18, 1987. As presented in Table 3-1, the final verification sampling results indicated that no final verification sample exceeded the cleanup goal of 25 mg/kg.

Area 2. In area 2, the grid points were initially sampled on September 3 and 4, 1987. Areas where soil contamination exceeded the cleanup criteria of 25 mg/kg PCBs were further excavated and were resampled on October 16, 1987. Seven and two randomly split samples were shared with the DHS on September 3-4, 1987 and October 16, 1987, respectively. These samples were taken to the DHS laboratory for sample preparation, splitting, and subsequent forwarding of half of each sample to Central Coast Analytical Services for PCB analysis. As presented in Table 3-2, the final verification sampling results indicated that no sample exceeded the cleanup goal of 25 mg/kg. The split samples analyzed by the DHS were consistent with the results of Table 3-2.

Area 3. In area 3, the interior and the periphery of excavation were sampled on August 5 and August 8, 1988, respectively. No sample splitting was performed following discussions with the DHS. All samples collected during this work were reported below the cleanup goal of 25 mg/kg as indicated by the results summarized in Table 3-3.

Sample Tracking and Laboratory Reporting

To track samples from the field to the laboratory, chain of custody documentation was prepared and sealed with the field-to-laboratory transport container. Chain of custody forms prepared and used during the sampling program are presented in Appendix E.

ANALYTICAL PROCEDURES

Once the soil samples were received at the Central Coast Analytical Services laboratory the samples were prepared, extracted, and analyzed for PCBs. Sample preparation and extraction generally followed EPA method 3550 - Sonication Extraction. However, instead of a 1mm X 1mm sieve required by the EPA method, Central Coast used a #10 sieve (2mm X 2mm) to be consistent with sample preparation required by California Administrative Code, Title 22, Division 4, Chapter 30, Section 66700 (c) (1). This modification to the EPA method was implemented at the request of the DHS.

The samples received at the laboratory were air dried (Phases 2 and 3 only) before analysis for PCBs per DHS recommendations. This was done after determination of percent moisture in the original sample. A 20 gram wet weight sample was used and mixed with Na2SO4 then sonicated. The extraction solvent was 1:1

hexane:acetone (B & J) chromatography grade. The extract sample was filtered and reduced in volume using a Kuderna-Danish concentrator. PCBs, if present in the sample extract, were identified using EPA method 8080 - Organochlorine Pesticides and PCBs.

Central Coast's "Quality Assurance/Quality Control Procedure" as summarized in Appendix F, required blanks, duplicates, and spikes to be analyzed once per batch, once per matrix type or once per 20 samples, whichever is more frequent. For this project, however, duplicates were run once per batch, once per matrix type, or once per 10 samples analyzed, whichever was more frequent.

Background and Blank Samples

As part of the quality assurance program, a soil background (BL-1) and blank (BL-2) were collected during Area 2 verification sampling. Trace levels of PCBs, 0.17 mg/kg and 0.5 mg/kg were detected in both soil samples BL-1 and BL-2, respectively. Both of the occurrences were a result of factors not directly influencing the verification sample data. Compared to the PCB concentrations found in the actual verification samples, those found in samples BL-1 and BL-2 are not significant.

INTERIM CLEANUP APPROVAL, SITE FINISHING, AND FUTURE SITE WORK

Laboratory analysis of the soil samples obtained in Phases 1, 2, and 3 of the Interim Cleanup of the site using EPA Verification Sampling Protocol indicated that the interim cleanup goal of 25 ppm or less had been achieved for all three areas. Each phase of the cleanup work received DHS review and comment prior to site backfilling.

Each excavated area was backfilled with acceptable engineered fill and compacted to minimize soil settlement. The entire cleanup area was topped with asphalt paving to prevent surface water infiltration and surface erosion.

The PCB removal area will be further investigated in the Hunters Point Annex Remedial Investigation/Feasibility Study (RI/FS) to further characterize remaining low-level PCB contamination at the site. Upon completion of the RI/FS, long-term remedial measures to protect the public health and environment will be implemented as appropriate.

SECTION 4

REFERENCES

The following references were developed or used during the cleanup work at the PCB site near former building 503, Hunters Point Annex, Treasure Island Naval Station.

1. ERM-West, September 1986, Hunters Point Naval Shipyard, PCB Investigation

2. ERM-West, November 1986, Hunters Point Naval Shipyard, Preliminary Investigation of Possible PCB Spill

3. ERM-West, January 1987, Investigation of PCBs in Soil and Groundwater at the Hunters Point Site

3A. ERM-West, September 1987, Groundwater Monitoring Plan, Hunters Point Naval Shipyard, PCB Spill Site, Near Former Building 503

4. ERM-West, April 1987, PCB Verification Sampling Results, Interim Report (Area 1)

4A. Addendum to the "PCB Verification Sampling Results, Interim Report", Attachment to a letter from the U.S. Navy to the Department of Health Services, June 25, 1987.

5. ERM-West, December 1987, PCB Verification Sampling Results, Area 2

6. ERM-West, July 1988, PCB Verification Sampling Plan, Area 3

7. ERM-West, February 1987, Hunters Point - PCB Cleanup Work: Health and Safety Plan

8. February 18, 1987, DHS letter to Alex Dong, Western Division-Naval Facilities Engineering Command

9. USEPA, August 1985, Verification of PCB Spill Cleanup by Sampling and Analysis, Interim Report No. 2

APPENDIX A

FIGURES AND TABLES

APPENDIX A
FIGURES and TABLES

LIST OF FIGURES

Figure No.		
1-1	Location Map	
2-1	Site Location Plan	
2-2	Original PCB Survey Plan	
2-3	Locations of Borings, Wells, and Geologic Cross Sections	
3-1	PCB Site - Work Areas	
3-2	Verification Sample Locations	(In Pocket at end of report)

LIST OF TABLES

Table No.	
3-1	Area 1 - Verification Soil Sampling Results
3-2	Area 2 - Verification Soil Sampling Results
3-3	Area 3 - Verification Soil Sampling Results

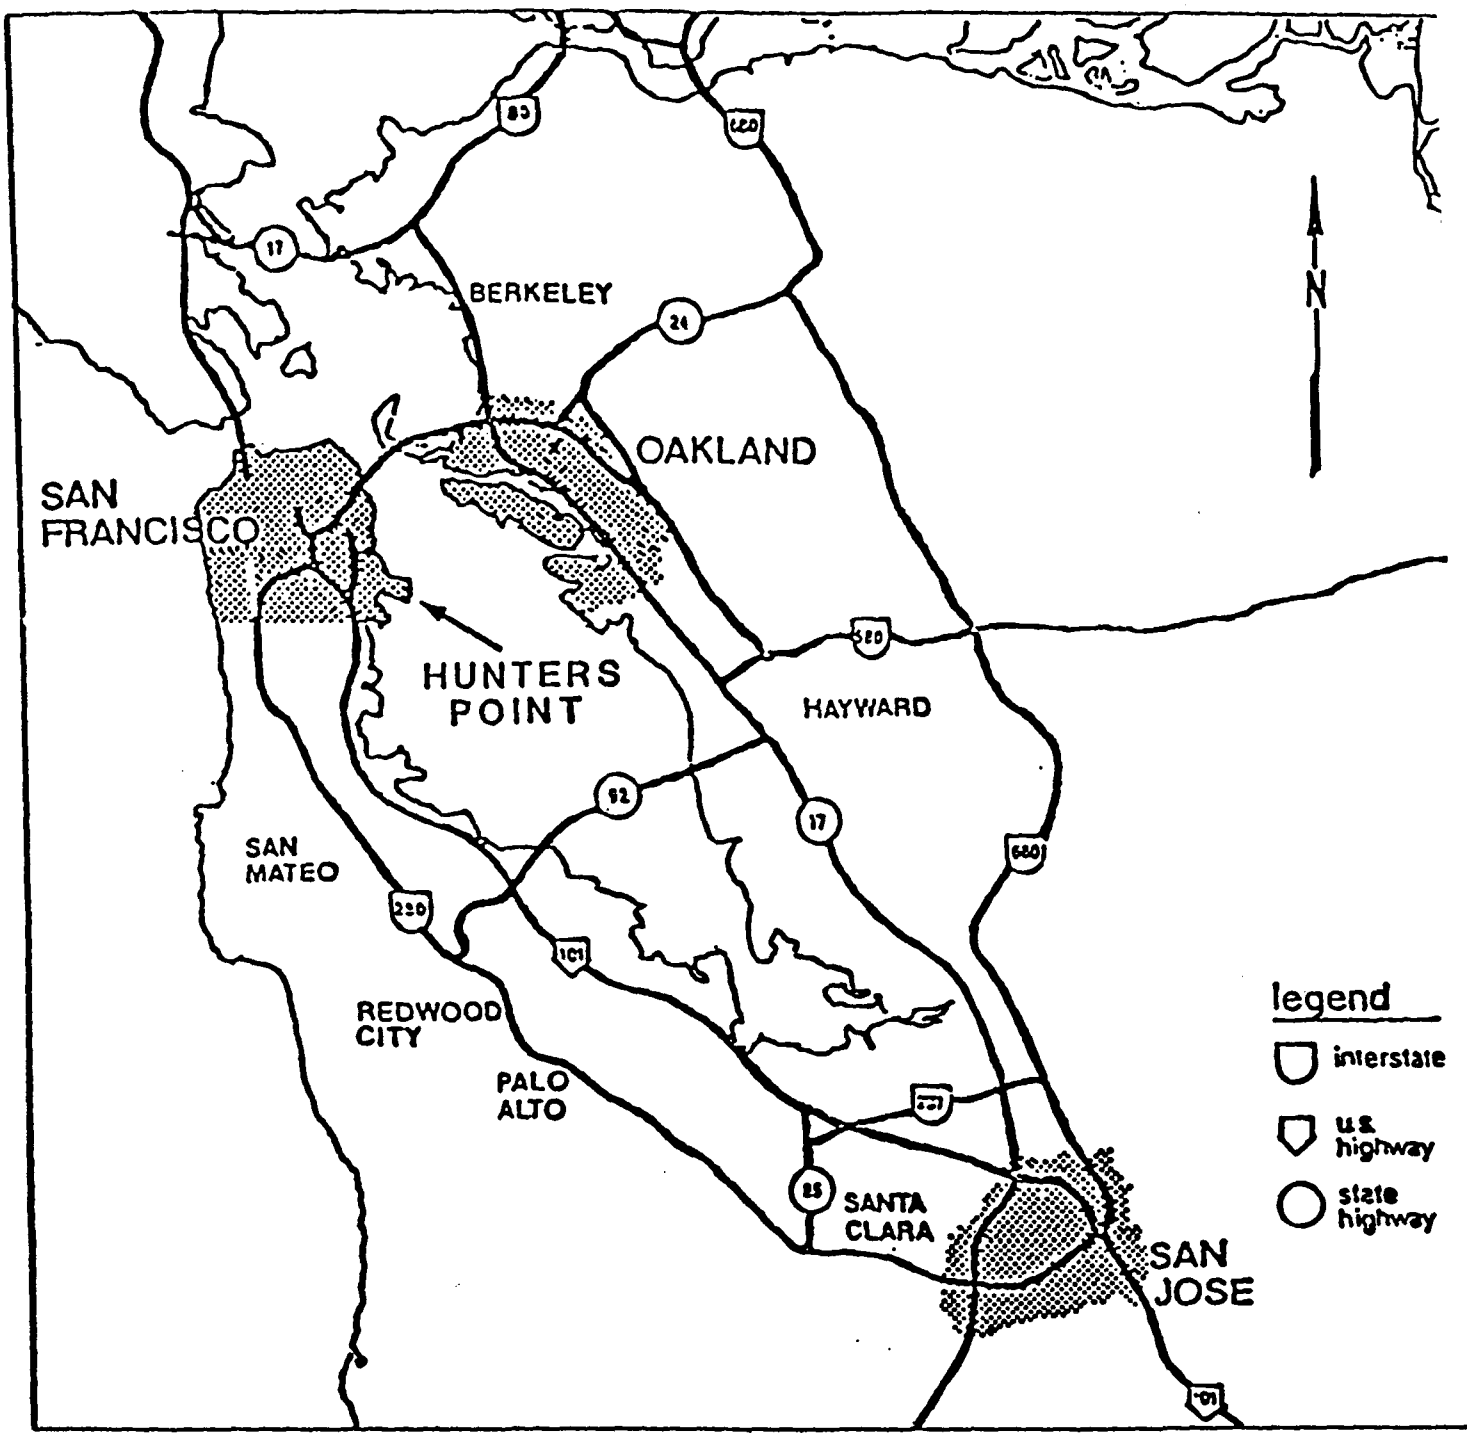

Figure 1-1

Hunters Point-Location Map

ERM-West 11/15
472.01/JPT/10.4.88

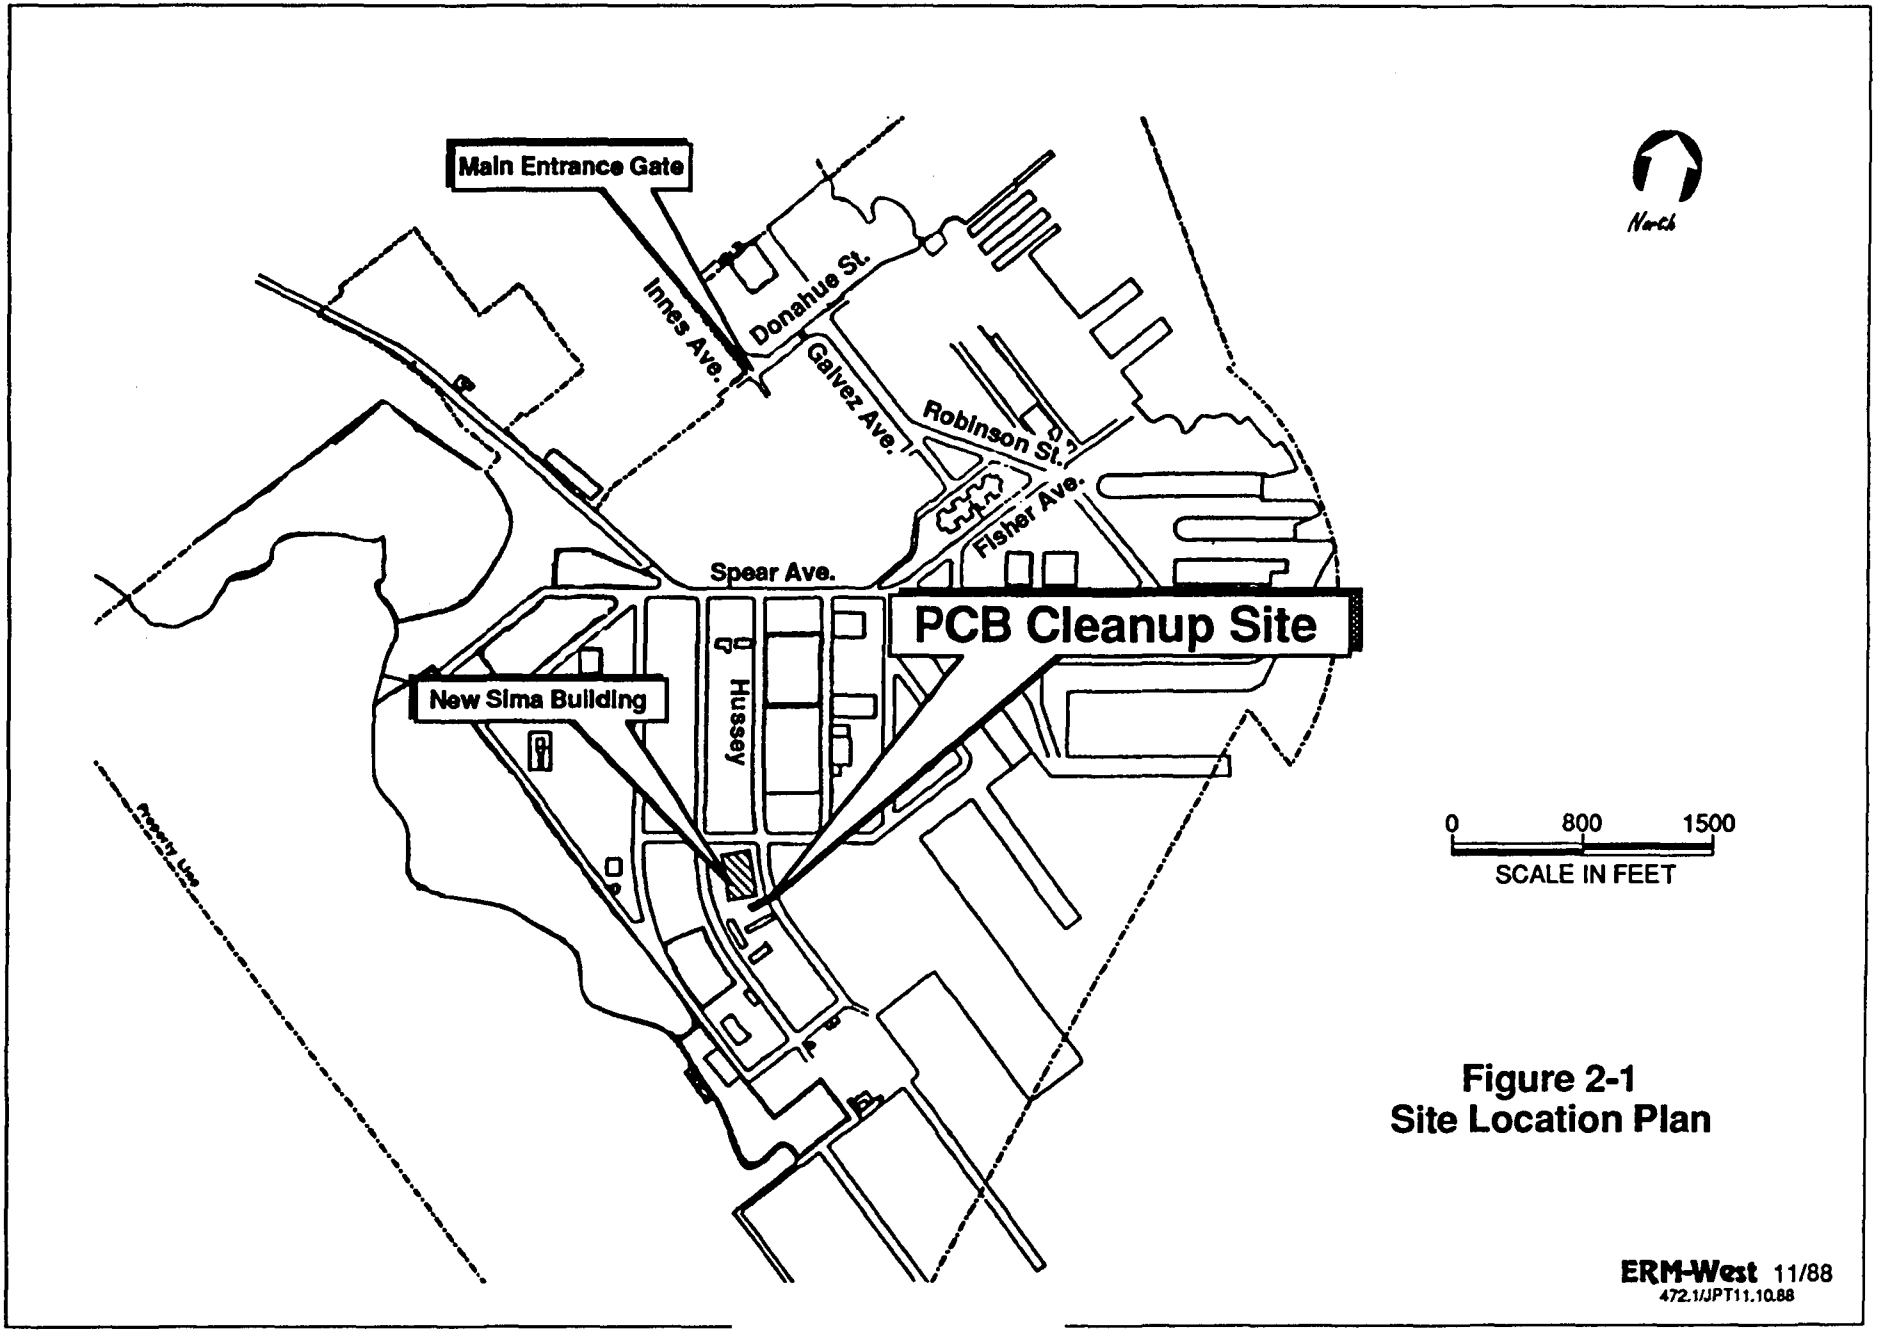

Figure 2-1
Site Location Plan

ERM-West 11/88
472.1/JPT11.10.88

Figure 2-2

Original PCB Survey Plan

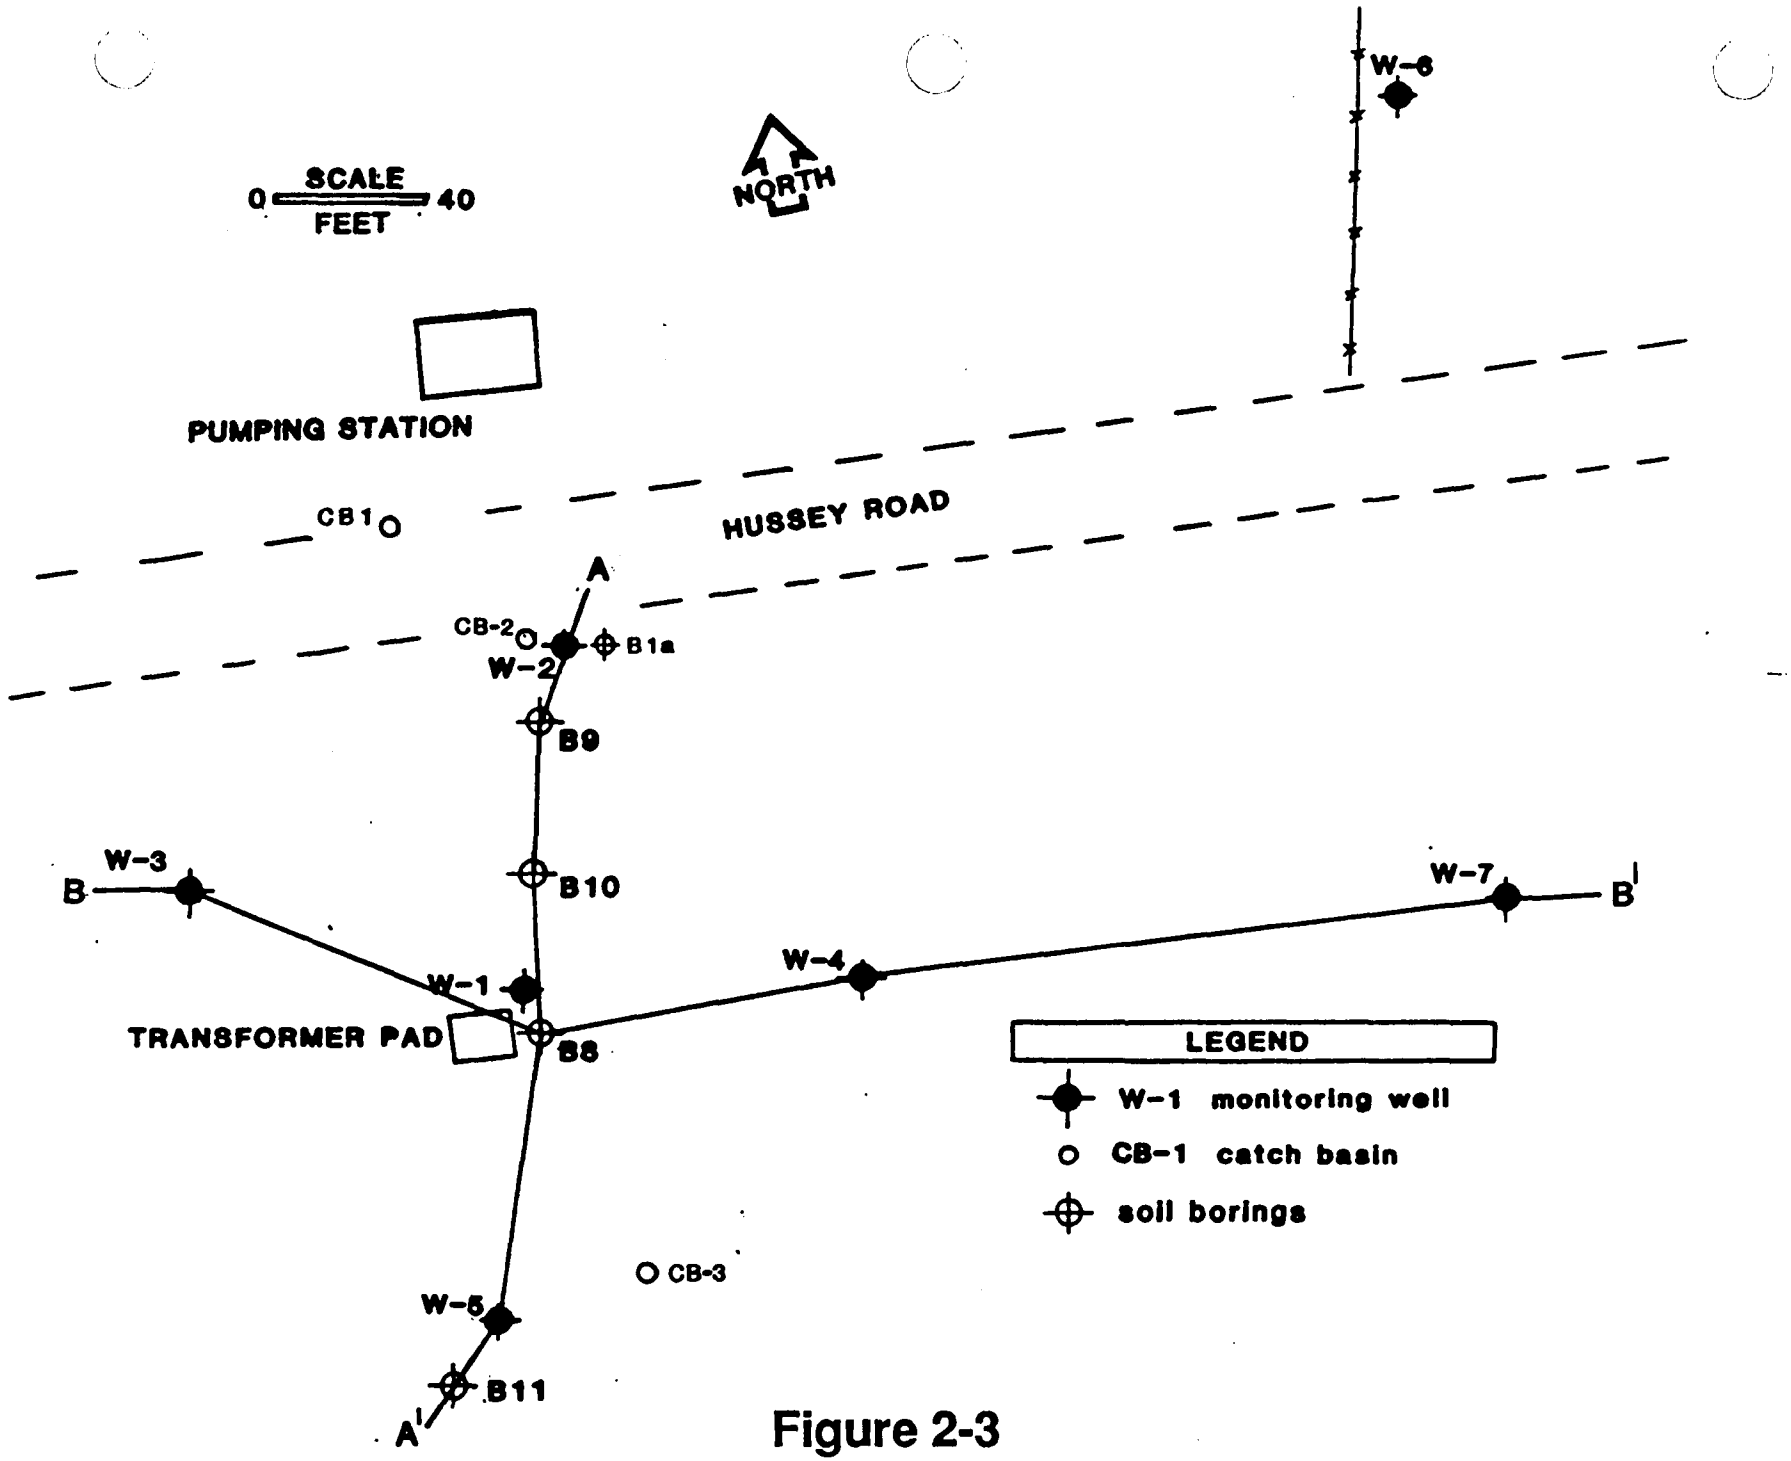

Figure 2-3

Locations of Borings, Wells and Geologic Cross Sections

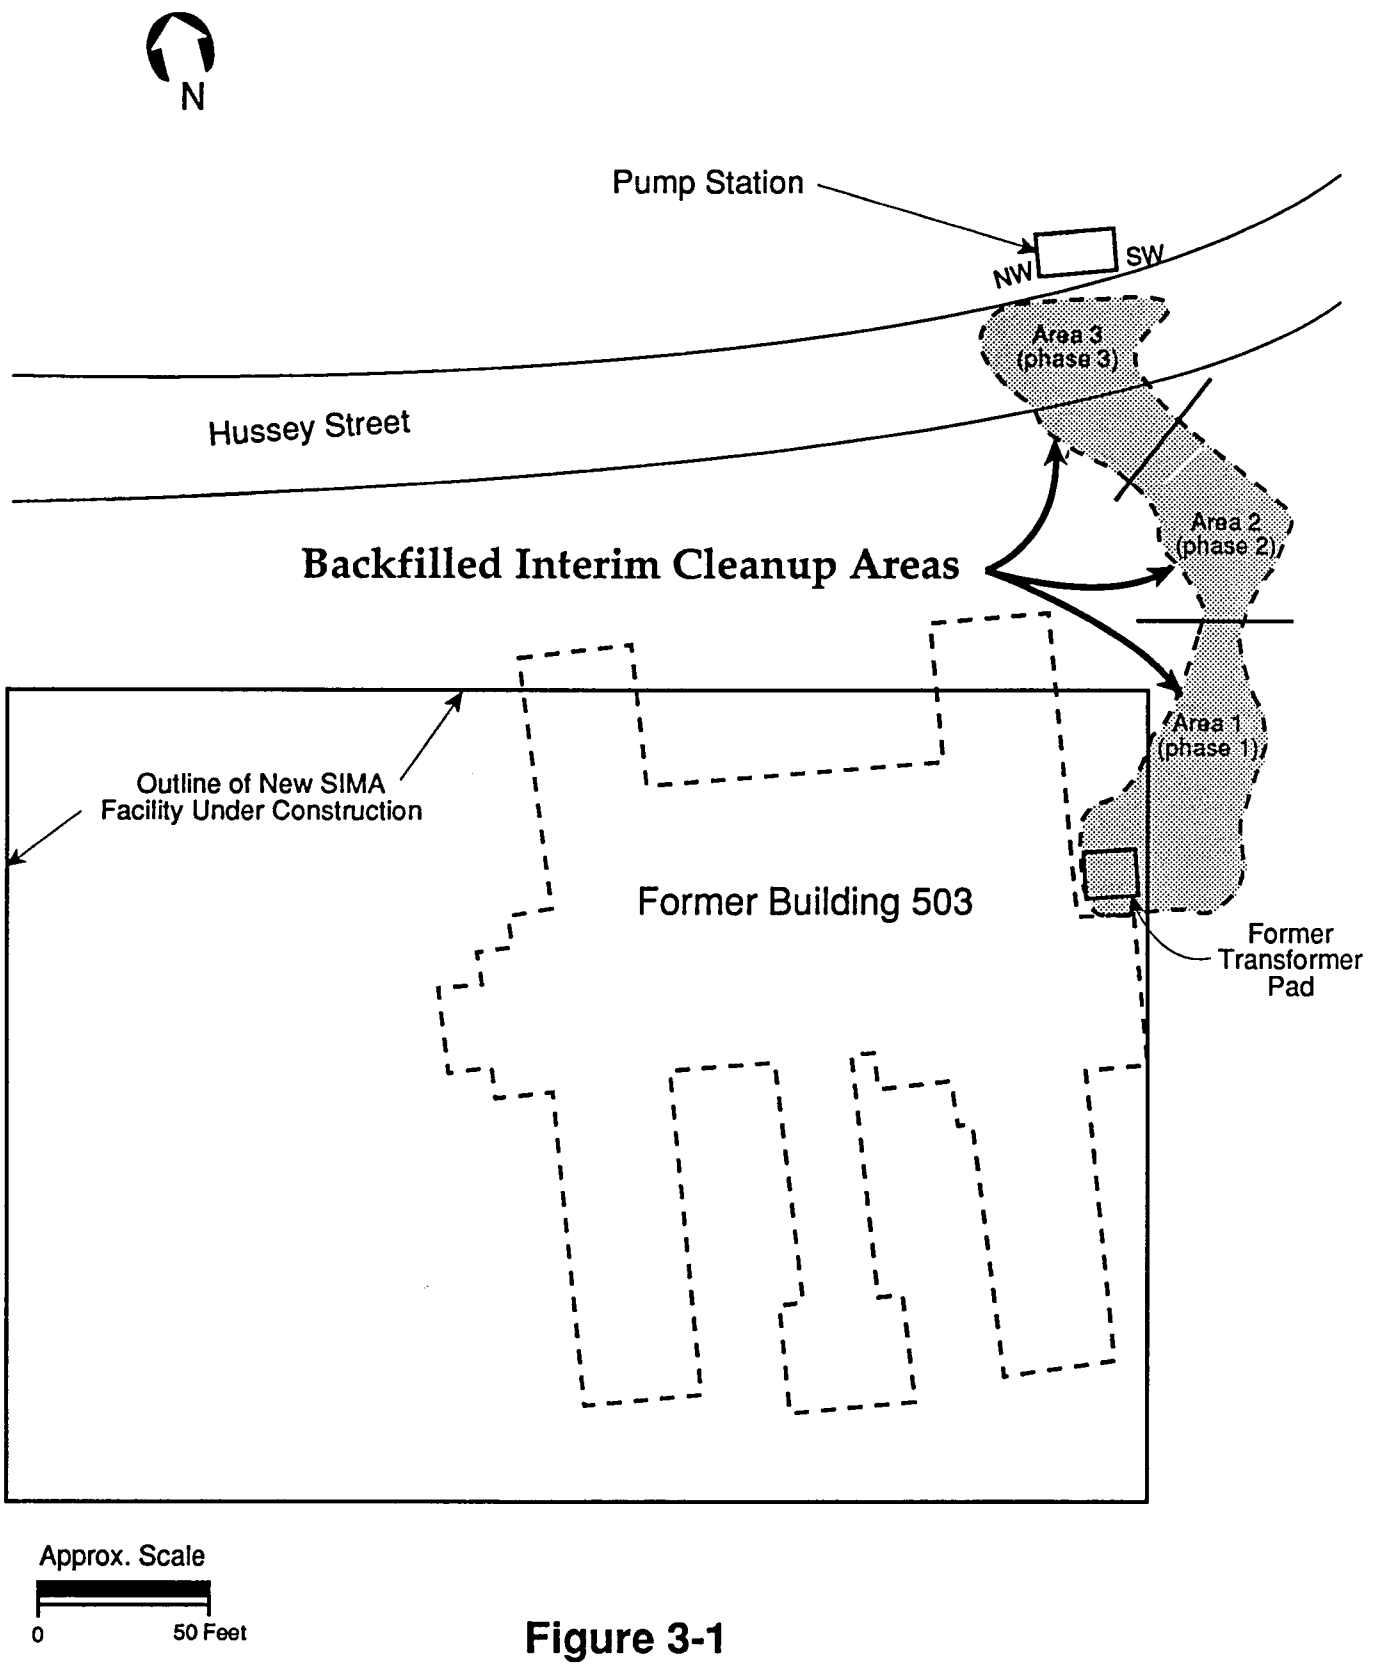

Figure 3-1

PCB Site-Work Areas

ERM-West 11/88
472.10/JPT10.30.88

TABLE 3-1

HUNTERS POINT ANNEX
TREASURE ISLAND NAVAL STATION

VERIFICATION SOIL SAMPLING RESULTS
FROM CENTRAL COAST ANALYTICAL SERVICES
FOR AREA 1

April 15 and May 18, 1987

Sample Description	Percent Moisture	PCBs[1] D.L.[2], mg/kg	Concentration[3]
F2	NA	0.1	3.5
F3	NA	0.1	1.0
G1	NA	0.1	4.2
G2	NA	0.1	0.4
H1	NA	0.1	2.0
H2	NA	0.1	0.4
H3	NA	0.1	3.6
H3(Dup)	NA	0.1	6.6
G4(5/1/87)	NA	0.01	0.41
X1	NA	0.01	0.30
X2	NA	0.01	0.49
X3	NA	0.01	0.03
X4	NA	0.01	0.08
X5	NA	0.01	0.02
X6	NA	0.01	0.02
X7	NA	0.01	0.04
X8	NA	0.01	<0.01
X9	NA	0.01	0.04
X10	NA	0.01	0.10
X11	NA	0.01	0.04
X12	NA	0.01	0.05
X12(Dup)	NA	0.01	0.05
X13	NA	0.01	0.25
X14	NA	0.01	0.10
X15	NA	0.01	0.08
X16	NA	0.01	0.16

Notes:

1. Only PCBs detected were Aroclor 1260.
2. D.L. is the detection limit.
3. Reported concentration of PCBs by the laboratory analysis.
4. NA - Not analyzed.

TABLE 3-2

HUNTERS POINT ANNEX
TREASURE ISLAND NAVAL STATION

VERIFICATION SOIL SAMPLING RESULTS
FROM CENTRAL COAST ANALYTICAL SERVICES
FOR AREA 2

September 3-4 and October 16, 1987

Sample Description	Percent Moisture	PCBs[1], D.L.[2]	mg/kg Concentration[3]
2A-1	6.0	0.2	<0.2
2A-2	3.2	0.02	5.0
2A-3	7.1	0.02	2.2
2A-4	2.7	0.02	0.61
2B-1	NA	0.02	<0.02
2B-2	16	0.02	16
2B-3	7.2	0.02	0.44
2B-3(Dup)	7.1	0.02	--
2B-4	5.1	0.02	1.0
2B-5	3.8	0.02	0.60
2B-6	NA	0.02	<0.02
2C-1	NA	0.02	0.04
2C-2	30	0.02	25
2C-3	12	0.02	3.2
2C-4	25	0.02	15
2C-5	NA	0.1	1.3
2C-5A	15	0.05	2.4
2C-5A(Dup)	15	0.05	2.7
2C-5A(Tripl)	15	0.05	2.9
2C-5B	21	0.05	11
2C-5C	19	0.05	1.5
2C-6	4.7	0.02	0.65
2C-7	NA	0.02	<0.02
2D-0	NA	0.02	<0.02
2D-1	30	0.02	3.5
2D-2	24	0.05	16
2D-3	31	0.02	4.3
2D-4	21	0.02	2.2
2D-5	1.2	0.02	2.2
2D-6	NA	0.02	<0.02

TABLE 3-2 (continued)

VERIFICATION SOIL SAMPLING RESULTS
FOR AREA 2

September 3-4 and October 16, 1987

Sample Description	Moisture Percent	PCBs[1], D.L.[2]	mg/kg Concentration[3]
2E-1	5.8	0.2	<0.2
2E-1(Dup)	5.8	0.2	<0.2
2E-2	18	0.05	3.0
2E-2(Dup)	18	0.05	3.0
2E-2A	5	0.05	2.2
2E-3	NA	0.05	7.9
2E-3A	20	0.05	15
2E-3B	16	0.05	0.79
2E-4	19	0.05	8.9
2E-4(Dup)	22	0.02	25
2E-4(Spike)	19	0.05	14
2E-5	20	0.02	4.6
2E-5(Dup)	20	0.02	4.2
2E-6	17	0.02	0.6
2E-7	NA	0.02	<0.02
2F-1	NA	0.02	<0.02
2F-2	25	0.02	3.4
2F-3	30	0.02	9.6
2F-4	17	0.02	8.4
2F-5	23	0.02	0.73
2F-6	1.6	0.02	0.6
2F-7	NA	0.02	<0.02
2G-1	NA	0.02	<0.02
2G-2	19	0.02	0.5
2G-3	19	0.02	2.0
2G-3(Dup)	19	0.02	3.8
2G-4	17	0.02	7.7
2G-5	32	0.02	7.0
2G-6	NA	0.02	<0.02
2H-1	NA	0.02	<0.02
2H-2	36	0.02	7.9
2H-3	20	0.02	13
2H-4	25	0.02	9.9

TABLE 3-2 (continued)

VERIFICATION SOIL SAMPLING RESULTS
FOR AREA 2

September 3-4 and October 16, 1987

Sample Description	Moisture Percent	PCBs[1], D.L.[2]	mg/kg Concentration[3]
2H-5	6.1	0.02	0.66
2H-6	NA	0.02	0.12
2H-6(Dup)	NA	0.02	0.13
BL-1	NA	0.02	0.17
BL-2	0.15	0.02	0.5

Notes:

1. Only PCBs detected were Aroclor 1260.
2. D.L. is the detection limit.
3. Concentration of PCB detected by the laboratory analysis.
4. NA = Not analyzed.

TABLE 3-3

HUNTERS POINT ANNEX
TREASURE ISLAND NAVAL STATION

VERIFICATION SOIL SAMPLING RESULTS
FROM CENTRAL COAST ANALYTICAL SERVICES
FOR AREA 3

August 5-8, 1988

Sample Description	Percent Moisture	PCBs[1], D.L.[2],	mg/kg Concentration[3]
3A-9	7.8	1.0	<1.0
3A-11	7.4	1.0	<1.0
3A-13	22	1.0	<1.0
3B-6	4.4	1.0	<1.0
3B-8	13	1.0	4
3B10	22	1.0	9
3B10(Dup)	NA	1.0	9
3B12	25	1.0	<1.0
3B16	8.0	1.0	<1.0
3B18	7.9	1.0	<1.0
3C-5	7.2	1.0	<1.0
3C-7	22	1.0	5
3C-9	20	1.0	<1.0
3C-11	20	1.0	<1.0
3C-13	22	1.0	6
3C-15	11	1.0	5
3C-17	6.7	1.0	<1.0
3C-19	30	1.0	<1.0
3D-4	6.5	1.0	<1.0
3D-6	19	1.0	2
3D-8	16	1.0	<1.0
3D-8 (Dup)	NA	1.0	<1.0
3D-10	14	1.0	3
3D-10(Dup)	NA	1.0	3
3D-12	18	1.0	<1.0
3D-14	17	1.0	4
3D-16	12	1.0	<1.0
3D-18	11	1.0	<1.0

TABLE 3-3 (Continued)

HUNTERS POINT ANNEX
TREASURE ISLAND NAVAL STATION

VERIFICATION SOIL SAMPLING RESULTS
FROM CENTRAL COAST ANALYTICAL SERVICES
FOR AREA 3

August 5-8, 1988

Sample Description	Percent Moisture	PCBs[1], D.L.[2],	mg/kg Concentration[3]
3E-5	12	1.0	<1.0
3E-7	32	1.0	15
3E-7(Dup)	NA	1.0	23
3E-9	21	1.0	14
3E-9(Dup)	NA	1.0	17
3E-11	17	1.0	<1.0
3E-13	23	1.0	3
3E-15	13	1.0	<1.0
3E-17	13	1.0	<1.0
3F-4	8.0	1.0	<1.0
3F-6	20	1.0	7
3F-8	19	1.0	4
3F-10	14	1.0	2
3F-12	19	1.0	<1.0
3F-14	17	1.0	<1.0
3F-16	16	1.0	<1.0
3G-5	11	1.0	<1.0
3G-7	13	1.0	<1.0
3G-9	23	1.0	9
3G-11	18	1.0	2
3G-13	22	1.0	2
3G-15	5.3	1.0	<1.0
3H-6	7.1	1.0	<1.0
3H-8	17	1.0	<1.0
3H-10	15	1.0	<1.0
3H-12	9.0	1.0	<1.0
3H-14	12	1.0	1.0

TABLE 3-3 (Continued)

HUNTERS POINT ANNEX
TREASURE ISLAND NAVAL STATION

VERIFICATION SOIL SAMPLING RESULTS
FROM CENTRAL COAST ANALYTICAL SERVICES
FOR AREA 3

August 5-8, 1988

Sample Description	Percent Moisture	PCBs[1], D.L.[2],	mg/kg Concentration[3]
3J-9	11	1.0	<1.0
3J-11	17	1.0	2
3J-13	19	1.0	<1.0
3K-10	8.9	1.0	<1.0
3K-12	8.4	1.0	18
3K-12(Dup)	NA	1.0	17

Notes:

1. Only PCBs detected were Aroclor 1260.
2. D.L. is the detection limit.
3. Concentration of PCBs detected in the laboratory analysis.
4. NA = Not analyzed.

APPENDIX B

PRELIMINARY SURVEY - SOIL SAMPLING RESULTS

Notes:

1. Boring and sample numbering correspond to circled numbers on report Figure 2-2

2. Table taken from reference 2

3. ANLAB was the certified laboratory used to analyze the soil samples

TABLE 1

HUNTER'S POINT PCB INVESTIGATION
OCTOBER 1986

BORING & SAMPLE NUMBER	DATE	TIME	McGRAW-EDISON FIELD KIT			ANLAB ANALYSIS		
			PROBE RESPONSE MV	ppm PCB IN SOIL AROCLOR 1242	AROCLOR 1260	AROCLOR 1242	AROCLOR 1260	EPA 8010
1	150CT86	940	156/167	<36	<16	X	X	X
2	150CT86	955	124/117	44/60	20/26	X	26	X
3	150CT86	1010	155	<36	<16	X	X	<0.05
4	150CT86	1050	159	<36	<16	X	X	<0.05
5	150CT86	1110	163	<36	<16	X	X	X
6	150CT86	1640	156	<36	<16	X	<0.1	X
7	150CT86	1100	159	<36	<16	X	X	X
10	150CT86	1537	171	<36	<16	X	X	X
11	150CT86	1500	169	<36	<16	X	X	X
12	150CT86	1130	160	<36	<16	X	X	X
13	150CT86	1430	163	<36	<16	X	X	X
14	150CT86	1306	161	<36	<16	X	X	X
15	150CT86	1233	165	<36	<16	X	X	X
16	160CT86	1012	158	<36	<16	X	X	X
17	160CT86	918	161	<36	<16	X	X	X

BORING & SAMPLE NUMBER	DATE	TIME	McGRAW-EDISON FIELD KIT PROBE RESPONSE MV	ppm PCB IN SOIL AROCLOR 1242	AROCLOR 1260	ANLAB ANALYSIS AROCLOR 1242	AROCLOR 1260	EPA 8010
18	150CT86	1546	171/170	<36	<16	X	X	X
19	150CT86	1600	171	<36	<16	X	X	X
20	150CT86	1314	149/141	<36	<16	X	X	X
21	150CT86	1557	167	<36	<16	X	X	X
22	150CT86	1155	157	<36	<16	X	X	X
23	160CT86	1036	157	<36	<16	X	X	X
24	160CT86	930	156/158	<36	<16	X	X	X
25	150CT86	1145	165	<36	<16	X	X	X
26	160CT86	1110	163	<36	<16	X	X	X
27	150CT86	1200	163/160	<36	<16	X	X	X
28	160CT86	1003	159	<36	<16	X	X	X
29	160CT86	955	154	<36	<16	X	X	X
30	160CT86	942	155	<36	<16	X	X	X
31	160CT86	1031	158	<36	<16	X	X	X
32	160CT86	1044	161	<36	<16	X	X	X
33	160CT86	1051	158	<36	<16	X	X	X
35	160CT86	1058	153	<36	<16	X	X	X
36	160CT86	1105	155	<36	<16	X	X	X

BORING & SAMPLE NUMBER	DATE	TIME	McGRAW-EDISON FIELD KIT PROBE RESPONSE MV	ppm PCB IN SOIL AROCLOR 1242	AROCLOR 1260	ANLAB ANALYSIS AROCLOR 1242	AROCLOR 1260	EPA 8010
37	150CT86	1035	156	<36	<16	X	X	X
38	150CT86	1030	159	<36	<16	X	X	X
40	150CT86	1225	156	<36	<16	X	X	X
41	160CT86	1015	159	<36	<16	X	X	X
42	150CT86	1210	158	<36	<16	X	X	X
43	150CT86	1302	166	<36	<16	X	X	X
44	150CT86	1255	160	<36	<16	X	X	X
45	160CT86	1025	157/160	<36	<16	X	X	X
46	150CT86	1246	168	<36	<16	X	X	X
2A	150CT86	1615	-.019	>7260	>4200	X	810	X
2B	150CT86	1620	166	<36	<16	X	X	X
2C	150CT86	1631	168	<36	<16	X	X	X
2D(3ft)	160CT86	813	158	<36	<16	X	X	X
2D(5ft)	160CT86	815	162	<36	<16	X	X	X
2E(3ft)	160CT86	854	168	<36	<16	X	X	X
2E(5ft)	160CT86	856	159	<36	<16	X	X	X
2F(3ft)	160CT86	843	165	<36	<16	X	X	X
2F(5ft)	160CT86	845	158	<36	<16	X	X	X

BORING & SAMPLE NUMBER	DATE	TIME	McGRAW-EDISON FIELD KIT PROBE RESPONSE MV	ppm PCB IN SOIL AROCLOR 1242	AROCLOR 1260	ANLAB AROCLOR 1242	ANALYSIS AROCLOR 1260	EPA 8010
2G(3ft)	160CT86	832	134/136	<36	<16	X	7	X
2G(5ft)	160CT86	835	156/155	<36	<16	X	2	X
2H(3ft)	160CT86	823	164	<36	<16	X	X	X
2H(5ft)	160CT86	825	159	<36	<16	X	X	X
2J(3ft)	160CT86	900	163	<36	<16	X	X	X
2J(5ft)	160CT86	903	163	<36	<16	X	X	X
2K	160CT86	1208	163	<36	<16	X	X	X
2L	160CT86	1200	157	<36	<16	X	X	X
2M	160CT86	1315	160	<36	<16	X	X	X
2N	160CT86	1219	162	<36	<16	X	X	X
2"O"	160CT86	1224	156/156	<36	<16	X	X	X
2P	160CT86	1230	158	<36	<16	X	<0.1	X
2Q(6"-12")	160CT86	1242	76	324	128	X	770	X
2Q(3ft)	160CT86	1238	155	<36	<16	X	<0.1	X
2Q(5ft)	160CT86	1239	----	<36	<16	X	<0.1	X
2R(3ft)	160CT86	1300	23/34	2830/1800	1000/652	X	910	X
2R(5ft)	160CT86	1302	35/37	1730/1594	628/580	X	180	X
2S	160CT86	1247	142/143	<36	<16	X	<0.1	X

McGRAW-EDISON FIELD KIT

BORING & SAMPLE NUMBER	DATE	TIME	PROBE RESPONSE MV	ppm PCB IN SOIL AROCLOR 1242	ppm PCB IN SOIL AROCLOR 1260	ANLAB ANALYSIS AROCLOR 1242	ANLAB ANALYSIS AROCLOR 1260	ANLAB ANALYSIS EPA 8010
2T	160CT86	1259	153	<36	<16	X	X	X
2U	160CT86	128	154	<36	<16	X	X	X

APPENDIX C

GROUND WATER STUDY
SOIL/GROUNDWATER DATA AND GEOLOGIC CROSS SECTION

APPENDIX C – GROUNDWATER STUDY
SOIL/GROUNDWATER DATA AND GEOLOGIC CROSS SECTION

THIS APPENDIX IS COMPLETE AS SUBMITTED.

FOR ADDITIONAL INFORMATION, CONTACT:

DIANE C. SILVA, RECORDS MANAGER
NAVAL FACILITIES ENGINEERING COMMAND, SOUTHWEST
1220 PACIFIC HIGHWAY
SAN DIEGO, CA 92132

TELEPHONE: (619) 532-3676
E-MAIL: diane.silva@navy.mil

TABLE 2-1

SUMMARY OF SUBSURFACE SOIL ANALYSES

Well or Boring Number	Sample Date	Sample Depth	PCB Conc. (mg/kg)
W1	1/7/87	10"-14"	28
W1	1/7/87	3"3"-3'9"	2.4
W1	1/7/87	5'0"-5'6"	32
W1	1/7/87	7'6"-8'0"	1
W1	1/7/87	10'0"-10'4"	4
W1	1/7/87	15'0"-15'6"	<0.1
W1	1/7/87	16'0"-17'0"	<0.1
W1	1/7/87	20'0"-20'6"	24
B1a	1/9/87	1'0" - 1'6"	1.2
B1a	1/9/87	3'0" - 3'6"	2
W2	1/7/87	5'0" - 5'6"	5
W2	1/7/87	7'6" - 8'0"	4.3
W2	1/7/87	10'0"-10'6"	6
W2	1/7/87	11'0"-11'6"	<0.1
W2	1/7/87	12'6"-13'0"	0.6
W2	1/7/87	14'2"-14'8"	12
W3	1/8/87	2'6"- 3'0"	5.6
W3	1/8/87	0'6"- 15'0"	0.1
W4	1/8/87	2'6"- 3'0"	0.7
W4	1/8/87	0'6"- 14'8"	<0.1
W5	1/8/87	3'0"-3'6"	0.1
W5	1/8/87	0'6"-14'8"	<0.1
W6	1/9/87	3'0"-3'6"	<0.1
W6	1/9/87	0'6"-18'0"	0.1
W7	1/9/87	2'6"-2'10"	<0.1
W7	1/9/87	0.6"-15'0"	<0.1
B8	2/23/87	7'0"-7'6"	0.21
B9	2/23/87	2'6"-3'0"	0.05
B9	2/23/87	5'3"-5'9"	0.05
B9	2/23/87	3'6"-32'0"	0.05
B10	2/24/87	3'4"-3'10"	0.56
B10	2/24/87	5'2"-5'8"	0.06
B10	2/24/87	27'0"-27'6"	0.05

TABLE 2-5

SUMMARY OF GROUNDWATER AND SURFACE WATER ANALYSIS

SAMPLE LOCATION	SAMPLING DATE	PCB CONC. (mg/l)
W1	1/9/87	0.004
	3/1/87	<0.0005
W2	1/9/87	<0.001
	3/1/87	0.0007
W3	1/9/87	<0.001
	3/1/87	<0.0005
W4	1/9/87	<0.001
	3/1/87	<0.0005
W5	1/9/87	<0.001
	3/1/87	<0.0005
W6	1/12/87	<0.1
W7	1/12/87	<0.1
Catch Basin #1	1/9/87	0.004
Surface Seepage*	4/24/87	<0.0002

* Groundwater that filled excavation resulting from removal of transformer pad.

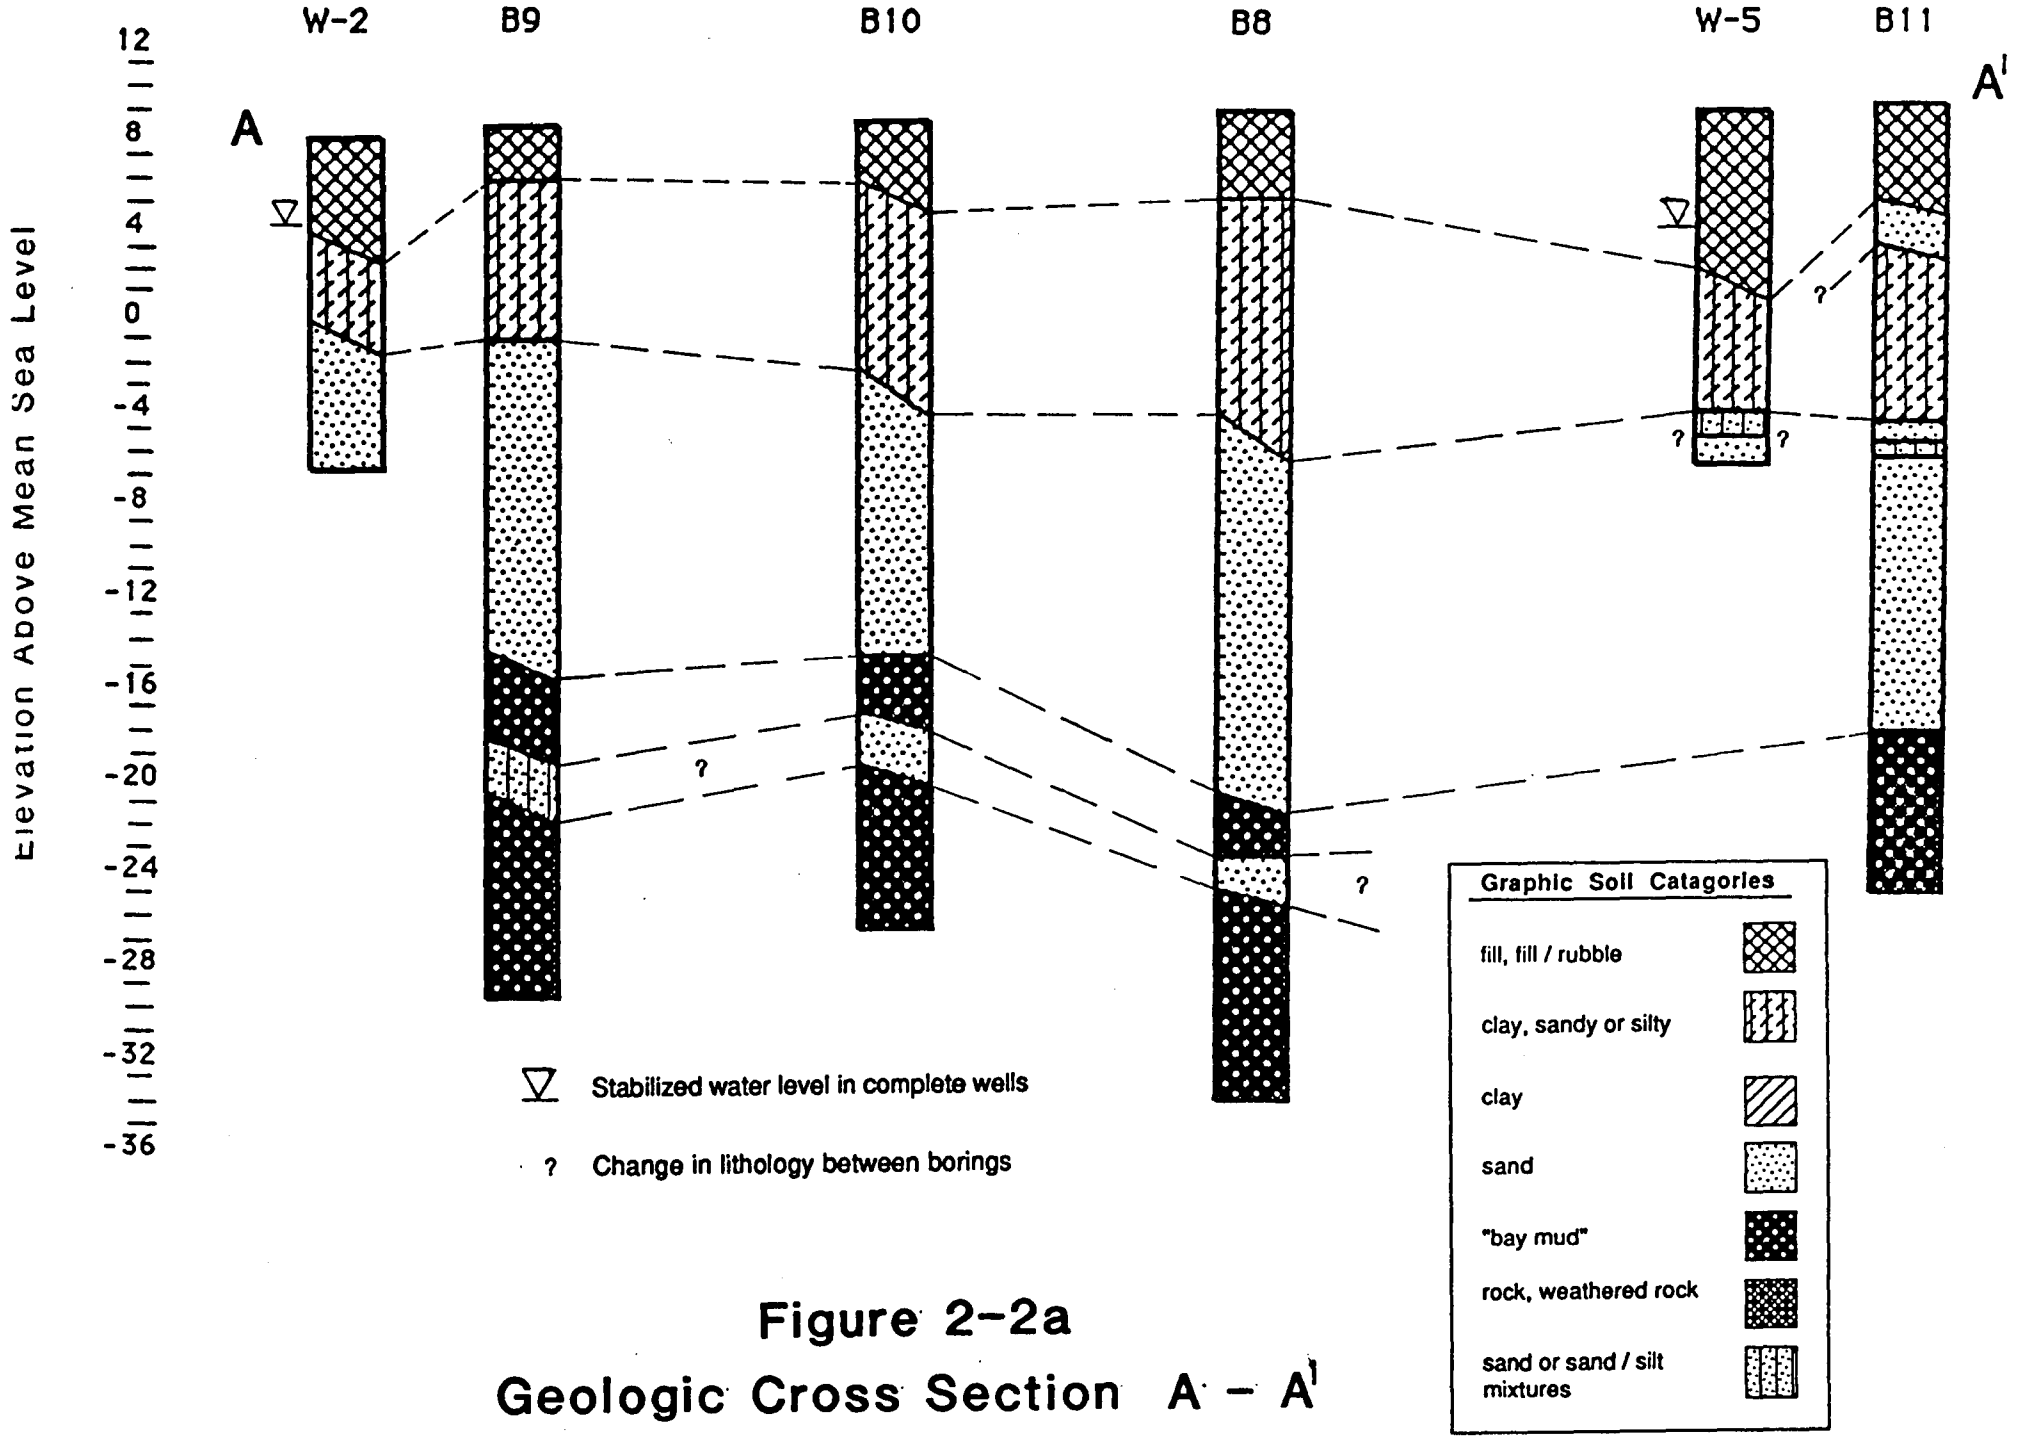

Figure 2-2a
Geologic Cross Section A – A'

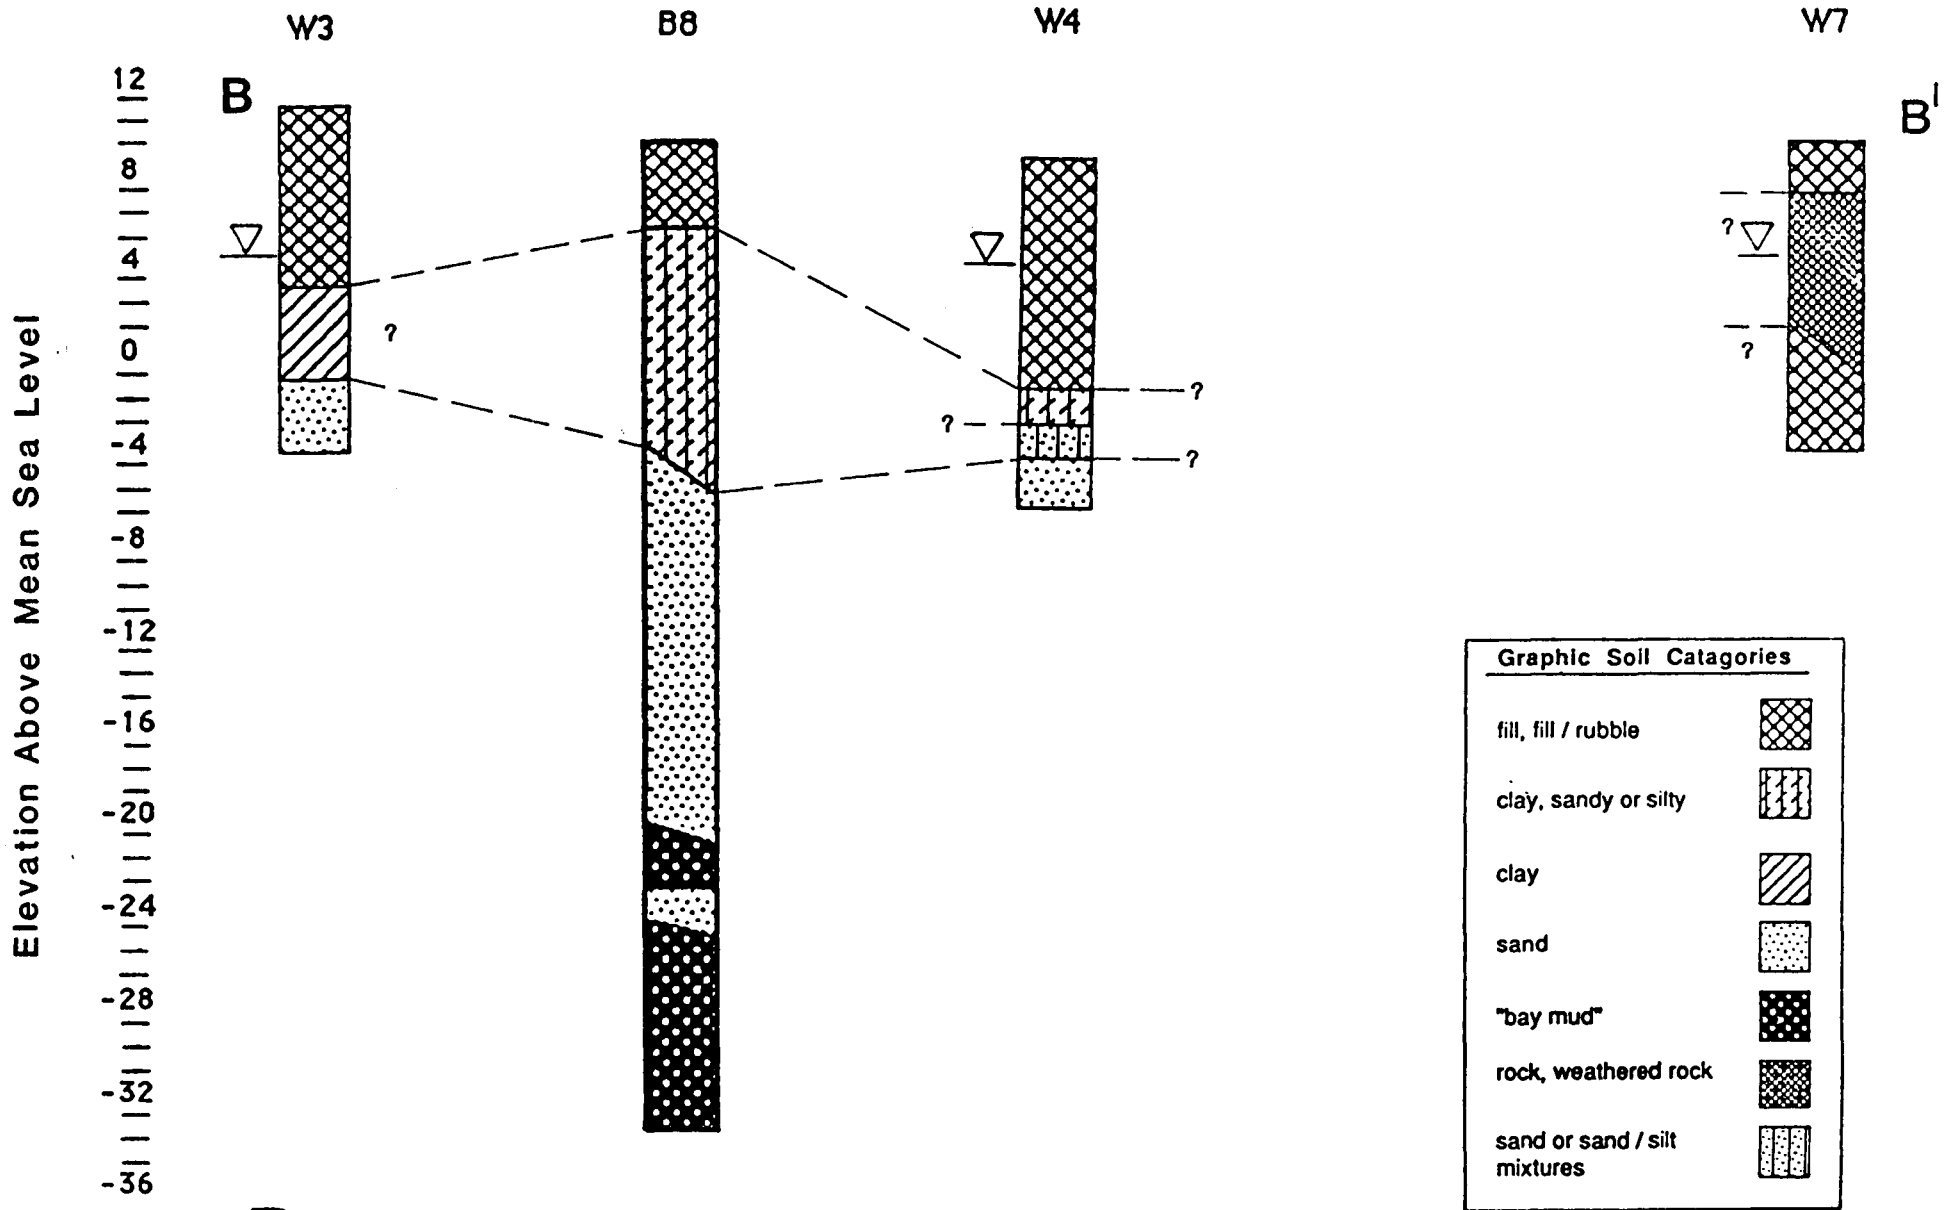

FIGURE 2-2b

Geologic Cross Section B - B'

APPENDIX D

VERIFICATION SOIL SAMPLING RESULTS
LABORATORY DATA REPORTS

D-1 AREA 1 (Interim Report)
D-2 AREA 2
D-3 AREA 3

D-1 AREA 1 (Interim Report)

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 04/15/87
Received: 04/16/87 @ 1720
Tested: 04/19/87
Collected by: Dan Cutugno

ERM WEST
177 Botelho Drive
Suite 260
Walnut Creek, CA 94596

Sample Description:

US Navy Hunters Point, San Francisco, CA, Soil Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	LEVEL FOUND - mg/kg
		POLYCHLORINATED BIPHENYLS AROCLOR 1260
EPA METHOD NUMBER----------		608/8080
DETECTION LIMIT----------		0.01
D-2680-2683	Composite A1, A2, B1, B2	71.
D-2684-2688	Composite C1, C2, D1, D2, D3	1.1
D-2689-2692	Composite E1, E2, E3, F1	2.1
D-2693-2696	Composite F2, F3, G1, G2	10.
D-2697-2700	Composite G4, H1, H2, H3	31.
QD-2697-2700	Duplicate of Above Sample	21.

Compositing was done as follows: Each soil sample (20g) was ground with a mortar and pestle then passed through a #10 sieve. The four ground and sieved discrete samples (20g each) were placed in a clean jar and mixed together. Approximately 20g of the resulting 80g composite was extracted using EPA Method 3550.

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D2680COM.WR1/16
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 04/15/87
Received: 04/16/87 @ 1720
Tested: 04/22/87
Collected by: Dan Cutugno

ERM WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596

Sample Description:

Project #400-30
US Navy Hunter's Point
Soil Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	LEVEL FOUND - mg/kg
		POLYCHLORINATED BIPHENYLS AROCLOR 1260
EPA METHOD NUMBER----------		8080
		DETECTION LIMIT
000VD02A	Instrument Blank	0.02 <0.02
QH0421	Sonic Horn Extraction Blank	0.02 <0.02
D-2680	Soil A1	0.02 4.9
D-2681	Soil A2	0.2 46.
D-2682	Soil B1	0.02 32.
D-2683	Soil B2	0.2 190.
D-2697	Soil G4	0.2 35.
D-2699	Soil H3	0.2 3.6
QD-2699	Duplicate of Above	0.2 6.6
D-2700	Soil H1	0.2 2.0

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D2680ERM.WR1/17
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 04/15/87
Received: 04/16/87
Tested: 05/01/87
Collected by: Dan Cutugno

ERM WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596

Sample Description:

US Navy, Hunters Point
Soil Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	LEVEL FOUND -mg/kg
		POLYCHLORINATED BIPHENYLS AROCLOR 1260
EPA METHOD NUMBER----------		608/8080
DETECTION LIMIT----------		0.1
D-2693	Soil F-2	3.5
D-2694	Soil F-3	1.0
D-2695	Soil G-1	4.2
D-2696	Soil G-2	0.4

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D2693ERM.WR1/21
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

Lab Number: As Listed
Collected: Ø5/18/87
Received: Ø5/19/87 @ ØØØØ
Tested: Ø5/21/87
Collected by: Dennis Miller

ERM-WEST
1777 Botelho Drive
Suite 26Ø
Walnut Creek, CA 94596

Sample Description:

Job #4ØØ3Ø US Navy, Hunter's Point
Soil Samples As Listed

LAB NUMBER	REPORT SAMPLE DESCRIPTION	LEVEL FOUND - mg/kg
		POLYCHLORINATED BIPHENYLS AROCLOR 126Ø
EPA METHOD NUMBER----------		6Ø8/8Ø8Ø
DETECTION LIMIT----------		Ø.Ø1
D-36ØØ	X1 @ 2'6"	Ø.3Ø
D-36Ø1	X2 @ 2'2"	Ø.49
D-36Ø2	X3 @ 2'4"	Ø.Ø3
D-36Ø3	X4 @ 2'Ø"	Ø.Ø8
D-36Ø4	X5 @ 2'Ø"	Ø.Ø2
D-36Ø5	X6 @ 2'2"	Ø.Ø2
D-36Ø6	X7 @ 1'11"	Ø.Ø4
D-36Ø7	X8 @ 1'1Ø"	<Ø.Ø1
D-36Ø8	X9 @ 2'1"	Ø.Ø4
D-36Ø9	X1Ø @ 1'9"	Ø.1Ø
D-361Ø	X11 @ 2'Ø"	Ø.Ø4
D-3611	X12 @ 2'4"	Ø.Ø5
QD-3611	DUPLICATE	Ø.Ø5
D-3612	X13 @ 2'Ø"	Ø.25
D-3613	X14 @ 2'Ø"	Ø.1Ø
D-3614	X15 @ 2'Ø"	Ø.Ø8
D-3615	X16 @ 2'6"	Ø.16

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D36ØØPCB.WR1
MH/ke

D-2 AREA 2

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

Lab Number: As Listed
Collected: Ø9/Ø4/87
Received: Ø9/Ø5/87
Tested: As Listed
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Drive
Suite 26Ø
Walnut Creek, CA 94523

Sample Description:

Hunter's Point, U.S. Navy
Project Ø4ØØ-36
Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	PERCENT MOISTURE	LEVEL FOUND - POLYCHLORINATED BIPHENYLS AROCLOR 126Ø mg/kg (Wet Weight)
		Percent	
EPA METHOD NUMBER----------		16Ø.3	8ØØØ
DETECTION LIMIT----------		Ø.ØØ5	Ø.Ø2
DATE TESTED/ANALYST----------		9/11/87/LD	9/Ø8-15/87/ARP
D-695Ø	2A-2	3.2	5.Ø
D-6951	2A-3	7.1	2.2
D-6952	2A-4	2.7	Ø.61
D-6953	2B-2	16.	16.
D-6954	2B-3	7.2	Ø.44
QD-6954	DUPLICATE	7.1	---
D-6955	2B-4	5.1	1.Ø
D-6956	2B-5	3.8	Ø.6Ø
D-6957	2C-3	12.	3.2

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES

Mary Havlicek, Ph.D., President

D695ØERM.WR1
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 09/03/87
Received: 09/04/87
Tested: 09/07/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94598

Sample Description:

U.S. Navy Hunter's Point
Project #4055-36

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	TOTAL LEVEL FOUND- milligrams/kg (Wet Weight)
		POLYCHLORINATED BIPHENYLS
EPA METHOD NUMBER----------		8080
DETECTION LIMIT----------		0.02
DATE TESTED/ANALYST----------		9/7/87/ARP
D-6886	2H-1 @ 1'6"-2'0"	<0.02
D-6887	2G-1 @ 1'8"-2'3"	<0.02
D-6888	2F-1 @ 1'5"-2'0"	<0.02
D-6889	2D-0 @ 2'3"-2'8"	<0.02
D-6890	2B-6 @ 1'6"-2'0"	<0.02
D-6891	2C-7 @ 2'7"-3'1"	<0.02
D-6892	2D-6 @ 1'6"-2'0"	<0.02
D-6893	2E-7 @ 1'8"-2'2"	<0.02
D-6894	2F-7 @ 1'10"-2'4"	<0.02
D-6895	2G-6 @ 2'4"-2'10"	<0.02
D-6896	2H-6 @ 1'4"-1'10"	0.12
QD-6896	DUPLICATE	0.13
D-6897	2B-1 @ 1'8"-2'2"	<0.02
D-6898	2C-1 @ 1'6"-2'0"	0.04
D-6899	BL-1 @ 1'6"-2'0"	0.17

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D6886ERM.WR1
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 09/04/87
Received: 09/05/87
Tested: As Listed
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94523

Sample Description:

Hunter's Point, U.S. Navy
Project #4006-36
Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	PERCENT MOISTURE	POLYCHLORINATED BIPHENYLS AROCLOR 1260
		Percent	mg/kg (Wet Weight)
EPA METHOD NUMBER----------		160.3	8080
DETECTION LIMIT----------		0.005	0.02
DATE TESTED/ANALYST----------		9/11/87/LD	9/08-15/87/ARP
D-6958	2C-4	25.	15.
D-6959	2D-1	30.	3.5
D-6960	2D-2	41.	21.
D-6961	2D-3	31.	4.3
D-6962	2D-4	21.	2.2
D-6963	2D-5	1.2	2.2
D-6964	2E-2	41.	36.
D-6965	2E-3	25.	59.
D-6966	2E-5	20.	4.6
QD-6966	DUPLICATE	20.	4.2
D-6967	2E-6	17.	0.60
D-6968	2F-2	25.	3.4
D-6969	2F-3	30.	9.6

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES
Mary Havlicek
Mary Havlicek, Ph.D., President

D6958ERM.WR1
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 09/04/87
Received: 09/05/87
Tested: As Listed
Collected by: Richard Knapp

ERM-WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94523

Sample Description:

Hunter's Point, U.S. Navy
Project #4505-36
Samples As Listed

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	PERCENT MOISTURE	LEVEL FOUND - POLYCHLORINATED BIPHENYLS AROCLOR 1260
		Percent	mg/kg (Wet Weight)
EPA METHOD NUMBER----------		160.3	8080
DETECTION LIMIT----------		0.005	0.02
DATE TESTED/ANALYST----------		9/11/87/LD	9/11/87/ARP
D-6970	2F-4	17.	8.4
D-6971	2F-5	23.	0.73
D-6972	2F-6	1.6	0.6
D-6973	2G-2	19.	0.50
D-6974	2G-3	19.	2.0
QD-6974	DUPLICATE	19.	3.8
D-6975	2G-5	32.	7.0
D-6976	2H-2	36.	7.9
D-6977	2H-3	20.	13.0
D-6978	2H-4	25.	9.9
D-6979	2H-5	6.1	0.66
D-6980	BL-2	0.15	0.50

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES

Mary Havlicek, Ph.D., President

D6970ERM.WR1
MH/ke

c[<1[10m AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of PUBLIC HE

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: As Listed
Collected: 10/16/87
Received: 10/17/87
Tested: As Listed
Collected by: D. Catugno

ERM-WEST
1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596

Sample Description:

US Navy, Hunter's Point
Project #4005-36, S.F.

REPORT

LAB NUMBER	SAMPLE DESCRIPTION	PERCENT MOISTURE %	PERCENT SOLID %
EPA METHOD NUMBER----------		160.3	160.3
DETECTION LIMIT----------		0.005	0.005
DATE TESTED/ANALYST----------		10/21/87/RDM	10/21/87/RDM
D-8233	Sample #2C-5A	15.	85.
D-8234	Sample #2C-5B	21.	79.
D-8235	Sample #2C-5C	19.	81.
D-8236	Sample #2E-4	19.	81.
D-8237	Sample #2D-2	24.	76.
D-8238	Sample #2E-3B	16.	84.
D-8239	Sample #2E-3A	20.	80.
D-8240	Sample #2E-2A	5.	95.
D-8241	Sample #2E-2	18.	82.

Respectfully submitted,
CENTRAL COAST ANALYTICAL SERVICES

Mary Havlicek

Mary Havlicek, Ph.D., President

D8233ERM.WR1
MH/ke

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7239
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#500,2A-1, %m=6.8;%s=20
PROJECT #400-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.2	not found
PCB 1221	0.2	not found
PCB 1232	0.2	not found
PCB 1242	0.2	not found
PCB 1248	0.2	not found
PCB 1254	0.2	not found
PCB 1260	0.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7239PC.WR1
MH/TK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7245
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#512,2C-2, %m=30;%s=38
PROJECT #4055-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	25.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7245PC.WR1
MH/TK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553
EPA METHOD 608/8080 - PCB'S

Lab Number: D-7242
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#509,2C-5, %m<0.1;%s=17
PROJECT #400-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	51.

Compounds listed as "not found", would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7242PC.WR1
MH/GH/ARP/ARP

c[<1[1ømAIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICE

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Øl
(8Ø5) 543-2553
EPA METHOD 6ØØ/8ØØØ - PCB'S

Lab Number: D-8552
Collected: 1Ø/16/87
Received: 1Ø/26/87
Tested: 11/Ø5/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
2c-5, Hunter's Point, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.1	not found
PCB 1221	Ø.1	not found
PCB 1232	Ø.1	not found
PCB 1242	Ø.1	not found
PCB 1248	Ø.1	not found
PCB 1254	Ø.1	not found
PCB 126Ø	Ø.1	1.3

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/28/87

Respectfully submitted,

Mary Havlicek, Ph.D.

D8552pc.wr1/3
MH/gh/arp/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553
EPA METHOD 608/8080 - PCB'S

Lab Number: QT-8241
Collected: 10/16/87
Received: 10/17/87
Tested: 10/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2C-5A
PROJECT #4005-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.05	not found
PCB 1221	0.05	not found
PCB 1232	0.05	not found
PCB 1242	0.05	not found
PCB 1248	0.05	not found
PCB 1254	0.05	not found
PCB 1260	0.05	2.7

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 10/20/87 .

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QT8241pc.wr1
MH/JK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-8233
Collected: 10/16/87
Received: 10/16/87
Tested: 10/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2C-5A
PROJECT #455-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.05	not found
PCB 1221	0.05	not found
PCB 1232	0.05	not found
PCB 1242	0.05	not found
PCB 1248	0.05	not found
PCB 1254	0.05	not found
PCB 1260	0.05	2.4

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 10/20/87 .

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D8233PC.WR1
MH/GH/ARP/ARP

c[<1[1ØmAIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553
EPA METHOD 6Ø8/8Ø8Ø - PCB's

Lab Number: QQ-8241
Collected: 1Ø/16/87
Received: 1Ø/17/87
Tested: 1Ø/23/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94598

SAMPLE DESCRIPTION:
Erm West: Navy, Hunter's Point
2C-5A
PROJECT Ø4ØØ-38

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	2.9

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek, Ph.D.

QQ8241PC.WR1
MH/GH/ARP/ARP

c[<1[1¶¤ AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVIC

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934¶1
(8¶5) 543-2553
EPA METHOD 6¶¶/8¶¶¶ - PCB'S

Lab Number: D-8234
Collected: 1¶/16/87
Received: 1¶/17/87
Tested: 1¶/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26¶
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2C-5¶
PROJECT #4¶¶-36

Compound Analyzed	Detection Limit milligroms/Kg	Concentration milligrams/Kg
PCB 1¶16	¶.¶5	not found
PCB 1221	¶.¶5	not found
PCB 1232	¶.¶5	not found
PCB 1242	¶.¶5	not found
PCB 1248	¶.¶5	not found
PCB 1254	¶.¶5	not found
PCB 126¶	¶.¶5	11.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1¶/2¶/87 .

Respectfully submitted,

Mary Havlicek, Ph.D.

D8234PC.WR1
MH/JK/ARP/ARP

c[<1[1ßa AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI(

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934ß1
(8ß5) 543-2553
EPA METHOD 6ß8/8ß8ß - PCB'S

Lab Number: D-8235
Collected: 1ß/16/87
Received: 1ß/16/87
Tested: 1ß/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26ß
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2C-5C
PROJECT #4ßß-38

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1ß16	ß.ß5	not found
PCB 1221	ß.ß5	not found
PCB 1232	ß.ß5	not found
PCB 1242	ß.ß5	not found
PCB 1248	ß.ß5	not found
PCB 1254	ß.ß5	not found
PCB 126ß	ß.ß5	1.5

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1ß/2ß/87 .

Respectfully submitted,

Mary Havlicek, Ph.D.

D8236PC.WR1
MH/JK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7241
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Don Catugno

ERM-WEST
1777 Botelho Dr.,Suite 265
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#502,2C-6, %m=4.7;%s=19
PROJECT #400-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	0.65

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek, Ph.D.

D7241PC.WR1
MH/TK/ARP/ARP

c[<1[1ßm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934ß1
(8ß5) 543-2553
EPA METHOD 6ß8/8ß8ß - PCB'S

Lab Number: D-8237
Collected: 1ß/16/87
Received: 1ß/17/87
Tested: 1ß/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26ß
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2D-2
PROJECT #4ßß-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1ß16	ß.ß5	not found
PCB 1221	ß.ß5	not found
PCB 1232	ß.ß5	not found
PCB 1242	ß.ß5	not found
PCB 1248	ß.ß5	not found
PCB 1254	ß.ß5	not found
PCB 126ß	ß.ß5	16.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1ß/2ß/87 .

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D8237PC.WR1
MH/JK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: QD-7248
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#502,2E-1, %m=5.8;%s=15
PROJECT #4008-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.2	not found
PCB 1221	0.2	not found
PCB 1232	0.2	not found
PCB 1242	0.2	not found
PCB 1248	0.2	not found
PCB 1254	0.2	not found
PCB 1260	0.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QD7248PC.WR1
MH/TK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7240
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#502,2E-1, %m=5.8;%s=15
PROJECT #4006-36

s/be HML# 501

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.2	not found
PCB 1221	0.2	not found
PCB 1232	0.2	not found
PCB 1242	0.2	not found
PCB 1248	0.2	not found
PCB 1254	0.2	not found
PCB 1260	0.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7240PC.WR1
MH/TK/ARP/ARP

c[<1[1ØmAIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553
EPA METHOD 6Ø8/8Ø8Ø - PCB'S

Lab Number: QD-8241
Collected: 1Ø/16/87
Received: 1Ø/16/87
Tested: 1Ø/21/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-2
PROJECT #4ØØ-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	3.Ø

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QD8241PC.WR1
MH/GH/ARP/ARP

c[<1[1Øm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SER\

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

EPA METHOD 6Ø8/8Ø8Ø - PCB'S

Lab Number: D-8241
Collected: 1Ø/16/87
Received: 1Ø/16/87
Tested: 1Ø/21/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94598

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-2
PROJECT #4ØØ-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	3.Ø

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek, Ph.D.

D8241PC.WR1
MH/GH/ARP/ARP

c[<1[1ØmAIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SE

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

EPA METHOD 6Ø8/8ØØ - PCB'S

Lab Number: D-824Ø
Collected: 1Ø/16/87
Received: 1Ø/16/87
Tested: 1Ø/21/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94598

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-2A
PROJECT #4ØØ-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	2.2

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D824ØPC.WR1
MH/JJK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

EPA METHOD 6Ø8/8Ø8Ø - PCB'S

Lab Number: D-8553
Collected: 1Ø/16/87
Received: 1Ø/28/87
Tested: 11/Ø5/87
Collected by: D. Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
2E-3, Hunter's Point, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	7.9

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/28/87

Respectfully submitted,
Mary Havlicek
Mary Havlicek, Ph.D.

D8553pc.wr1/3
MH/gh/arp/ea

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553
EPA METHOD 608/8080 - PCB'S

Lab Number: D-8239
Collected: 10/16/87
Received: 10/16/87
Tested: 10/21/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-3A
PROJECT #4005-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.05	not found
PCB 1221	0.05	not found
PCB 1232	0.05	not found
PCB 1242	0.05	not found
PCB 1248	0.05	not found
PCB 1254	0.05	not found
PCB 1260	0.05	15.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 10/20/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D8239PC.WR1
MH/GH/ARP/ARP

c[<1[1ØM AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVIC

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553
EPA METHOD 6ØØ/8ØØØ - PCB'S

Lab Number: D-8238
Collected: 1Ø/16/87
Received: 1Ø/16/87
Tested: 1Ø/21/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-3B
PROJECT #4ØØ-38

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	Ø.79

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D8238PC.WR1
MH/GH/ARP/ARP

c[<1[1§m AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERV

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-8236
Collected: 10/16/87
Received: 10/16/87
Tested: 10/22/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point
2E-4
PROJECT #4000-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.05	not found
PCB 1221	0.05	not found
PCB 1232	0.05	not found
PCB 1242	0.05	not found
PCB 1248	0.05	not found
PCB 1254	0.05	not found
PCB 1260	0.05	8.9

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 10/20/87 .

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D8236PC.WR1
MH/JK/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7243
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#510,2E-4, %m=22;%s=40
PROJECT #4006-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	24.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7243PC.WR1
MH/TK/ARP/ARP

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: QD-7243
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#510,2E-4, %m=22;%s=40
PROJECT #4006-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	25.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QD-7243PC.WR1
MH/TK/ARP/ARP

c[<1[1Øm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553
EPA METHOD 6Ø8/8Ø8Ø - PCB'S

Lab Number: QS-8236
Collected: 1Ø/16/87
Received: 1Ø/16/87
Tested: 1Ø/23/87
Collected by: Dan Cutugno

ERM-WEST
1777 Botelho Dr., Suite 26Ø
Walnut Creek, CA 94598

SAMPLE DESCRIPTION:
Erm West; Navy, Hunter's Point, 2E-4,
Spiked at 4.4 ppm
PROJECT #4ØØ-38

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	14.*

*Recovery of spike = 116%

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QS8236PC.WR1
MH/GH/ARP/ARP

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: D-7244
Collected: 9/04/78
Received: 9/17/87
Tested: 9/21/87
Collected by: Dan Catugno

ERM-WEST
1777 Botelho Dr.,Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
U.S Navy Hunters Point
HML#511,2G-4, %m=17;%s=48
PROJECT #400-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	7.7

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 9/18/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

D7244PC.WR1
MH/TK/ARP/ARP

c[<1[1Øm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVIC

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553
EPA METHOD 6Ø8/8ØØ - PCB'S

Lab Number: QL-1ØØ2
Collected:
Received:
Tested: 1Ø/23/87
Collected by:

CCAS

SAMPLE DESCRIPTION:
Liq;Liq Extraction Blank

Compound Analyzed	Detection Limit micrograms/Kg	Concentration micrograms/Kg
PCB 1Ø16	Ø.2	not found
PCB 1221	Ø.2	not found
PCB 1232	Ø.2	not found
PCB 1242	Ø.2	not found
PCB 1248	Ø.2	not found
PCB 1254	Ø.2	not found
PCB 126Ø	Ø.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QL1ØØ2PC.WR1
MH/GH/ARP/ARP

c[<1[1ØmAIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

EPA METHOD 6ØØ/8ØØØ - PCB'S

Lab Number: B-1Ø237
Collected:
Received:
Tested: 1Ø/23/87
Collected by:

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

Compound Analyzed	Detection Limit micrograms/Kg	Concentration micrograms/Kg
PCB 1Ø16	Ø.2	not found
PCB 1221	Ø.2	not found
PCB 1232	Ø.2	not found
PCB 1242	Ø.2	not found
PCB 1248	Ø.2	not found
PCB 1254	Ø.2	not found
PCB 126Ø	Ø.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

B1Ø23PC.WR1
MH/GH/ARP/ARP

c[<1[1Øm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI :E

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

Lab Number: QL-1ØØ5
Collected: 1Ø/Ø5/87
Received: 1Ø/Ø5/87
Tested: 1Ø/22/87
Collected by: na

EPA METHOD 6ØØ/8ØØØ - PCB'S

CCAS

SAMPLE DESCRIPTION:
Liquid-Liquid Extraction Blank

Compound Analyzed	Detection Limit micrograms/L	Concentration micrograms/L
PCB 1Ø16	Ø.2	not found
PCB 1221	Ø.2	not found
PCB 1232	Ø.2	not found
PCB 1242	Ø.2	not found
PCB 1248	Ø.2	not found
PCB 1254	Ø.2	not found
PCB 126Ø	Ø.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/Ø5/87 .

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QL1ØØ5pc.wr1
MH/GH/ARP/ARP

c[<1[1$m AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVI

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934$1
($$5) 543-2553

Lab Number: B-1$227
Collected: na
Received: na
Tested: 1$/22/87
Collected by: na

EPA METHOD 6$$/8$$$ - PCB'S

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

Compound Analyzed	Detection Limit micrograms/L	Concentration micrograms/L
PCB 1$16	$.2	not found
PCB 1221	$.2	not found
PCB 1232	$.2	not found
PCB 1242	$.2	not found
PCB 1248	$.2	not found
PCB 1254	$.2	not found
PCB 126$	$.2	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits.

Respectfully submitted,

Mary Havlicek, Ph.D.

B1$227pc.wr1
MH/JK/ARP/ARP

c[<1[1ßm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SER

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934ß1
(8ß5) 543-2553

EPA METHOD 6ßß/8ßßß - PCB'S

Lab Number: B1ß217
Collected:
Received:
Tested: 1ß/21/87
Collected by:

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

PROJECT #4ßß-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1ß16	ß.ß5	not found
PCB 1221	ß.ß5	not found
PCB 1232	ß.ß5	not found
PCB 1242	ß.ß5	not found
PCB 1248	ß.ß5	not found
PCB 1254	ß.ß5	not found
PCB 126ß	ß.ß5	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1ß/2ß/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

B1ß217PC.WR1
MH/JJK/ARP/ARP

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: B-09217
Collected:
Received:
Tested: 9/21/87
Collected by:

EPA METHOD 608/8080 - PCB'S

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

PROJECT #400-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.02	not found
PCB 1221	0.02	not found
PCB 1232	0.02	not found
PCB 1242	0.02	not found
PCB 1248	0.02	not found
PCB 1254	0.02	not found
PCB 1260	0.02	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

B09217PC.WR1
MH/GH/ARP/ARP

c[<1[1Øm AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERV

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 934Ø1
(8Ø5) 543-2553

Lab Number: QH1Ø2Ø7
Collected:
Received:
Tested: 1Ø/21/87
Collected by:

EPA METHOD 6Ø8/8Ø8Ø - PCB'S

CCAS

SAMPLE DESCRIPTION:
Sonic Horn Extraction Blank

PROJECT #4ØØ-36

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1Ø16	Ø.Ø5	not found
PCB 1221	Ø.Ø5	not found
PCB 1232	Ø.Ø5	not found
PCB 1242	Ø.Ø5	not found
PCB 1248	Ø.Ø5	not found
PCB 1254	Ø.Ø5	not found
PCB 126Ø	Ø.Ø5	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 1Ø/2Ø/87

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.

QH1Ø2Ø7PC.WR1
MH/JJK/ARP/ARP

D-3 AREA 3

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7681
Collected: 08/08/88 @ 1141
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3A-9 (1.5 to 2.0 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 7.8%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7681pc.wr1/35
MH/bl/jl/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7679
Collected: 08/08/88 @ 1218
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3A-11 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 7.4%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7679pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7678
Collected: 08/08/88 @ 1205
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3A-13 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 22%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7678pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7680
Collected: 08/08/88 @ 1228
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-6 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 4.4%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7680pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7572
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-8, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	4.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 13%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7572pc.wr1/35
MH/bl/sc/jl

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7573
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-10, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	9.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 22%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7573pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553
EPA METHOD 608/8080 - PCB'S

Lab Number: E-7573
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09 & 24/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-10, Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	9.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 22%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
08/26/88
E7573pc2.wr1/37
MH/als/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7574
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-12, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 13%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7574pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7677
Collected: 08/08/88 @ 1153
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-14 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 25%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7677pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7676
Collected: 08/08/88 @ 1142
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-16 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 8.0%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7676pc.wr1/35
MH/bl/jl/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7675
Collected: 08/08/88 @ 1129
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3B-18 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 7.9%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7675pc.wr1/35
MH/bl/jl/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7682
Collected: 08/08/88 @ 1342
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3C-5 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 7.2%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
E7682pc.wr1/36
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7568
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-7, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	5.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 22%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7568pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7570
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-9, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 20%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7570pc.wr1/35
MH/bl/sc/jl

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7571
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-11, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 20%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7571pc.wr1/35
MH/bl/sc/jl

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7575
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-13, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	6.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 22%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7575pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7576
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-15, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	5.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 11%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7576pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7674
Collected: 08/08/88 @ 1113
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-17 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 6.7%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7674pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7673
Collected: 08/08/88 @ 1056
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3C-19 (2.0 to 2.5 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 30%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7673pc.wr1/35
MH/bl/jl/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7683
Collected: 08/08/88 @ 1352
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3D-4 (2.5 to 3.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 6.5%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7683pc.wr1/36
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7567
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-6, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	2.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 19%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7567pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7569
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-8, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 16%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7569pc.wr1/35
MH/bl/sc/jl

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7569
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09 & 24/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-8, Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 16%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
08/26/88
E7569pc2.wr1/37
MH/als/sc/jl

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7566
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-10, Soil

REVISED REPORT

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	3.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 14%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7566pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services	Central Coast Analytical Services 141 Suburban Road , Suite C-4 San Luis Obispo, California 93401 (805) 543-2553	Lab Number: E-7566 Collected: 08/05/88 Received: 08/07/88 Tested: 08/11 & 24/88 Collected by: A. Chemburkar

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-10, Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	3.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 14%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5/ECD
08/26/88
E7566pc2.wr1/37
MH/als/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7565
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-12, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 18%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7565pc.wr1/35
MH/bl/sc/sc

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7577
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-14, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	4.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 17%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7577pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7699
Collected: 08/08/88 @ 1715
Received: 08/09/88 @ 1800
Tested: 08/12/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3D-16 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 12%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7699pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: E-7672
Collected: 08/08/88 @ 1038
Received: 08/09/88
Tested: 08/11/88
Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3D-18 (1.5 to 2.0 Feet), Soil Grab

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/09/88.

Percent Moisture: 11%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7672pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7684
Collected: 08/08/88 @ 1406
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3E-5 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 12%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7684pc.wr1/36
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7564
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-7, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	15.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 32%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7564pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7564
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11 & 24/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-7, Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	23.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 32%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

RSD #5
08/26/88
E7564pc2.wr1/37
MH/als/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7563
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-9, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	14.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 21%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7563pc2.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7563
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11 & 24/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-9, Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	17.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 21%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
08/26/88
E7563pc3.wr1/37
MH/als/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7562
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-11, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 17%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7562pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7561
Collected: 08/05/88
Received: 08/07/88
Tested: 08/11/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-13, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	3.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 23%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7561pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7560
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3E-15, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 13%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7560pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7694
Collected: 08/08/88 @ 1713
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3E-17 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	1.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 13%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
E7694pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7685
Collected: 08/08/88 @ 1420
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3F-4 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 8.0%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7685pc.wr1/36
MH/jg/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7559
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3F-6, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	7.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 20%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7559pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7558
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3F-8, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	4.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 19%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7558pc.wr1/34
MH/jc/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7557
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3F-10, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	2.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 14%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7557pc.wr1/34
MH/jc/sc/sc

Central
Coast
Analytical
Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7556
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3F-12, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 19%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7556pc.wr1/35
MH/bl/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7555
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3F-14, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 17%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7555pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7693
Collected: 08/08/88 @ 1657
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3F-16 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 16%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7693pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services	Central Coast Analytical Services 141 Suburban Road , Suite C-4 San Luis Obispo, California 93401 (805) 543-2553	Lab Number: E-7686 Collected: 08/08/88 @ 1435 Received: 08/09/88 @ 1800 Tested: 08/11/88 Collected by: CS/AC

EPA METHOD 608/8080 - PCB'S

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3G-5 (2.5 to 3.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 11%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
E7686pc.wr1/36
MH/jg/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7687
Collected: 08/08/88 @ 1451
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3G-7 (2.5 to 3.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 13%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7687pc.wr1/36
MH/jg/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7552
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3G-9, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	9.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 23%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7552pc.wr1/35
MH/bl/gh/gh

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7553
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3G-11, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	2.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 18%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7553pc.wr1/34
MH/jc/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7554
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3G-13, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	2.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 22%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7554pc.wr1/34
MH/jc/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7695
Collected: 08/08/88 @ 1605
Received: 08/09/88 @ 1800
Tested: 08/12/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3G-15 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 5.3%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7695pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7688
Collected: 08/08/88 @ 1506
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #400058, Hunter's Point S.F.,
3H-6 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 7.1%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
E7688pc.wr1/36
MH/jc/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7689
Collected: 08/08/88 @ 1520
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3H-8 (2.0 to 2.5 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 17%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7689pc.wr1/36
MH/jc/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7551
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3H-10, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 15%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7551pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7696
Collected: 08/08/88 @ 1625
Received: 08/09/88 @ 1800
Tested: 08/12/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3H-12 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 9.0%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7696pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7690
Collected: 08/08/88 @ 1600
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3J-9 (2.5 to 3.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 11%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7690pc.wr1/36
MH/jc/sc/sc

AIR, WATER and HAZARDOUS WASTE LABORATORY CERTIFIED by CALIFORNIA DEPT of HEALTH SERVICES

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7550
Collected: 08/05/88
Received: 08/07/88
Tested: 08/09/88
Collected by: A. Chemburkar

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
3J-11, Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	2.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/08/88.

Percent Moisture: 17%. Tested by EPA Method 160.3 on 08/08/88 by ACF.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
E7550pc.wr1/34
MH/jc/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7697
Collected: 08/08/88 @ 1640
Received: 08/09/88 @ 1800
Tested: 08/12/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3J-13 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 19%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7697pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7698
Collected: 08/08/88 @ 1702
Received: 08/09/88 @ 1800
Tested: 08/12/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3H-14 (1.5 to 2.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	1.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 12%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
E7698pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7691
Collected: 08/08/88 @ 1620
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3K-10 (2.5 to 3.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 8.9%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

ECD
E7691pc.wr1/36
MH/jc/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7692
Collected: 08/08/88 @ 1645
Received: 08/09/88 @ 1800
Tested: 08/11/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3K-12 (2.5 to 3.0 Feet), Soil

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	18.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 8.4%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
E7692pc.wr1/36
MH/jc/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: E-7692
Collected: 08/08/88 @ 1645
Received: 08/09/88 @ 1800
Tested: 08/11 & 24/88
Collected by: CS/AC

ERM-WEST
1777 Botelho Dr.
Suite 260
Walnut Creek, CA 94596

SAMPLE DESCRIPTION:
Job #40058, Hunter's Point S.F.,
3K-12 (2.5 to 3.0 Feet), Soil
Duplicate Analysis of Same Extract

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	17.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Percent Moisture: 8.4%. Tested by EPA method 160.3 on 08/15/88 by PD.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

ECD
08/26/88
E7692pc2.wr1/37
MH/als/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: B-08118
Collected:
Received:
Tested: 08/11/88
Collected by:

EPA METHOD 608/8080 - PCB'S

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
B08118pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: QH-080888
Collected: 08/10/88
Received: 08/10/88
Tested: 08/11/88
Collected by:

EPA METHOD 608/8080 - PCB'S

CCAS

SAMPLE DESCRIPTION:
Sonic Horn Extraction Blank
08/10/88

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/10/88.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
QH0810pc.wr1/35
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: OS-080068-1
Collected: 08/06/88
Received: 08/06/88
Tested: 08/12/88
Collected by:

CCAS

SAMPLE DESCRIPTION:
Sand Spiked With Arochlor 1248

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.01	not found
PCB 1221	0.01	not found
PCB 1232	0.01	not found
PCB 1242	0.01	not found
PCB 1248	0.01	0.1 *
PCB 1254	0.01	not found
PCB 1260	0.01	not found

Percent Recovery of Arochlor 1248 = 100%.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/06/88.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
OS806pc1.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: QS-80868-3
Collected: 08/06/88
Received: 08/06/88
Tested: 08/12/88
Collected by:

CCAS

SAMPLE DESCRIPTION:
Sand Spiked With Arochlor 1248

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	0.01	not found
PCB 1221	0.01	not found
PCB 1232	0.01	not found
PCB 1242	0.01	not found
PCB 1248	0.01	0.07 *
PCB 1254	0.01	not found
PCB 1260	0.01	not found

Percent Recovery of Arochlor 1248 = 70%.

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/06/88.

Respectfully submitted,

Mary Havlicek

Mary Havlicek, Ph.D.
President

MSD #5
QS806pc3.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

Lab Number: B-08128
Collected:
Received:
Tested: 08/12/88
Collected by:

EPA METHOD 608/8080 - PCB'S

CCAS

SAMPLE DESCRIPTION:
Instrument Blank

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
B08128pc.wr1/36
MH/bl/sc/sc

Central Coast Analytical Services

Central Coast
Analytical Services
141 Suburban Road , Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

EPA METHOD 608/8080 - PCB'S

Lab Number: QH-080868
Collected: 08/06/88
Received: 08/06/88
Tested: 08/12/88
Collected by:

CCAS

SAMPLE DESCRIPTION:
Sonic Horn Extraction Blank
08/06/88

Compound Analyzed	Detection Limit milligrams/Kg	Concentration milligrams/Kg
PCB 1016	1.	not found
PCB 1221	1.	not found
PCB 1232	1.	not found
PCB 1242	1.	not found
PCB 1248	1.	not found
PCB 1254	1.	not found
PCB 1260	1.	not found

Compounds listed as "not found" would have been reported if present at or above the listed detection limits. Sample was extracted 08/06/88.

Respectfully submitted,

Mary Havlicek, Ph.D.
President

MSD #5
QH0806pc.wr1/36
MH/bl/sc/sc

APPENDIX E

CHAIN OF CUSTODY FORMS FOR VERIFICATION SAMPLING PROGRAMS

E-1 AREA 1 (Interim Report)
E-2 AREA 2
E-3 AREA 3

E-1 AREA 1 (Interim Report)

Security Seal : intact

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West Environmental Resources Management

Client: Navy
Sampler (s): D. Citrano
Date: 4-15-97
Weather: sunny, breezy, windy

Job Location: Hunters Pt., San Fran CA
Job No: 400-30
No. of Samples Collected: 21 soils
page 1 of 4

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Verification samples : 3 day turn around

	Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
D2680	A-1*	4:00P				X	6 oz.	1 glass jar	None	YES	trowel	see note below
2681	A-2	4:05P				X						
2682	B-1	4:10P				X						
2683	2ft. S.E. of B-2	4:14P				X						
2684	C-1*	4:19P				X						
2685	C-2	4:24P				X						

* split sample to DOHS

Comments:
Verification samples for PCB cleanup

Composite the following sample groups for single Aroclor analyses (PCBs)
(1) A-1, A-2, B-2, B-1
(2) C-1, C-2, D-1, D-2, D-3

Custody Record
Signature, Date/Time
Relinquished: D. Citrano 4-16-97 9 AM
Received: [illegible] of JCHS 17:20 Hrs
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Centrel Coast Analytical Services
141 Suburban Rd
E-4
San Luis Obispo CA
93401
(805) 543-3553

Security Seal: intact

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Citrano
Date: 4-15-87
Weather: sunny, breezy, warm

Job Location: Hunters Pt., San Fran CA
Job No: 400.30
No. of Samples Collected: 2-1 soils

Verification samples : 3 day turn around

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
D2686 D-1	4:28P				X	60z.	1 gluss jar	none	YES	trowel	see note below
2687 D-2*	4:34P				X						
2688 D-3	4:38P				X						
2689 E-1	4:42P				X						
2690 E-2	4:45P				X						
2691 E-3	4:49P				X						

* split sample to DOHS

Comments:
Verification samples
composite the soil, whole sample acps for single, discrete analyses (PCB's)
(3) E-1, E-2, E-3, F-1
(4) F-1, F-3, G-1, G-2

Custody Record
Signature, Date/Time
Relinquished: D. Citrano 4-16-87 9 AM
Received: [illegible] 4-16-87 1720 hrs
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast Analytical
San Luis Obispo CA

Security Seal: intact

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutuyoo
Date: 4-15-97
Weather: sunny, breezy, warm

Job Location: Hunters Pt. San Fran CA
Job No: 400-30
No. of Samples Collected: 2 soils

Verification samples: 3 day turn around

	Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
D2692	F-1*	4:55P				X	60z.	1 glass jar	none	YES	4 Comp	see note below
2693	F-2	5:00P				X						
2694	F-3	5:04P				X						
2695	3.5 Ft. N.W. of G-1	5:09P				X						
2696	G-2	5:14P				X						
2697	G-4	5:19P				X						

* split sample to DOHS

Comments:
Verification samples
composite the following
sample sets for single
composite analyses (PCB's)
(4) F-2, F-3 G-1 G-2
(5) G-4 H-1, H-2, H-3

Custody Record
Signature, Date/Time
Relinquished: D. Cutuyoo 4-16-97 9AM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast Analytical
San Luis Obispo CA

Security seal: intact!!

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutugno
Date: 4-15-87
Weather: sunny, breezy, warm

Job Location: Hunters Pt, San Fran CA
Job No: 400-30
No. of Samples Collected: 21 soils
page 4 of 4

Verification samples: 3 day turn around

	Sample ID #	Time	Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preser-vative	Iced (Y/N)	Sampling Method	Analyses
D2698	H-2	5:24 P				X	6 oz.	1 glass jar	none	YES	trowel	see note below
2699	H-3*	5:30 P				X	↓	↓	↓	↓	↓	↓
2700	H-1	5:37 P				X	↓	↓	↓	↓	↓	↓

* split sample to DOHS

Comments:
Verification samples
composite the following
sample grps. for single
discrete analyses (PCBs):
(5) G-4, H-1, H-2, H-3

Custody Record
Signature, Date/Time
Relinquished: D. Cutugno 4-16-87 9AM
Received: [illegible] CCAS 1220 4/16
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast
Analytical
San Luis Obispo CA

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: NAVY
Sampler (s): MILLER / BROWN
Date: 5/18/87
Weather: Foggy / Overcast A.M / Sunny / Windy P.M

Job Location: Hunters Point
Job No: 40030
No. of Samples Collected: 16
page 1 of 3

3 day Turn Around

Sample ID #	Time	Sample Type Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preser-vative	Iced (Y/N)	Sampling Method	Analyses
X1	4:55PM				X	3-4oz	1/GLASS	None	Y	Auger (Hand) Travelled to Container	PCB
X2	4:45PM				X						
X3	4:32PM				X						
X4	4:25PM				X						
X5	5:05PM				X						
X6	5:12PM				X						
X7	5:20PM				X						

Comments:
SAMPLE DEPTHS FROM SURFACE
X1 = ~~2'-~~2'-6"
X2 = 2'-2"
X3 = 2'-4"
X4 = 2'-0"
X5 = 2'-0"
X6 = 2'-2"
X7 = 1'-11"

Custody Record
Signature, Date/Time
Relinquished: Dennis Miller 5-18-87 7:00P.M
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received: [illegible] 5.19.87

Name and Address of Receiving Laboratory
Central Coast Analytical
141 Suburban Rd Suite C-4
San Luis Obispo, CA 93401
805-543-2553

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: NAVY
Sampler (s): MILLER/BROWN
Date: 5-18-87
Weather: Foggy/overcast A.M / Sunny, Windy P.M

Job Location: HUNTERS Point
Job No: 40030
No. of Samples Collected: 16
page 1 of 2

3 day TURN AROUND

Sample ID #	Time	Sample Type Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
X8	5:15PM				X	~3-4oz	1/GLASS	NONE	Y	AUGER (HAND) Trowelled to Container	PCB
X9	5:07PM				X						
X10	5:01PM				X						
X11	4:27PM				X						
X12	3:45PM				X						
X13	3:55PM				X						
X14	4:02P.M				X						

Comments:
Sample depths from Surface
X8 = 1'-10"
X9 = 2'-1"
X10 = 1'-9"
X11 = 2'-0"
X12 = 2'-4"
X13 = 2'-0"
X14 = 2'-0"

Custody Record
Signature, Date/Time
Relinquished: Dennis Miller 5-18-87 7:00PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast Analytical
141 Suburban Rd, Suite C-4
San Luis Obispo, CA 93401

805-543-2553

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: NAVY
Sampler (s): MILLER/BROWN
Date: 5/18/87
Weather: Foggy/Overcast A.M / Sunny/Windy P.M

Job Location: Hunters Point
Job No: 40030
No. of Samples Collected: 16
page 3 of 3

3 day Turn Around

Sample ID #	Time	Sample Type Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
X15	4:10 PM				X	3-4oz	1/GLASS	None	Y	Auger (HAND)	PCB
X16	4:15PM				X	"	↓	None	Y	Trowelled to container	PCB

Comments:
Sample depths from surface:
X15 = 2'-0"
X16 = 2'-6"

Custody Record
Signature, Date/Time
Relinquished: Dennis Miller 5-18-87 7:00PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:

Name and Address of Receiving Laboratory
Central Coast Analytical
141 Suburban Rd Suite C-4
San Luis Obispo, CA 93401
805-543-2553

E-2 AREA 2

State of California-Health and Welfare Agency

HAZARDOUS MATERIALS SAMPLE ANALYSIS REQUEST

All applicable items must be completed

1. HML No. To: D500-D502 | 2. Page 1 of

3. Collector: Chein Kao | 4. Phone: (8) 415 540-3052

5. Priority: 2

6. Authorized by:

7. Date Sampled: 9/3/87 | 7. Time Sampled: 11.00 Hours

8. Codes (fill in all applicable codes)

a. STC	0 0 1 0 2 1
b. Region	4
c. TPC	
d. INDEX	6 5 3 0
e. PCA	1 1 0 2 5
f. SITE	2 0 0 5 7 0
g. County	0 7 5

9. Activity: ☐ Enf ☐ Surv ☒ Site Mit ☐ Permitting ☐ Alt Tech ☐ Other

10. SAMPLING LOCATION

a. EPA ID No.

b. Site: Hunters Point Naval shipyard

c. Address: Number Street City S. F. Zip

11. SAMPLES

a. ID	b. Collector's No.	c. HML No.	d. Type	e. Container Type	f. Size	g. Field Information
A.	D2392A-1	D500	soil	G	250	Soil boring at 1'1" to 2'6
B.	40 2E-1	D501	soil	G	250	Soil boring at 11" to 1'-1
C.	4 2C-6	D502	soil	G	250	Soil boring at 1' to 1'-1
D.						
E.						
F.						
G.						
I.						

12. ANALYSIS REQUESTED

a. ☐ pH	f. ☒ PCB	k. ☐ Ext. Org (Screeng)
b. ☐ Metal Scan	g. ☐ VOA	l. ☐ Chlorinated Pesticides
c. ☐ Metals (Spec)	h. ☐ PAH	m. ☐ Organo-P Pesticides
d. ☐ W.E.T.	i. ☐ Phenols	n. ☐
	j. ☐ Carbamates	o. ☐

13. CHAIN OF CUSTODY

	Signature	Name/Title	Inclusive Dates
a.	Chein Ping Kao	Chein Ping Kao / AWME	9/3/87 - 9/3/
b.	[signature]	VERNE EARL WOODSON / LAB ASST	9/3/87 - 9/15/
c.	Chein Ping Kao	Chein Ping Kao / AWME	9/15/87 - 9/16/
d.	Shellie Noller	Shellie Noller / Sample Control	9/16/87 - / /

14. SPECIAL REMARKS: Security seal intact upon receipt HML to prep sample for split for injection

RECEIVED BY: [signature] a. Title: AIC III b. Date: 9-3-87

16. SAMPLE ALLOCATION a. ☐ HML-Berkeley b. ☐ HML-SC c. ☐ AIHL d. ☐ Contract b. Date

17. ANALYSIS REQUESTED: PCB

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutugno
Date: 9-3-87
Weather: sunny, breezy, warm, dry

Job Location: San Fran CA
Job No: 400-36
No. of Samples Collected: 14 soils

Verification Samples : 5-day Turnaround

Sample ID #	Time	Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
✓ 2H-1 1'6"-2'0"	9:50A		D-6886		X	2" x 6"	1 brass tube	none	YES	drive sampler	PCBs
✓ 2G-1 1'8"-2'3"	10:25A		[illegible]		X	2" x 7"	1 steel tube	"	"	"	"
✓ 2F-1 1'5"-2'0"	10:45A		[illegible]		X	2" x 7"	"	"	"	"	"
✓ 2D-0 2'2"-2'8"	11:45A		[illegible]		X	2" x 6"	1 brass tube	"	"	"	"
✓ 2B-6 1'6"-2'0"	12:55P		[illegible]		X	2" x 6"	"	"	"	"	"
✓ 2C-7 2'7"-3'1"	2:25P		[illegible]		X	2" x 6"	"	"	"	"	"

Comments: Analyze soil from bottom (… of) depth of each tube

Soil fines ONLY: DO NOT INCLUDE ROCKS, CONCRETE ETC.

Analyze 1 random sample in duplicate (1 of 14 total)

Custody Record
Signature, Date/Time
Relinquished: D. Cutugno 9-3-87 6:45P
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received: [illegible]

Name and Address of Receiving Laboratory
Central Coast Analytical Services (CCAS)
141 Suburban Rd
C-4
San Luis Obispo CA
93401
(805) 543-2553

NOTE: Samples 2A-1, 2C-6 and 2E-1 were retained by the Dept. of Health Services. Splits of these samples will be sent to [illegible]

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

Client: Navy
Sampler (s): D. Cutugno
Date: 9-3-87
Weather: see p. 1

Job Location: San Fran CA
Job No: 400-36
No. of Samples Collected: 14 soils

page 2 of 3

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Verification Samples : 5-day turn around

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
1-2D-6 1'6"-2'0"	2:35P				X	3"x6"	1 steel tube	none	YES	drive sampler	PCBs
1-2E-7 1'9"-2'2"	2:50P				X	↓	1 brass tube	↓	↓	↓	↓
2F-7 1'10"-2'4"	3:10P				X		"				
2G-6 2'4"-2'10"	3:25P				X		"				
1-2H-6 1'4"-1'10"	3:50P				X		1 steel tube				
1-2B-7 1'8"-2'2"	4:10P				X	↓	"	↓	↓	↓	↓

Comments:

see comment section, pg 1

Custody Record
Signature, Date/Time

Relinquished: D. Cutugno 9-3-87 6:45P
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received: Willie Hatter 9-4-87 0900

Name and Address of Receiving Laboratory

Central Coast Analytical Services
San Luis Obispo CA

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutuyne
Date: 9-3-87
Weather: sec 9-1

Job Location: San Fran CA
Job No: 400-36
No. of Samples Collected: 14 soils

Verification Samples: 5-day turn around

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
✓ 2C-1 1'6"-2'0"	4:20P				X	2"x6"	1 Brass tube	none	YES	drive sampler	PCBs
✓ BL-1 1'6"-2'0"	4:35P				X	"	"	"	"	"	"

Comments:
see comment section, pg 1.

Custody Record Signature, Date/Time
Relinquished: D. Cutuyne 9-3-87 6:45P
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received: [illegible] 9-4-87 0900

Name and Address of Receiving Laboratory
Central Coast Analytical Services
San Luis Obispo CA

CHAIN OF CUSTODY / SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutuyao/R. Kupp
Date: 9/4/97
Weather: partly cloudy, warm, breezy

Job Location: San Fran, CA
Job No: 400.36
No. of Samples Collected: 31 soils / 2 waters

page 1 of 16

Verification Samples : 5-day turnaround

	Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
6950	2A-2	2:13P				X	~4oz.	1 glass jar	none	YES	manual	PCBs
6951	2A-3	2:17P				X						
6952	2A-4	2:22P				X						
6953	2B-2	2:20P				X						
6954	2B-3	2:18P				X						
6955	2B-4	2:15P				X						

Comments:

31 soils : analyze

10% in duplicate.

Custody Record
Signature, Date/Time

Relinquished: D. Cutuyao 9/4/97 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory

Central Coast
Analytical Services
141 Suburban Rd
C-4
San Luis Obispo CA
93401
(805) 543-2553

NOTE: Samples 2C-2, 2C-5, 2E-4 and 2G-4 were retained by the Dept. of Health Services; splits will be sent to CCAS

CHAIN OF CUSTODY & SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): Cutugno/Knapp
Date: 9/4/87
Weather: see p. 1

Job Location: San Fran CA
Job No: 400.36
No. of Samples Collected: 3 soils/2 waters

page 2 of 6

Verification Samples : 5-day turnaround

	Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
0956	2B-5	2:28P				X	~4 oz.	1 glass jar	none	YES	manual	PCBs
0957	2C-3	2:24P				X						
0958	2C-4	2:29P				X						
0959	2D-1	2:36P				X						
0960	2D-2	2:39P				X						
0961	2D-3	2:35P				X						

Comments:
see p. 1

Custody Record
Signature, Date/Time
Relinquished: D. Cutugno 9/4/87 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Coastal Coast Analytical
San Luis Obispo CA

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): Cutuspo/Knapp
Date: 9/4/87
Weather: see p. 1

Job Location: San Fran CA
Job No: 400.36
No. of Samples Collected: 31 soils / 2 rinsates

Verification Samples : 5-day turnaround

	Sample ID #	Time	Sample Type Water Comp.	Water Grab	(Soil) Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
962	2D-4	2:43P				X	~4 oz.	1 glass jar	none	YES	manual	PCBs
963	2D-5	2:12P				X	↓	↓	↓	↓	↓	↓
964	2E-2	2:48P				X	↓	↓	↓	↓	↓	↓
965	2E-3	2:49P				X	↓	↓	↓	↓	↓	↓
966	2E-5	2:56P				X	↓	↓	↓	↓	↓	↓
967	2E-6	3:10P				X	↓	↓	↓	↓	↓	↓

Comments: see p. 1

Custody Record
Signature, Date/Time
Relinquished: D. Cutuspo 9/4/87 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast Analytical
San Luis Obispo

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): Cutuano/Knapp
Date: 9/4/87
Weather: see p. 1

Job Location: San Fran CA
Job No: 400.36
No. of Samples Collected: 32 soils/2 waters
page 4 of 6

Verification Samples: 5-day turnaround

	Sample ID #	Time	Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
D6968	2F-2	2:50P				X	~4oz	1 glass jar	none	YES	manual	PCBs
6969	2F-3	2:53 P				X	↓	↓	↓	↓	↓	↓
6970	2F-4	3:31 P				X	↓	↓	↓	↓	↓	↓
6971	2F-5	3:20P				X	↓	↓	↓	↓	↓	↓
6972	2F-6	3:35 P				X	↓	↓	↓	↓	↓	↓
6973	2G-2	3:01P				X	↓	↓	↓	↓	↓	↓

Comments: see p. 1

Custody Record
Signature, Date/Time
Relinquished: D. Cutuano 9/4/87 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast
Analytical Services
San Luis Obispo CA

CHAIN OF CUSTODY AND SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): Cotuvo / Kopp
Date: 9/4/97
Weather: see p. 1

Job Location: San Fran SA
Job No: 400.36
No. of Samples Collected: 31 soils/2 waters

Verification Samples: 5-day turnaround

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
6974	2G-3	2:55P				X	~4oz.	1 glass jar	none	YES	manual	PCBs
6975	2G-5	3:23P				X						
6976	2H-2	3:02P				X						
6977	2H-3	3:14P				X						
6978	2H-4	3:17P				X						
6979	2H-5	3:43P				X						
6980	BL-2	5:00P				X	~2oz.	1 glass jar	none	YES	manual	PCBs

Comments: see p. 1

Custody Record
Signature, Date/Time
Relinquished: D. Cotuvo 9/4/97 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Coastal Coast Analytical
San Luis Obispo CA

CHAIN OF CUSTODY / SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): C. Cutrano
Date: 9/4/87
Weather: see p. 1

Job Location: San Francisco CA
Job No: 4DD-36
No. of Samples Collected: 3 soils / 2 waters

page 6 of 6

5-day turnaround

Sample ID #	Time	Sample Type (Water: Comp. / Grab; Soil: Comp. / Grab)	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
D6981 #1	9:45A	Water: Grab X	1l	1 amber glass bottle	none	YES	manual	see comment section
D6982 #2	3:20P	Water: Grab X	1l	"	"	"	"	"

Comments:

PCB Analysis:
#1: supernatant
only; DO NOT HOMOGENIZE
SEDIMENT
#2: Total content only

Custody Record
Signature, Date/Time

Relinquished: C. Cutrano 9/4/87 6PM
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory

Central Coast Analytical
San Luis Obispo CA

CHAIN OF CUSTODY & SAMPLE IDENTIFICATION RECORD

ERM-West
Environmental
Resources
Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutuano
Date: 10-16-97
Weather: sunny, warm, dry

Job Location: Hunters Pt, San Fran.
Job No: 400-36
No. of Samples Collected: 11*

Verification Samples : 5-day turnaround

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
2C-5a	12:31P				X	~60z.	1 glass jar	none	YES	manual	see comment section
2C-5b	12:32P				X						
2C-5c	12:34P				X						
2E-4	12:36P				X						
2D-2	12:37P				X						
2E-3b	12:39				X						

Comments:

Analyze for PCBs; if possible, ARCLOR prior to screening and homogenizing

Analyze 2E-4 in TRIPLICATE

Custody Record
Signature, Date/Time

Relinquished: D. Cutuano 10-16-97 2:45P
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory

Central Coast Analytical Services
141 Suburban Rd
C-4
San Luis Obispo CA
93401
(805) 543-2553

*NOTE: Samples 2E-3 and 2C-5 were retained by CA. DHS and will be sent to CCAS under separate cover.

CHAIN OF CUSTODY & SAMPLE IDENTIFICATION RECORD

EKK-West Environmental Resources Management

1777 Botelho Drive
Suite 260
Walnut Creek, CA 94596
(415) 946-0455

Client: Navy
Sampler (s): D. Cutuno
Date: 10-16-87
Weather: sunny, warm, dry

Job Location: Hunters Pt., San Fran.
Job No: 400.36
No. of Samples Collected: 11 (see p. 1)

Verification Samples : 5-day turnaround

Sample ID #	Time	Sample Type: Water Comp.	Water Grab	Soil Comp.	Soil Grab	Volume	No. of Contnrs. Contnr. Type	Preservative	Iced (Y/N)	Sampling Method	Analyses
2E-3a	12:42P				X	~60z.	1 glass jar	none	YES	manual	see comment section pg 1
2E-2a	12:45P				X	↓	↓	↓	↓	↓	↓
2E-2	1:05P				X	↓	↓	↓	↓	↓	↓

Comments: see pg 1

Custody Record
Signature, Date/Time
Relinquished: D. Cutuno 10-16-87 2:45P
Received:
Relinquished:
Received:
Relinquished:
Received:
Relinquished:
Received:

Name and Address of Receiving Laboratory
Central Coast Analytical Svcs.
San Luis Obispo CA

HAZARDOUS MATERIALS SAMPLE ANALYSIS REQUEST

All applicable items must be completed

1. HML No. To D723-D724 | 2. Page of

3. Collector Chein Kao | 4. Phone 415 540-3052

5. Priority ☐ a. Authorized by

6. Date Sampled 10/16/87 | 7. Time Sampled 12.30 Hours

8. Codes (fill in all applicable codes)

a. STC	0 9 1 0 2 1
b. Region	4
c. TPC	
d. INDEX	6 5 3 0
e. PCA	1 1 0 2 5
f. SITE	2 0 0 0 5 0 0
g. County	0 7 5

9. Activity ☐ Enf ☐ Surv ☒ Site Mit ☐ Permitting ☐ Alt Tech ☐ Other

10. SAMPLING LOCATION

a. EPA ID No.

b. Site Hunters Point Naval Shipyard

c. Address S.F.

Number Street City Zip

11. SAMPLES

a. ID	b. Collector's No.	c. HML No.	d. Type	Container e. Type	Container f. Size	g. Field Information
A.	2C-5	D723	soil	G	250	resample the same loc
B.	2E-3	D724	soil	G	250	" " "
C.						
D.						
E.						
F.						
G.						
H.						

12. ANALYSIS REQUESTED

a. ☐ pH
b. ☐ Metal Scan
c. ☐ Metals (Spec)
d. ☐ W.E.T.
f. ☒ PCB
g. ☐ VOA
h. ☐ PAH
i. ☐ Phenols
j. ☐ Carbamates
k. ☐ Ext. Org (Screeng)
l. ☐ Chlorinated Pesticides
m. ☐ Organo-P Pesticides
n. ☐
o. ☐

13. CHAIN OF CUSTODY

	Signature	Name/Title	Inclusive Dates
a.	Chein Ping Kao	Chein Ping Kao/AWME	10/16/87-10/16/
b.	[illegible]	Verne Earl Novosew/ABASIT	10/16/87-10/23/
c.	Chein Ping Kao	Chein Ping Kao/AWME	10/23/87- / /
d.	Shellie Miller	Shellie Miller/Sample control-CCAS	10/26/87- / /

14. SPECIAL REMARKS please contact Howard Okamoto for special instruc

15. RECEIVED BY Howard S. Okamoto a. Title PHC III b. Date 10/16/87

16. SAMPLE ALLOCATION a. ☐ HML-Berkeley b. ☐ HML-SC c. ☐ AIHL d. ☐ Contract b. Date

17. ANALYSIS REQUESTED PCBs

Air dried, #10 mesh fraction — splits to be given to C.P. Kao

State of California-Health and Welfare Agency — Department of Health Services

HAZARDOUS MATERIALS SAMPLE ANALYSIS REQUEST

All applicable items must be completed

1. HML No. To: DS09-DS12 — 2. Page 2 of

3. Collector: Chein Kao — 4. Phone: 415 540-3052

5. Priority: ☒ — a. Authorized by:

6. Date Sampled: 9/4/87 — 7. Time Sampled: — Hours

8. Codes (fill in all applicable codes)

a. STC	0 0 1 0 2 1
b. Region	4
c. TPC	
d. INDEX	6 5 3 0
e. PCA	1 1 0 2 5
f. SITE	2 9 0 0 5 0 0
g. County	0 7 5

9. Activity: ☐ Enf ☐ Surv ☒ Site Mit ☐ Permitting ☐ Alt Tech ☐ Other

10. SAMPLING LOCATION — a. EPA ID No.

b. Site: Hunters Point Naval Shipyard

c. Address: ____ (Number) ____ (Street) S.F. (City) ____ (Zip)

11. SAMPLES

a. ID	b. Collector's No.	c. HML No.	d. Type	e. Container Type	f. Container Size	g. Field Information
A.	DS09-2C-5	DS09	Soil	G	250	
B.	43 2E4	DS10	"	G	"	
C.	44 2G-4	DS11	"	G	"	
D.	45 2C-2	DS12	"	G	"	
E.						
F.						
H.						

12. ANALYSIS REQUESTED

a. ☐ pH		f. ☒ PCB		k. ☐ Ext. Org (Screeng)	
b. ☐ Metal Scan		g. ☐ VOA		l. ☐ Chlorinated Pesticides	
c. ☐ Metals (Spec)		h. ☐ PAH		m. ☐ Organo-P Pesticides	
d. ☐ W.E.T.		i. ☐ Phenols		n. ☐	
		j. ☐ Carba-mates		o. ☐	

13. CHAIN OF CUSTODY

	Signature	Name/Title	Inclusive Dates
a.	Chein Ping Kao	Chein Ping Kao / AWME	9/4/87 - 09/04
b.	J. Thom Coons	J. Thom Coons / Chemist	9/4/87 - 9/4
c.	Verne Earl Hansen	VERNE EARL HANSEN / HRB DSIT	9/4/87 - 9/15
d.	Chein Ping Kao	Chein Ping Kao / AWME	9/15/87 - 9/16
e.	Shellie Noller	Shellie Noller / Sample Control	9/17/87

14. SPECIAL REMARKS: Security seal intact upon receipt.

15. RECEIVED BY: ____ a. Title: ____ b. Date: 9/17/87

16. SAMPLE ALLOCATION: a. ☐ HML-Berkeley b. ☐ HML-SC c. ☐ AIHL d. ☐ Contract e. Date

17. ANALYSIS REQUESTED: PCB

E-3 AREA 3

Date 8.5.88 Weather cloudy 65-70°F Page 1 of 3

ERM-West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location HUNTER'S PT.

Sampler (signature) ASC / Don Lapin

Printed name ARUN CHEMBURKAR / Don Lapin

Lab Report Recipient

Telephone No.

Receiving Lab CENTRAL COAST ANA. SER.

Address 141 SUBURBAN ROAD, SUITE G-4

SAN LUIS OBISPO, CA 93401

Sample ID#	Time	W=water S=soil	C=comp G=grab	Volume	Container type	ICED	Preservative	Sampling method	TPH-Extraction	BTEX/Total Fuel HCs	601 / 8010 Halocarbons	602 / 8020 Aromatics	604 / 8040 Phenols	8080 Pest/PCBs	624-8240 Purgeables	625-8270 BNAs & Pest (SVs)	Dioxins	Metals	Wet Chemistry	% moisture	Number of Containers	Remarks
31-11	1124	S	G		glass jar	Y	N	E-7550						✓						✓	1	PCB 8080
34-10	1129							7551													1	+ % Moisture
36-9	1136							7552													1	
36-11	1142							7553													1	
36-13	1147							7554													1	
3F-14	1151							7555													1	
3F-12	1157							7556													1	
3F-10	1202							7557													1	
3F-8	1206							7558													1	
3F-6	1212							7559													1	

5-Day Turnaround

EPA Protocol

Precautions: Conc: ☒ Lo ☐ Med ☐ Hi Ship Via Total Number of Containers: 10

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Arun	08/05		[illegible]	8/5	1834	
Company ERM-W			Company CCAL			
Company			Company			

LABORATORY—Please Complete ☐ Samples Intact ☐ Samples at 4°C ☐ Samples not leaking ☐ # of containers matches C-of-C ☐ Container tags match C-of-C ☐ Cooler seals intact

Lab sample custodian Signature Date Time Sample Disposition ☐ Return to Site ☐ Discard ☐ Hold ____ days

Date 8.5.88 Weather Cloudy 65-70°F Page 1 of 3

ERM-West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location HUNTER'S PT.

Sampler (signature) ASC / Don Lapan

Printed name ARUN CHEMBURKAR / DON LAPAN

Lab Report Recipient

Telephone No.

Receiving Lab CENTRAL COAST ANA. SER.

Address 141 SUBURBAN ROAD, SUITE G-4

SAN LUIS OBISPO, CA 93401

Sample ID#	Time	W-water S-soil	C-comp G-grab	Volume	Container type	ICED	Preservative	Sampling method	TPH-Extraction	BTEX/Total Fuel HCs	601 / 8010 Halocarbons	602 / 8020 Aromatics	604 / 8040 Phenols	8080 Pest/PCBs	624-8240 Purgeables	625-8270 BNAs & Pest (SVs)	Dioxins	Metals	Wet Chemistry	% Moisture	Number of Containers	Remarks
3E-15	1217	S	G	Glass Jar		Y	N	7560						✓							1	EPA Protocol PCB 8080 + % Moisture
3E-13	1221							7561													1	
3E-11	1223							7562													1	
3E-9	1228							7563													1	
3E-7	1231							7564													1	
3D-12	1238							7565													1	
3D-10	1241							7566													1	
[illegible]	[illegible]																					
3D-6	1251							7567													1	
~~3D-4~~ 3C-7	1258							7568													1	

Precautions: Conc: ☒ Lo ☐ Med ☐ Hi Ship Via Total Number of Containers: 9

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Arun	08/05		Maria Fernandez	8/7	[illegible]	1854
Company			Company CCAL			
Company			Company			

LABORATORY—Please Complete ☐ Samples Intact ☐ Samples at 4°C ☐ Samples not leaking ☐ # of containers matches C-of-C ☐ Container tags match C-of-C ☐ Cooler seals intact

Lab sample custodian Signature Date Time Sample Disposition ☐ Return to Site ☐ Discard ☐ Hold ____ days

Date 8.5.88 Weather cloudy 65-70°F Page 1 of 3

ERM-West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location HUNTER'S PT.

Sampler (signature) ASC /

Printed name ARUN CHEMBURKAR /

Lab Report Recipient

Telephone No.

Receiving Lab CENTRAL COAST ANA. SER.

Address 141 SUBURBAN ROAD, SUITE G-4

SAN LUIS OBISPO, CA 93401

Sample ID#	Time	W-water S-soil	C-comp G-grab	Volume	Collection: Container type	Collection: ICED	Collection: Preservative	Collection: Sampling method	GC: TPH-Extraction	GC: BTEX/Total Fuel HCs	GC: 601 / 8010 Halocarbons	GC: 602 / 8020 Aromatics	GC: 604 / 8040 Phenols	GC: [redacted] / 8080 Pest/PCBs	GC/MS: 624-8240 Purgeables	GC/MS: 625-8270 BNAs & Pest (SVs)	GC/MS: Dioxins	Inorg: Metals	Inorg: Wet Chemistry	Other	Number of Containers	Remarks
3D-8 [redacted]	1302	S	G	GLASS JAR	Y	N	7569							✓							1	PCB 8080
3C-9	1305						7570														1	+
3C-11	1309						7571														1	% Moisture
3B-8	1316						7572														1	
3B-10	1318						7573														1	
3B-12	1321						7574														1	
3C-13	1328						7575														1	
3C-15	1332						7576														1	
3D-14	1337						7577														1	

5-Day Turnaround

EPA Protocol

Precautions: Conc: ☒ Lo ☐ Med ☐ Hi Ship Via Total Number of Containers: 9

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Arun	05/05		Nicholas Havlicek	5/8	1834	
Company			Company C.A.S.			
Company			Company			

LABORATORY—Please Complete

Lab sample custodian ☐ Samples Intact ☐ Samples at 4°C ☐ Samples not leaking ☐ # of containers matches C-of-C ☐ Container tags match C-of-C ☐ Cooler seals Intact

Signature Date Time

Sample Disposition ☐ Return to Site ☐ Discard ☐ Hold ____ days

Date 8/8/88 Weather Cool, Sunny, windy Page 1 of 2

ERM West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location Hunters Pt. S.F.

Sampler (signature) Arun Chemburkar + Cheryl Seath

Printed name ARUN CHEMBURKAR + CHERYL SEATH

Lab Report Recipient

Telephone No.

Receiving Lab CENTRAL COAST ANALYTICAL

Address SUBURBAN BD. STE. C-4

SAN LUIS OBISPO, CA. 93401

Sample ID#	Time	W=water S=soil	C=comp G=grab	Volume	Container type	ICED	Preservative	Sampling method	TPH-Extraction	BTEX/Total Fuel HCs	601 / 8010 Halocarbons	602 / 8020 Aromatics	604 / 8040 Phenols	608 / 8080 Pest/PCBs	624-8240 Purgeables	625-8270 BNAs & Pest (SVs)	Dioxins	Metals	Wet Chemistry	Other	Number of Containers	Remarks
7672 3D-18 (1.5-2')	1038	S	G	1/2 lb.	3x6" Brass Tube	Y	N	Calif. mod. Sten Hollow Auger						X							1	PCB by EPA
7673 3C-19 (2-2.5')	1056													X							1	method 8080
7674 3C-17 (2-2.5')	1113													X							1	and
7675 3B-18 (2-2.5')	1129													X							1	% Moisture
7676 3B-16 (2-2.5')	1142													X							1	
7677 3B-14 (2-2.5')	1153													X							1	
7678 3A-13 (2-2.5')	1205													X							1	
7679 3A-11 (2-2.5')	1218													X							1	
7680 3B-6 (2-2.5')	1228													X							1	
7681 3A-9 (1.5-2')	1141													X							1	

5 DAY Turn Around!

Precautions: Conc: ☒ Lo ☐ Med ☐ Hi Ship Via Bus Total Number of Containers: 10

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Cheryl Seath Company ERM-West	8/9/88	0914	Joni Farlick Company	8/9/88	18:00	
Cheryl Seath (for Arun C) Company ERM-West	8/8/88	1900	Company			

LABORATORY— Please Complete Lab sample custodian Signature ☐ Samples Intact ☐ Samples at 4°C ☐ Samples not leaking Date ☐ # of containers matches C-of-C Time ☐ Container tags match C-of-C ☐ Cooler seals intact

Sample Disposition ☐ Return to Site ☐ Discard ☐ Hold ____ days

7.20.88 D.L.

Date 8/8/88 Weather Cool, windy, Sunny Page 2 of 3

ERM-West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location Hunters Pt. S.F.

Sampler (signature) Cheryl E. Seath + Arun Chemburkar

Printed name Cheryl E. Seath + Arun Chemburkar

Lab Report Recipient

Telephone No.

Receiving Lab Central Coast Analytical

Address 141 SUBURBAN RD. STE. L-4

SAN LUIS OBISPO, CA. 93401

Sample ID#	Time	W=water S=soil	C=comp G=grab	Volume	Container type	ICED	Preservative	Sampling method	TPH-Extraction	BTEX/Total Fuel HCs	601 / 8010 Halocarbons	602 / 8020 Aromatics	604 / 8040 Phenols	608 / 8080 Pest/PCBs	624-8240 Purgeables	625-8270 BNAs & Pest (SVs)	Dioxins	Metals	Wet Chemistry	Number of Containers	Remarks
7682 3C-5 (1.5-2')	1342	S	G	.5 lb.	2x6" Brass Tubes	Y	N	CALIF. MODIFIED 6" HOL LOW STEM AUGER						X						1	TEST METHOD 8080 FOR PCB'S AND % MOISTURE
7683 3D-4 (2.5-3')	1352													X						1	
7684 3E-5 (2-2.5')	1406													X						1	
7685 3F-4 (2-2.5')	1420													X						1	
7686 3G-5 (2.5-3')	1435													X						1	
7687 3G-7 (2.5-3')	1451													X						1	
7688 3H-6 (2-2.5')	1506													X						1	
7689 3H-8 (2-2.5')	1520													X						1	
7690 3J-9 (2.5-3')	1608													X						1	
7691 3K-10 (2.5-3')	1620													X						1	

5 DAY TURN AROUND!

Precautions: Conc: [X] Lo [ ] Med [ ] Hi Ship Via Bus Total Number of Containers: 10

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Cheryl E. Seath Company ERM-West			Lane Hardwick Company	8/8/88	1500	
Cheryl Seath (for ASC) Company ERM-West	8/8/88	1900	Company			

LABORATORY—Please Complete Lab sample custodian [ ] Samples Intact [ ] Samples at 4°C [ ] Samples not leaking [ ] # of containers matches C-of-C [ ] Container tags match C-of-C [ ] Cooler seals intact

Signature Date Time

Sample Disposition [ ] Return to Site [ ] Discard [ ] Hold ____ days

7.29.88 D.H.

Date 8/8/88 Weather cold, windy, sunny Page 3 of 5

ERM-West

1777 Botelho Drive • Suite 260 • Walnut Creek, CA • 94596 • (415) 946-0455

Chain of Custody Record

Job # 40058

Job Location Hunters Pt. B.F.

Sampler (signature) Arun Chemburkar + Cheryl Seath

Printed name Arun Chemburkar + Cheryl Seath

Lab Report Recipient

Telephone No.

Receiving Lab Central Coast Analytical

Address 141 SUBURBAN RD. STE C-1

SAN LUIS OBISPO, CA 93401

6

Sample ID#	Time	W-water S-soil	C-comp G-grab	Volume	Container type	ICED	Preservative	Sampling method	TPH-Extraction	BTEX/Total Fuel HCs	601 / 8010 Halocarbons	602 / 8020 Aromatics	604 / 8040 Phenols	8080 Pest/PCBs	624-8240 Purgeables	625-8270 BNAs & Pest (SVs)	Dioxins	Metals	Wet Chemistry	Other	Number of Containers	Remarks
7692 3K-12 (2.5-3')	1645	S	G	≈.5 lb.	2x6" Brass Tube	Y	N	6" Hollow Stem Auger						X							1	5 DAY TURN AROUND TIME! EPA Protocol: PCB Method 8080 and % Moisture
7693 3F-14 (2.0-2.5')	1657	S	G	"										X							1	
7694 3E-17 (2-2.5')	1713	S	G	"										X							1	
7695 3G-15 (1.5-2')	1605	S	G	.25 lb.	1x6" Brass Tube	Y	N	Hand Auger						X							1	
7696 3H-12 (1.5-2')	1625													X							1	
7697 3J-13 (1.5-2')	1640													X							1	
7698 3H-14 (1.5-2')	1702													X							1	
7699 3D-16 (1.5-2')	1715													X							1	

Precautions: Conc: [X] Lo [ ] Med [ ] Hi | Ship Via | Total Number of Containers: 8

Sample Relinquished By	Date	Time	Received By	Date	Time	Reason for Transfer (List Shipping Bill Number)
Cheryl Seath Company ERM-West	8/9/88	0914	Kim Hartlieb Company	8/9/88	15:00	
Cheryl Seath (for Arun) Company ERM-West	8/8/88	1900	Company			

LABORATORY—Please Complete: Lab sample custodian [ ] Samples Intact [ ] Samples at 4°C [ ] Samples not leaking [ ] # of containers matches C-of-C [ ] Container tags match C-of-C [ ] Cooler seals Intact

Signature Date Time

Sample Disposition: [ ] Return to Site [ ] Discard [ ] Hold ____ days

7.29.88 D.L.

APPENDIX F

LABORATORY QUALITY CONTROL ASSURANCE AND QUALITY CONTROL PROCEDURES

Central Coast Analytical Services

CENTRAL COAST ANALYTICAL SERVICES
Air, Water & Hazardous Waste Analysis
141 Suburban Road, Suite C-4
San Luis Obispo, California 93401
(805) 543-2553

RECEIVED
NOV 13 1987
ERM-WEST
WALNUT CREEK, CA

August 1, 1986

QUALITY ASSURANCE/QUALITY CONTROL PROCEDURE

1. Chain of Custody samples are stored in locked refrigerators.

2. The assignment of unique laboratory numbers to each sample as it is logged in has been extended to include the assignment of unique log numbers to subsamples on a container-by-container basis.

3. A central standard logbook is maintained for all standards. Information such as suppliers, lot numbers, weight/volume of standards used, date prepared and the name of the analyst preparing the standard are all part of the records kept therein.

4. The laboratory runs calibration standards at a minimum of three concentrations. We bracket sample data with standards.

5. We confirm all positive gas chromatographic results by either a second column or by GC/MS.

6. Blanks, duplicates, and spikes are analyzed once per batch, once per matrix type or once per 20 samples, whichever is more frequent. We have adopted an "all with the final report" filing system.

7. Records of the analysis of blank samples are recorded in individual laboratory notebooks, referred to on laboratory worksheets and documented on instrument use record books.

8. Acceptance limits for quality control samples currently used by our laboratory are summarized in Table I.

9. All analytical and quality control results are reviewed and approved by a supervisor. Data of an unusual nature are brought to the attention of one of our three Ph.D. chemists for final review.

10. Instructions for corrective action in the event of an out-of-control method are as follows: Stop analyses. Conduct investigation. Check mathematics. Check dilutions for systematic error. Check syringes, automatic pipettes, ect. for possible malfunction. Check dates on standards. Remake standards. If instrument malfunction is indicated, arrange for

service. Analyses may resume only when problem has been identified and corrected.

11. Repair and maintainence records are documented for inspection and review.

12. Analytical results including raw data and chromatographs of method blanks, three point standard calibration and quality control samples (matrix spikes and matrix spike duplicates) for the following methods are available for review:

Method Number	Description
632	Carbamates
8030	Acrolein, Acrylonitrile & Acetonitrile
8060	Phthalate Esters
8090	Nitroaromatics & Cyclic Ketones
8120	Chlorinated Hydrocarbons

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Metals by AA *	Liquid	10X	80-115	15
	Solid		65-130	30
As	Liquid	468	70-128	25
	Solid	12500	60-135	35
Cd	Liquid	90	80-122	25
	Solid	12500	60-135	35
Cr	Liquid	916	75-120	20
	Solid	20000	60-135	35
Co	Liquid	303	82-115	15
	Solid	12500	60-135	40
Cu	Liquid	110	84-117	15
	Solid	180000	65-130	40
Pb	Liquid	556	85-120	15
	Solid	18000	75-125	25
Hg	Liquid	24	65-133	30
	Solid	6100	40-150	45
Ni	Liquid	121	82-118	15
	Solid	9000	55-140	40
Se	Liquid	45	50-131	40
	Solid	12500	40-150	45
V	Liquid	791	82-123	25
	Solid	9000	55-140	40
Zn	Liquid	1378	85-114	15
	Solid	360000	40-150	45
Tl	Solid	1800	50-145	40
Ag	Solid	1800	12-160	45
Sb	Solid	6100	60-135	35
Be	Solid	16300	55-140	40
Al	Liquid	815	78-125	25

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE

SAMPLES-Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Chlorinated Herbicides *	Liquid	300	75-120	25
2,4-D	Liquid	300	75-120	25
Silvex	Liquid	70	75-120	25
2,4,5-T	Liquid	30	75-125	25
Phenols *	Liquid Solid	300	40-140	45
2-Chlorophenol	Liquid	100	25-135	45
	Solid	10030	32-140	50
2-Nitrophenol	Liquid	500	D-150	100
	Solid	4020	D-150	100
Phenol	Liquid	300	5-112	75
	Solid	4000	D-150	100
2,4-Dimethyl-phenol	Liquid	300	12-150	75
	Solid	4020	D-150	100
2,4-Dichloro-phenol	Liquid	300	35-140	50
	Solid	10100	19-150	75
2,4,6-Tri-chlorophenol	Liquid	300	20-150	75
	Solid	10020	20-150	75
4-Chloro-3-methylphenol	Liquid	200	22-147	75
	Solid	10020	15-150	75
2,4-Dinitro-phenol	Liquid	500	D-160	100
	Solid	10000	D-150	100
2-Methyl-4,6-dinitrophenol	Liquid	500	5-160	75
	Solid	4020	D-160	100
Pentachloro-phenol	Liquid	100	14-176	75
	Solid	4010	D-180	100
4-Nitrophenol	Liquid	500	D-132	75
	Solid	4010	D-160	100

- TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES

- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Metals by ICP *	Liquid	10X	50-140	40
As	Liquid	22	70-125	25
Cd	Liquid	2.5	52-140	40
Cr	Liquid	10	46-145	40
Cu	Liquid	11	10-160	75
Pb	Liquid	24	15-155	75
Ni	Liquid	60	58-135	40
Se	Liquid	6	D-200	100
Zn	Liquid	16	10-170	75
Be	Liquid	20	70-125	25
Co	Liquid	120	40-150	50
V	Liquid	70	80-115	15
Carbamate by LC	Liquid	100X	80-115	15
Polychlorinated Biphenyls (see organochlorine pesticides)				
Aromatic Volatile Organics				
Benzene	Liquid	9	64-130	40
Chlorobenzene	Liquid	100	70-127	30
1,2-Dichloro-benzene	Liquid	10	16-170	75
1,3-Dichloro-benzene	Liquid	5	37-150	75
1,4-Dichloro-benzene	Liquid	10	40-170	75
Ethylbenzene	Liquid	10	62-137	40
Toluene	Liquid	100	41-136	75

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Halogenated Volatile Organics			
Bromodichloromethane Liquid	0.5	85-115	15
Bromoform Liquid	50	60-130	30
Carbon tetrachloride Liquid	50	20-140	75
Chlorobenzene Liquid	50	67-121	25
Chloroethane Liquid	50	30-150	75
2-Chloroethyl vinyl ether Liquid	133	66-126	30
Chloroform Liquid	50	60-160	40
Chloromethane Liquid	24	50-140	50
Dibromochloromethane Liquid	93	78-118	25
1,2-Dichlorobenzene Liquid	150	85-115	15
1,3-Dichlorobenzene Liquid	50	79-112	25
1,4-Dichlorobenzene Liquid	50	70-124	25
1,1-Dichloroethane Liquid	45	80-120	25
1,2-Dichloroethane Liquid	45	80-120	25
1,1-Dichloroethylene Liquid	50	40-150	60
t-1,2-Dichloroethylene Liquid	98	30-150	75
1,2-Dichloropropane Liquid	39	70-125	25
t-1,3-Dichloropropylene Liquid	50	22-150	75
1,1,2,2-Tetrachloroethane Liquid	45	45-135	45
Tetrachloroethylene Liquid	35	35-150	75
1,1,1-Trichloroethane Liquid	29	45-135	50
1,1,2-Trichloroethane Liquid	50	20-150	75
Trichloroethylene Liquid	45	80-120	25
Vinyl Chloride Liquid	32	70-130	25

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Base/Neutrals				
Acenapthene	Liquid	100	47-145	45
	Solid	2010	26-130	75
Acenaphthalene	Liquid	2000	31-140	75
	Solid	2020	25-130	75
Anthracene	Liquid	2000	30-140	75
	Solid	4040	32-132	75
Benzo(a)anth-	Liquid	2000	30-140	75
racene	Solid	2020	7-150	100
Benzo(b)fluor-	Liquid	2000	17-140	100
anthene	Solid	4420	6-150	100
Benzo(k)fluor-	Liquid	2000	17-140	100
anthene	Solid	4420	6-150	100
Benzo(ghi)per-	Liquid	2000	D-180	200
ylene	Solid	62000	40-160	75
Benzo(a)pyrene	Liquid	2000	17-140	100
	Solid	2080	18-130	100
Benzidine	Liquid	2000	0-150	200
	Solid	2010	EPA NOT ABLE TO RECOVER	
Butyl benzyl	Liquid	2000	D-150	200
phthalate	Solid	2020	7-150	100
Bis(2-chloro-	Liquid	2000	D-150	200
ethoxy)methane	Solid	2020	9-150	100
Bis(2-chloro-	Liquid	2000	D-150	200
ethyl)ether	Solid	2020	D-150	200
Bis(2-chloro-	Liquid	2000	D-150	200
ispropyl)ether	Solid	10020	30-150	75
Bis(2-ethyl-	Liquid	2000	D-200	200
hexyl)phthal.	Solid	32210	30-150	75
4-Bromophenyl	Liquid	2000	30-150	75
phenyl ether	Solid	2070	30-150	75
2-Chloro-	Liquid	2000	37-150	75
naphthalene	Solid	1920	30-150	75
4-chlorophenyl	Liquid	2000	30-150	75
phenyl ether	Solid	2010	15-130	100
Chrysene	Liquid	2000	37-150	75
	Solid	2020	7-150	100
Dibenzo(a,h)	Liquid	2000	D-170	200
anthracene	Solid	61400	34-200	100
Di-n-butyl	Liquid	2000	D-200	200
phthalate	Solid	2010	5-180	100
1,2-Dichloro	Liquid	100	1-118	125
benzene	Solid	77200	50-128	50

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
1,3-Dichloro	Liquid	100	1-118	125
benzene	Solid	8540	D-170	200
1,3-Dichloro	Liquid	100	1-118	125
benzene	Solid	54800	29-142	75
3,3-Dichloro-	Liquid	2000	D-300	200
benzidine	Solid	10000	D-300	200
Dimethyl	Liquid	2000	3-130	125
phthalate	Solid	2010	21-140	100
2,4-Dinitro-	Liquid	200	50-158	75
toluene	Solid	2030	18-140	100
2,6-Dinitro-	Liquid	200	50-158	75
toluene	Solid	2030	18-140	100
Di-n-octyl	Liquid	2000	D-200	200
phthalate	Solid	2030	12-170	100
Fluoranthene	Liquid	2000	20-140	100
	Solid	2010	D-170	150
Fluorene	Liquid	2000	20-140	100
	Solid	2010	30-160	100
Hexachloro-	Liquid	2000	26-150	100
benzene	Solid	1610	63-133	50
Hexachloro-	Liquid	2000	D-200	200
butadiene	Solid	2050	0-200	200
Hexachloro-	Liquid	2000	D-200	200
cypentadiene	Solid	2010	EPA NOT ABLE TO RECOVER	
Hexachloro-	Liquid	2000	D-200	200
ethane	Solid	2000	56-151	75
Indeno(1,2,3-	Liquid	2000	D-200	200
cd) pyrene	Solid	50010	34-180	100
Isophorone	Liquid	2000	D-200	200
	Solid	2020	9-142	100
Naphthalene	Liquid	2000	D-200	200
	Solid	152500	55-126	75
Nitrobenzene	Liquid	2000	D-200	200
	Solid	42100	16-150	125
N-Nitrosodi-n-	Liquid	2000	D-200	200
propylamine	Solid	10020	62-180	75
N-Nitrosodi-	Liquid	2000	6-170	100
phenylamine	Solid	10000	0-200	200
Phenanthrene	Liquid	2000	29-136	100
	Solid	2010	26-130	75
Pyrene	Liquid	2000	29-136	100
	Solid	2020	16-160	100
Trichloro-	Liquid	2000	17-170	100
benzene	Solid	2200	3-160	125

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
EPA 624/8240 Purgeable Organics				
Benzene	Liquid	100	68-130	40
	Solid	99	80-100	50
Bromodichloro-	Liquid	100	73-130	30
methane	Solid	10	60-170	50
Bromoform	Liquid	100	52-152	50
	Solid	10	70-150	50
Bromomethane	Liquid	100	22-169	75
Carbon tetra-	Liquid	100	69-149	40
chloride	Solid	10	61-150	50
Chlorobenzene	Liquid	100	75-130	30
	Solid	10	10-150	100
Chloroethane	Liquid	100	14-190	100
2-Chloroethyl vinyl ether	Liquid	100	75-150	35
Chloroform	Liquid	100	64-136	40
	Solid	10	85-132	40
Chloromethane	Liquid	100	28-172	75
Dibromochloro-	Liquid	100	62-146	40
methane	Solid	1	33-126	75
1,1-Dichloro-	Liquid	100	60-150	40
ethane	Solid	10	31-150	75
1,2-Dichloro-	Liquid	100	72-132	35
ethane	Solid	10	13-160	100
1,1-Dichloro-	Liquid	100	54-145	40
ethene	Solid	10	10-170	100
t1,2-Dichloro-	Liquid	100	71-130	35
ethene	Solid	10	23-147	100
1,2-Dichloro-	Liquid	100	67-136	40
propane	Solid	10	35-144	75
c1,3-Dichloro-	Liquid	100	45-157	50
propene	Solid	8	45-140	75
t1,3-Dicloro-	Liquid	100	46-154	50
propene	Solid	10	48-142	100
Ethylbenzene	Liquid	100	73-133	40
	Solid	10	43-130	100
Methylene	Liquid	100	8-187	200
Chloride	Solid	10	28-130	200
1,1,2,2-Tetra-	Liquid	100	60-146	40
chloroethane	Solid	10	D-250	300
Tetrachloro-	Liquid	100	67-133	70
ethene	Solid	10	D-250	300

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
Toluene	Liquid	100	56-140	40
	Solid	10	61-120	45
1,1,1-Tri-chloroethane	Liquid	100	54-150	40
	Solid	10	23-140	150
1,1,2-Tri-chloroethane	Liquid	100	59-149	40
	Solid	10	55-127	50
Trichloro-ethene	Liquid	100	64-136	40
	Solid	10	18-145	150
Trichloro-fluoromethane	Liquid	100	50-164	75
Vinyl chloride	Liquid	100	23-173	180
EPA 8030 PURGEABLE ORGANIC COMPOUNDS				
Acrolein	Liquid	20	61-135	45
Acrylonitrile	Liquid	20	85-124	40
EPA 8060 PHTHALATE ESTERS				
Bis(2-ethyl-hexyl)phthalate	Liquid	1000	74-111	45
Butyl benzyl phthalate	Liquid	1000	66-116	50
Dibutyl-phthalate	Liquid	1000	65-115	50
Diethyl phthalate	Liquid	50	90-110	40
Dimethyl phthalate	Liquid	50	84-110	40
Dioctyl phthalate	Liquid	150	73-113	40
EPA 8090 NITROAROMATICS AND CYCLIC KETONES				
2,4-Dinitro-toluene	Liquid	100	55-110	75
2,6-Dinitro-	Liquid	50	60-110	75
Isophorone toluene	Liquid	50	63-110	75
Nitrobenzene	Liquid	100	58-113	75
EPA 8100 POLYNUCLEAR AROMATIC HYDROCARBONS				
Same as EPA 625/8270				

TABLE I - ACCEPTANCE LIMITS for QUALITY ASSURANCE SAMPLES
- Continued

ANALYTICAL PROCEDURE or PARAMETER GROUP	Matrix	SPIKE LEVEL ppb	SPIKE ACCEPTABLE % RANGE	DUPLICATE ACCEPTABLE % DIFFERENCE
EPA 8120 CHLORINATED HYDROCARBONS				
2-Chloro-naphthalene	Liquid	200	19-157	180
1,2-Dichloro-benzene	Liquid	300	57-125	100
1,3-Dichloro-benzene	Liquid	200	40-146	150
1,4-Dichloro-benzene	Liquid	300	35-153	150
Hexachloro-benzene	Liquid	10	61-134	75
Hexachloro-butadiene	Liquid	30	66-130	75
Hexachloro-ethane	Liquid	10	63-136	75
1,2,4-Tri-chlorobenzene	Liquid	10	48-148	125
EPA 8140 ORGANOPHOSPORUS PESTICIDES				
Azinphos methyl	Liquid	200	32-141	150
Bolstar	Liquid	40	53-115	75
Chlorpyrifos	Liquid	50	82-116	45
Coumaphos	Liquid	200	70-147	75
Demeton	Liquid	300	46-121	100
Diazinon	Liquid	5	55-112	75
Dichlorvos	Liquid	500	55-117	75
Disulfoton	Liquid	80	60-122	75
Ethoprop	Liquid	50	88-112	45
Fensulfothion	Liquid	100	46-148	150
Fenthion	Liquid	50	33-136	150
Merphos	Liquid	50	76-145	75
Mevinphos	Liquid	500	34-123	150
Naled	Liquid	200	69-119	75
Parathion methyl	Liquid	500	81-115	45
Phorate	Liquid	40	46-117	150
Ronnel	Liquid	50	83-117	45
Stirophos	Liquid	500	54-112	150
Tokuthion	Liquid	50	51-113	150
Trichloronate	Liquid	20	46-161	150

93, 96–98, and 104–115 to new Table IB, entitled "List of Approved Inorganic Test Procedures", adding two new inorganic parameters, Carbonaceous Biochemical Oxygen Demand (CBOD5) and Nitrate-Nitrite, including an additional test procedure based upon the inductively coupled plasma technique in Table IB for 25 of the metal parameter designations, by including 10 methods approved under the equivalency provisions of §§ 136.4(d) and 136.5(e), and updating references to EPA, Standard Methods, ASTM, AOAC and USGS test procedures; by deleting former parameter 14 (Chlorinated organic compounds) and by entering the individual chlorinated organic compounds into new Table IC, entitled, "List of Approved Test Procedures for Non-Pesticide Organic Compounds", transferring old parameters 9 (Benzidine) and 94 (Pentachlorophenol) to Table IC, by including the 78 additional proposed non-pesticidal organic parameters and by adding 17 new test procedures in Table IC; by deleting former parameter 95 (Pesticides) and by entering the 68 individual pesticides into new Table ID, entitled "List of Approved Test Procedures for Pesticides", by including the 2 additional proposed pesticide parameters, and the two new test procedures in Table ID; and by transferring the former radiological parameters 101–105 to new Table IE, entitled "Approved Radiological Test Procedures", adding an EPA reference to the approved test procedures, and updating the Standard Methods, ASTM and USGS references. As revised, Table I reads as follows:

§ 136.3 Identification of Test Procedures.

• • • • •

TABLE IA.—LIST OF APPROVED BIOLOGICAL TEST PROCEDURES

Parameter and units	Method [1]	EPA [2]	Reference (Method Number or Page)		
			Standard Methods 15th Ed.	ASTM	USGS
Bacteria:					
1. Coliform (fecal) number per 100 ml	MPN, 5 tube, 3 dilution, or, membrane filter (MF) [3], single step	p. 132	908C		
		p. 124	909C		I-0050-77.
2. Coliform (fecal) in presence of chlorine number per 100 ml	MPN, 5 tube, 3 dilution	p 132	908C		
3. Coliform (total), number per 100 ml	MPN, 5 tube, 3 dilution; or, MF [3] single step or two step	p. 114	908A		
		p. 108	909A		I-0025-77.
4. Coliform (total) in presence of chlorine, number per 100 ml	MPN, 5 tube, dilution; or MF [3] with enrichment	p. 114	908A		
		p. 111	909 (A + A.5c)		
5. Fecal streptococci, number per 100 ml	MPN, 5 tube, 3 dilution; MF [3]; or, plate count	p. 139	910A		
	p. 136	9108		B0055-77.[9]	
	p 143	910C			

Table IA Notes

[1] The method must be specified when results are reported

[2] "Microbiological Methods for Monitoring the Environment, Water and Wastes, 1978", EPA-600/8-78-017, U.S. Environmental Protection Agency.

[3] Greeson, P.E., *et al.*, Methods for Collection and Analysis of Aquatic Biological and Microbiological Samples, "U.S. Geological Survey, Techniques of Water-Resources Investigations, Book 5, Chapter A4, Laboratory Analysis, 1977

[4] 0.45 um membrane filter or other pore size certified by the manufacturer to fully retain organisms to be cultivated, and free of extractables which could interfere with their growth and development.

[5] Approved only if dissolution of the KF Streptococcus Agar (Section 5.1, USGS Method B-0055-77) is made in a boiling water bath to avoid scorching of the medium.

TABLE IB.—LIST OF APPROVED INORGANIC TEST PROCEDURES

Parameter, units, and method	Reference (method No. or page)				
	EPA 1979	Standard methods 15th Ed.	ASTM	USGS [1]	Other
1. Acidity, as $CaCO_3$, mg/L Electrometric end point or phenolphthalein end point	305.1	402(4.d)	D1067-70(E)		
2. Alkalinity, as $CaCO_3$, mg/L Electrometric or color titration:					
Titration to pH 4.5, manual	310.1	403	D1067(B)	I-1030-78	P. 548.[3]
Or automated	310.2			I-2030-78	
3. Aluminum—Total [2] mg/L Digestion [3] followed by:					
AA direct aspiration	202.1	303C		I-3051-78	
AA furnace	202.2	304			
Inductively coupled plasma					Method 200.7.[4]
Or colorimetric (Eriochrome cyanine R)		306B			
4. Ammonia (as N), mg/L Manual distillation [5] (at pH 9.5):					
Followed by	350.2	417A			
Nesslerization	350.2	417B	D1426-79(A)	I-3520-78	P. 553.[3]
Titration	350.2	417D			
Electrode	350.3		D1426-79(D)		
Automated phenate or	350.1	417F	D1426-79(C)	I-4523-78	[4]
Automated electrode					[4]
5. Antimony—Total [2], mg/L Digestion [3] followed by					
AA direct aspiration	204.1	303A			
AA furnace, or	204.2	304			
Inductively coupled plasma					Method 200.7.[4]
6. Arsenic—Total [2], mg/L					
Digestion [3] followed by	206.5				
Hydride	206.3	303E	D2972-78(B)	I-3062-78	
AA furnace	206.2	304			
Inductively coupled plasma					Method 200.7.[4]
Or, colorimetric (SDDC)	206.4	307B	D2972-78(A)	I-3060-78	
7. Barium—Total [2], mg/L Digestion [3] followed by					
AA direct aspiration	208.1	303C		I-3084-78	
AA furnace, or	208.2	304			
Inductively coupled plasma					Method 200.7.[4]
8. Beryllium—Total [2], mg/L Digestion [3] followed by					
AA direct aspiration	210.1	303C	D3645-78	I-3095-78	
AA furnace	210.2	304			

TABLE IB.—LIST OF APPROVED INORGANIC TEST PROCEDURES—Continued

Parameter, units, and method	Reference (method No. or page)				
	EPA 1979	Standard methods 15th Ed.	ASTM	USGS [1]	Other
Inductively coupled plasma					Method 200.7.[4]
Or colorimetric (aluminon)		3098			
9. Biochemical oxygen demand (BOD_5), mg/L:					
Winkler (Azide modification)	405.1	507		I-1578-78	P. 17.[5]
Or electrode method					P. 548.[5]
10. Boron—Total, mg/L:					
Colorimetric (curcumin) or	212.3	404A		I-3112-78	
Inductively coupled plasma					Method 200.7.[4]
11. Bromide, mg/L: Titrimetric	320.1		D1246-77(C)	I-1125-78	P. 844.[5]
12. Cadmium—Total[3], mg/L: Digestion[2] followed by:					
AA direct aspiration	213.2	303A or 303B	D3557-78 (A or B)	I-3135-78 or I-3136-78	Pg. 557.[5]
AA furnace	213.2	304			P. 37.[5]
Inductively coupled plasma					Method 200.7.[4]
Voltammetry[6] or			D3557-78(C)		
Colorimetric (Dithizone)		3108			
13. Calcium—Total[3], mg/L: Digestion[2] followed by					
Atomic absorption	215.1	303A	D511-77(C)	D152-78	
Inductively coupled plasma					Method 200.7.[4]
Or EDTA titration	215.2	311C	D511-77(B)		
14. Carbonaceous Biochemical oxygen demand (CBOD$_5$), mg/L: Winkler (Azide modification) or electrode method with nitrification inhibitor.		507(5 e.6)			
15. Chemical oxygen demand (COD), mg/L:					
Titrimetric colorimetric	410.1	508A	D1252-78	I-3560-78	P. 550[5] and
Manual or	410.2			I-3562-78	P. 17[5] and
	410.3			I-3561-78	(10.)
Automated	410.4				
Spectrophotometric					(11)
16. Chloride, mg/L:					
Titrimetric (silver nitrate) or		407A	D512-67(B)	I-1183-78	
Mercuric nitrate	325.3	407B	D512-67(A)	I-1184-78	P. 554.[5]
Colorimetric (ferricyanide) manual or			D512-67(C)	I-1187-78	
Automated	325.1 or 325.2	407D		I-2187-78	
17. Chlorine—Total residual, mg/L					
Titrimetric-amperometric [12]	330.1	408C	D1253-76(A)		
Starch end point	330.2	408B			
Iodometric or	330.3	408A	D1253-76(B)		
DPD-FAS	330.4	408D			
Spectrophotometric, DPD, or	330.5	408E			
Electrode					(9.)
18. Chromium VI dissolved, mg/L 0.45 micron filtration with:					
Extraction and atomic absorption, or	218.4	303B		I-1232-78	
Colorimetric (Diphenylcarbazide)				I-1230-78	
19. Chromium—Total[3], mg/L					
Digestion[2] (optional extraction) followed by	218.3				
AA direct aspiration	218.1	303A or 303B	D1687-77(D)	I-3236-78	P. 557.[5]
AA furnace	218.2	304			
Inductively coupled plasma					Method 200.7.[4]
Or colorimetric (Diphenylcarbazide)		312A	D1687-77(A)		
20. Cobalt—Total[3], mg/L Digestion[2] followed by					
AA direct aspiration	219.1	303A or 303B	D3558-77 (A or B)	I-3240-78 or I-3239-78	P. 37.[5]
AA furnace, or	219.2	304			
Inductively coupled plasma					Method 200.7.[4]
21. Color, platinum Cobalt units or dominant wavelength hue, luminence, purity					
Colorimetric, ADMI	110.1	204D			(13.)
Platinum cobalt, or	110.2	204A		I-1250-78	
Spectrophotometric	110.3	204B			
22. Copper—Total[3], mg/L Digestion[2] followed by					
AA direct aspiration	220.1	303A or 303B	D1688-77 (D or E)	I-3271-78 or I-3270-78	P. 557[5] and P. 37.[5]
AA furnace	220.2	304			
Inductively coupled plasma					Method 200.7.[4]
Colorimetric (Neocuproine)		313B	D1688-77(A)		
Bicinchoninate					(14.)
23. Cyanide—Total mg/L					
Manual distillation with MgCl,	335.2	412D			
Followed by titrimetric	335.2	412B			P. 22.[5]
Manual or	335.2	412C	D2036-75(A)		
Automated [15] spectrophotometric	335.3	412D	D2036-75(A)	I-3300-78	
24. Cyanide amenable to chlorination, mg/L Manual distillation with MgCl, Followed by titrimetric, manual or automated [15] spectrophotometric	335.1	412F	D2036-75(B)		
25. Fluoride—Total, mg/L					
Manual distillation [7]		413A			
Followed by manual or	340.2	413B	D1179-72(B)		
Automated electrode				I-4327-78	
SPADNS	340.1	413C	D1179-72(A)		
Or automated complexone	340.3	413E			
26. Gold—Total[3], mg/L Digestion[2] followed by					
AA direct aspiration	231.1	303A			
Or AA furnace	231.2	304			
27. Hardness—Total as $CaCo_3$, mg/L					
Automated colorimetric	130.1				
EDTA titration	130.2	314B	D1126-67(B)	I-1338-78	
Inductively coupled plasma					Method 200.7.[4]
Or atomic absorption (sum of Ca and Mg as their respective carbonates)	215.1, 242.1	303A		I-3153-78, I-3449-78	

TABLE IB.—LIST OF APPROVED INORGANIC TEST PROCEDURES—Continued

Parameter, units, and method	Reference (method No. or page)				
	EPA 1979	Standard methods 15th Ed.	ASTM	USGS [1]	Other
28. Hydrogen ion (pH), pH units:					
Electrometric	150.1	423	D1293-78(A) or D1293-78(B).	I-1586-78	
Measurements; or automated electrode					(14)
29. Indium—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	235.1	303A			
Or AA furnace	235.2	304			
30. Iron—Total [8], mg/L:					
Digestion [9] followed by		303A or 303B	D1068-77		
AA direct aspiration	236.1	303B	(C or D)	I-3381-78	P. 557.[9]
AA furnace	236.2	304			
Inductively coupled plasma					Method 200.7.[6]
Or colorimetric (Phenanthroline)		315B	D1068-77(A)		(14)
31. Kjeldahl nitrogen—Total (as N), mg/L:					
Digestion and distillation	351.3	420A or B			P. 552.[9]
Followed by titration	351.3	417D	D3590-77		
Nesslerization or	351.3	417B			
Electrode	351.3	417E		I-4551-78	
Automated phenate	351.1			I-4552-78	
Semi-automated block digestor	351.2				
Or potentiometric	351.4				
32. Lead—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	239.1	303A or 303B	D3559-78 (A or B)	I-3399-78	P. 567.[9]
AA furnace	239.2	304			
Inductively coupled plasma					Method 200.7.[6]
Voltammetry [9] or			D3559-78(C)		
Colorimetric (Dithizone)		318B			
33. Magnesium—Total [8], mg/L: Digestion [9] followed by:					
Atomic absorption	242.1	303A	D511-77(B)	I-3447-78	P. 557.[9]
Inductively coupled plasma					Method 200.7.[6]
Or gravimetric		318B	D511-77(A)		
34. Manganese—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	243.1	303A or 303B	D858-77 (B or C)	I-3454-78	P. 557.[9]
AA furnace	243.2	304			
Inductively coupled plasma					Method 200.7.[6]
Or colorimetric (Persulfate)		319B	D858-77(A)		P. 564.[6]
Periodate					18.
35. Mercury—Total [8], mg/L:					
Cold vapor, manual or	245.1	303F	D3223-79	I-3462-78	P. 558.[9]
Automated	245.2				
36. Molybdenum—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	246.1	303C		I-3490-78	
AA furnace, or	246.2	304			
Inductively coupled plasma					Method 200.7.[6]
37. Nickel—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	249.1	303A or 303B	D1886-77 (C or D)	I-3499-78	
AA furnace	249.2	304			
Inductively coupled plasma					Method 200.7.[6]
Or colorimetric (Heptoxime)		321B			
38. Nitrate (as N), mg/L:					
Brucine sulfate, or	352.1		D992-71		P. 554.[9]
Nitrate-nitrite N minus Nitrite N	See parameters 39 and 40.	See parameters 39 and 40.	See parameters 39 and 40.	See parameters 39 and 40.	P. 28.[6]
39. Nitrate-nitrite (as N), mg/L:					
Cadmium reduction, manual	353.3	418C	D3867-79(B)		
Or automated; or	353.2	418F	D3867-79(A)	I-4545-78	
Automated hydrazine	353.1				
40. Nitrite (as N), mg/L:					
Spectrophotometric, manual or	354.1	419	D1254-67		19.
Automated (Diazotization)				I-4540-78	
41. Oil and grease—Total recoverable, mg/L: Gravimetric (extraction)	413.1	503A			
42. Organic carbon—Total (TOC), mg/L: Combustion or oxidation	415.1	505	D2579-78(A) or D2579-78(B)		P. 551.[9] and P. 4.[10]
43. Organic nitrogen (as N), mg/L: Total Kjeldahl N minus ammonia N	See parameters 31 and 4.	420A	D3590-77 minus D1426-79(A).	See parameters 31 and 4.	PP. 552-53.[9]
44. Orthophosphate (as P), mg/L: Ascorbic acid method, automated	365.1	424G		I-4601-78	P. 561.[9]
Or manual single reagent or	365.2	424F	D515-78(A)		
Manual two reagent	365.3				
45. Osmium—Total [8], mg/L: Digestion [9] followed by					
AA direct aspiration, or	252.1	303C			
AA furnace	252.2	304			
46. Oxygen, dissolved, mg/L:					
Winkler (Azide modification)	360.2	421B	D1589-60(A)	I-1575-78	P. 550.[9]
Or electrode	360.1	421F		I-1576-78	
47. Palladium—Total [8], mg/L: Digestion [9] followed by:					
AA direct aspiration	253.1				P. 527.[10]
Or AA furnace	253.2				P. 528.[10]
48. Phenols, mg/L:					
Manual distillation	420.1		D1783-70 (A or B)		26.
Followed by manual	420.1				26.
Or automated [11] colorimetric (4AAP)	420.2				
49. Phosphorus (elemental), mg/L: Gas-liquid chromatography					21.

TABLE IB.—LIST OF APPROVED INORGANIC TEST PROCEDURES—Continued

Parameter, units, and method	Reference (method No. or page)				
	EPA 1979	Standard methods 15th Ed.	ASTM	USGS [1]	Other
50. Phosphorus—Total, mg/L					
Persulfate digestion	365.2	424C (1)			P. 561.[3]
Followed by manual or	365.2 or 365.3	424F	D515-78(A)		
Automated ascorbic acid	365.1	424G		I-4600-78	
Reduction, or semi-automated block digestor	365.4			I-4603-78	
51. Platinum—Total [2], mg/L: Digestion [3] followed by:					
AA direct aspiration	255.1	303A			
Or AA furnace	255.2	304			
52. Potassium—Total [2], mg/L: Digestion [3] followed by:					
Atomic absorption	258.1	303A		I-3630-78	P. 560.[3]
Inductively coupled plasma					Method 200.7.[4]
Or flame photometric		322B	D1428-64(A)		
53. Residue—total, mg/L: Gravimetric, 103–105°C	160.3	208A		I-3750-78	
54. Residue—filterable, mg/L: Gravimetric, 180°C	160.1	208B		I-1750-78	
55. Residue—nonfilterable, (TSS), mg/L: Gravimetric, 103–105°C post washing of residue.	160.2	209C		I-3765-78	
56. Residue—settleable, mg/L: Volumetric (Imhoff cone) or gravimetric.	160.5	209F			
57. Residue—volatile, mg/L: Gravimetric, 550°C	160.4	209E		I-3753-78	
58. Rhodium—Total [2], mg/L: Digestion [3] followed by:					
AA direct aspiration	265.1	303A			
Or AA furnace	267.2	304			
59. Ruthenium—Total [2], mg/L: Digestion [3] followed by:					
AA direct aspiration	267.1	303A			
Or AA furnace	267.2	304			
60. Selenium—Total [2] mg/L: Digestion [3] followed by:					
AA furnace	270.2	304			
Inductively coupled plasma					Method 200.7.[4]
Or hydride	270.3	303E	D3859-79	I-3667-78	
61. Silica—Dissolved, mg/L: 0.45 micron filtration:					
Followed by manual or	370.1	425C	D859-68(B)	I-1700-78	
Automated colorimetric (Molybdosilicate), or				I-2700-78	
Inductively coupled plasma					Method 200.7.[4]
62. Silver—Total [2] mg/L: Digestion [3] followed by:					
AA direct aspiration	272.1	303A or 303B		I-3720-78	P. 557.[3] and p. 37.[4]
AA furnace, or	272.1	304			
Inductively coupled plasma					Method 200.7.[4]
63. Sodium—Total [2], mg/L: Digestion [3] followed by:					
Atomic absorption	273.1	303A		I-3735-78	P. 561.[3]
Inductively coupled plasma					Method 200.7.[4]
Or flame photometric			D1428-64(A)		
64. Specific conductance, mhos/cm: Wheatstone bridge.	120.1	205	D1125-77(A)	I-1780-78	P. 547.[4]
65. Sulfate (as SO_4), mg/L:					
Automated methylthymol blue	375.2			I-2822-78	
Gravimetric, or	375.3	426A or 426B	D516-68(A)		PP. 562-63.[3]
Turbidimetric	375.4	426C	D516-68(B)		
66. Sulfide (as S), mg/L:					
Titrimetric (iodine) or	376.1	427D		I-3840-78	
Colorimetric (methylene blue)	376.2	427C			
67. Sulfite (as SO_3), mg/L: Titrimetric (iodine iodate)	377.1	428F	D1339-79(C)		
68. Surfactants, mg/L: Colorimetric (methylene blue)	425.1	512A	D2330-68(A)		
69. Temperature, °C: Thermometric	170.1	212			([5]).
70. Thallium—Total, [2] mg/L: Digestion [3] followed by:					
AA direct aspiration	279.1	303A			
AA furnace, or	279.2	304			
Inductively coupled plasma					Method 200.7.[4]
71. Tin—Total, [2] mg/L: Digestion [3] followed by:					
AA direct aspiration or	282.1	303A		I-3850-78	
AA furnace	282.2	304			
72. Titanium—Total, [2] mg/L: Digestion [3] followed by:					
AA direct aspiration or	283.1	303C			
AA furnace	283.2	304			
73. Turbidity, NTU: Nephelometric	180.1	214A	D1889-71	I-3860-78	
74. Vanadium—Total, [2] mg/L: Digestion [3] followed by:					
AA direct aspiration	286.1	303C			
AA furnace	286.2	304			
Inductively coupled plasma					Method 200.7.[4]
Or colorimetric (Gallic acid)			D3373-75		
75. Zinc—Total, [2] mg/L: Digestion [3] followed by:					
AA direct aspiration[6]	289.1	303A or 303B	D1691-77(D)	I-3900-78	P. 557.[3]
AA furnace	289.2	304	D1691-77(C)		P. 37.[4]
Inductively coupled plasma					Method 200.7.[4]
Or colorimetric (Zincon)					[6].

Table IB Notes

[1] "Methods for Analysis of Inorganic Substances in Water and Fluvial Sediments," U.S. Department of the Interior, U.S. Geological Survey, Open-File Report 78-679, or "Methods for Determination of Inorganic Substances in Water and Fluvial Sediments," N.W. Skougstad, *et al*, U.S. Geological Survey, Techniques of Water-Resources Investigation, Book 5, Chapter A1, 1979.

[2] "Official Methods of Analysis of the Association of Official Analytical Chemists" methods manual, 13th ed. (1980)

[3] For the determination of total metals the sample is not filtered before processing. A digestion procedure is required to solubilize suspended material and to destroy possible organic-metal complexes. Two digestion procedures are given in "Methods for Chemical Analysis of Water and Wastes, 1979." One (§ 4.1.3), is a vigorous digestion using nitric acid. A less vigorous digestion using nitric and hydrochloric acids (§ 4.1.4) is preferred, however, the analyst should be cautioned that this mild digestion may not suffice for all sample types. Particularly, if a colorimetric procedure is to be employed, it is necessary to ensure that all organo-metallic bonds be broken so that the metal is in a reactive state. In those situations, the vigorous digestion is to be preferred making certain that at no time does the sample go to dryness. Samples containing large amounts of organic materials would also benefit by this vigorous digestion. Use of the graphite furnace technique, inductively coupled plasma, as well as determinations for certain elements such as arsenic, the noble metals, mercury, selenium, and titanium require a modified digestion and in all cases the method write-up should be consulted for specific instructions and/or cautions.

Note: If the digestion procedure for direct aspiration or graphite furnace atomic absorption analyses included in one of the other approved references is different than the above, the EPA procedure must be used.

Dissolved metals are defined as those constituents which will pass through a 0.45 micron membrane filter. Following filtration of the sample, the referenced procedure for total metals must be followed. Sample digestion of the filtrate for dissolved metals, or digestion of the original sample solution for total metals may be omitted for AA (direct aspiration or graphite furnace) and ICP analyses provided the sample has a low COD and the filtrate meets the following criteria:

(a) Is visibly transparent,

(b) Has no perceptible odor, and

(c) Is free of particulate or suspended matter following acidification.

[6] The full text of Method 200.7, "Inductively Coupled Plasma Atomic Emission Spectrometric Method for Trace Element Analysis of Water and Wastes," is given at Appendix C of this Part 136.

[7] Manual distillation is not required if comparability data on representative effluent samples are on company file to show that the preliminary distillation step is not necessary; however, manual distillation will be required to resolve any controversies.

[8] Ammonia, Automated Electrode Method, Industrial Method Number 379-75WE, dated February 19, 1976, Technicon AutoAnalyzer II, Technicon Industrial Systems, Tarrytown, New York 10591.

[9] Carbonaceous biochemical oxygen demand ($CBOD_5$) must not be confused with the traditional BOD_5 test which measures "total BOD". The addition of the nitrification inhibitor is not a procedural option, but must be included to report the $CBOD_5$ parameter. A discharger whose permit requires reporting the traditional $CBOD_5$ may not use a nitrification inhibitor in the procedure for reporting the results. Only when a discharger's permit specifically states $CBOD_5$ is required can the permittee report data obtained using the nitrification inhibitor.

[10] American National Standard on Photographic Processing Effluents, Apr. 2, 1975. Available from ANSI, 1430 Broadway, New York, NY 10018.

[11] The use of normal and differential pulse voltage ramps to increase sensitivity and resolution is acceptable.

[12] Chemical Oxygen Demand, Method 8000, Hach Handbook of Water Analysis, 1979, Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.

[13] COD Method, Oceanography International Corporation, 512 West Loop, P.O. Box 2980, College Station, Texas 77840.

[14] The back titration method will be used to resolve controversy.

[15] National Council of the Paper Industry for Air and Stream Improvement, Inc., Technical Bulletin 253, December 1971.

[16] Copper, Bicinchoninate Method, Method 8506, Hach Handbook of Water Analysis, 1979, Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.

[17] After the manual distillation is completed, the auto-analyzer manifolds in EPA Methods 335.03 (Cyanide) or 420.2 (phenols) are simplified by connecting the re-sample line directly to the sampler. When using the manifold setup shown in Method 335, the buffer 6.2 should be replaced with the buffer 7.6 found in Method 335.2.

[18] Hydrogen Ion (pH) Automated Electrode Method, Industrial Method Number 378-75WA, October 1976, Technicon Auto-Analyzer II, Technicon Industrial Systems, Tarrytown, New York 10591.

[19] Iron, 1,10-Phenanthroline Method, Method 8008, 1980, Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.

[20] Manganese, Periodate Oxidation Method, Method 8034, Hach Handbook of Wastewater Analysis, 1979, pages 2-113 and 2-117, Hach Chemical Company, Loveland, Colorado 80537.

[21] Nitrogen, Nitrate, Method 8507, Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.

[22] Goerlitz, D., Brown, E., "Methods for Analyses of Organic Substances in Water," U.S. Geological Survey, Techniques of Water-Resources Investigations, Book 5, Chapter A3, p.4 (1972).

[23] R.F. Addison and R.G. Ackman, "Direct Determination of Elemental Phosphorus by Gas-Liquid Chromatography," Journal of Chromatography, Vol. 47, No. 3, pp. 421-426, 1970.

[24] Recommended methods for the analysis of silver in industrial wastewaters at concentrations of 1 mg/L and above are inadequate where silver exists as an inorganic halide. Silver halides such as the bromide and chloride are relatively insoluble in reagents such as nitric acid but are readily soluble in an aqueous buffer of sodium thiosulfate and sodium hydroxide to a pH of 12. Therefore, for levels of silver above 1 mg/L, 20 mL of sample should be diluted to 100 mL by adding 40 mL each of 2 M $Na_2S_2O_3$ and 2M NaOH. Standards should be prepared in the same manner. For levels of silver below 1 mg/L the recommended method is satisfactory.

[25] Stevens, H.H., Ficke, J.F., and Smoot, G.F., "Water Temperature-Influential Factors, Field Measurement and Data Presentation," U.S. Geological Survey, Techniques of Water-Resources Investigations, Book 1, Chapter D1, 1975.

[26] Zinc, Zincon Method, Method 8009, Hach Handbook of Water Analysis, 1979, pages 2-231 and 2-233, Hach Chemical Company, Loveland, Colorado 80537.

[27] "Selected Analytical Methods Approved and Cited by the United States Environmental Protection Agency," Supplement to the Fifteenth Edition of *Standard Methods for the Examination of Water and Wastewater* (1981).

[28] The approved method is that cited in *Standard Methods for the Examination of Water and Wastewater*, 14th Edition. The colorimetric reaction is conducted at a pH of 10.0 ± 0.2. The approved methods are given on pp. 576-81 of the 14th Edition: Method 510A for distillation, Method 510B for the manual colorimetric procedure, or Method 510C for the manual spectrophotometric procedure.

[29] ORION Research Instruction Manual, Residual Chlorine Electrode Model 97-70, 1977, Orion Research Incorporated, 840 Memorial Drive, Cambridge, Massachusetts 02138.

TABLE IC.—LIST OF APPROVED TEST PROCEDURES FOR NON-PESTICIDE ORGANIC COMPOUNDS

Parameter [1]	EPA Method Number [2,3]			Other
	GC	GC/MS	HPLC	
1. Acenaphthene	610	625, 1625	610	
2. Acenaphthylene	610	625, 1625	610	
3. Acrolein	603	[4]624, 1624		
4. Acrylonitrile	603	[4]624, 1624		
5. Anthracene	610	625, 1625	610	
6. Benzene	602	624, 1624		
7. Benzidine		[5]625, 1625	605	Note 3, p. 1;
8. Benzo(a)anthracene	610	625, 1625	610	
9. Benzo(a)pyrene	610	625, 1625	610	
10. Benzo(b)fluoranthene	610	625, 1625	610	
11. Benzo(ghi)perylene	610	625, 1625	610	
12. Benzo(k)fluoranthene	610	625, 1625	610	
13. Benzyl Chloride				Note 3, p. 130; Note 6, p. 5102.
14. Benzyl Butyl Phthalate	606	625, 1625		
15. Bis(2-chloroethoxy) methane	611	625, 1625		
16. Bis(2-chloroethyl) ether	611	625, 1625		
17. Bis(2-ethylhexyl) phthalate	606	625, 1625		
18. Bromodichloromethane	601	624, 1624		
19. Bromoform	601	624, 1624		
20. Bromomethane	601	624, 1624		
21. 4-Bromophenylphenyl ether	611	625, 1625		
22. Carbon tetrachloride	601	624, 1624		Note 3, p. 130;
23. 4-Chloro-3-methylphenol	604	625, 1625		
24. Chlorobenzene	601, 602	624, 1624		Note 3, p. 130;
25. Chloroethane	601	624, 1624		
26. 2-Chloroethylvinyl ether	601	624, 1624		
27. Chloroform	601	624, 1624		Note 3, p. 130;
28. Chloromethane	601	624, 1624		
29. 2-Chloronaphthalene	612	625, 1625		
30. 2-Chlorophenol	604	625, 1625		
31. 4-Chlorophenylphenyl ether	611	625, 1625		
32. Chrysene	610	625, 1625	610	
33. Dibenzo(a,h)anthracene	610	625, 1625	610	
34. Dibromochloromethane	601	624, 1624		
35. 1,2-Dichlorobenzene	601, 602, 612	624, 625, 1625		
36. 1,3-Dichlorobenzene	601, 602, 612	624, 625, 1625		
37. 1,4-Dichlorobenzene	601, 602, 612	625, 1624, 1625		
38. 3,3-Dichlorobenzidine		625, 1625	605	
39. Dichlorodifluoromethane	601			
40. 1,1-Dichloroethane	601	624, 1624		
41. 1,2-Dichloroethane	601	624, 1624		
42. 1,1-Dichloroethene	601	624, 1624		
43. trans-1,2-Dichloroethene	601	624, 1624		
44. 2,4-Dichlorophenol	604	625, 1625		
45. 1,2-Dichloropropane	601	624, 1624		
46. cis-1,3-Dichloropropene	601	624, 1624		
47. trans-1,3-Dichloropropene	601	624, 1624		
48. Diethyl phthalate	606	625, 1625		

TABLE IC.—LIST OF APPROVED TEST PROCEDURES FOR NON-PESTICIDE ORGANIC COMPOUNDS—Continued

Parameter [1]	EPA Method Number [2, 3]			Other
	GC	GC/MS	HPLC	
49. 2,4-Dimethylphenol	604	625, 1625		
50. Dimethyl phthalate	606	625, 1625		
51. Di-n-butyl phthalate	606	625, 1625		
52. Di-n-octyl phthalate	606	625, 1625		
53. 2,4-Dinitrophenol	604	625, 1625		
54. 2,4-Dinitrotoluene	609	625, 1625		
55. 2,6-Dinitrotoluene	609	625, 1625		
56. Epichlorohydrin				Note 3, p. 130; Note 6, p. S102.
57. Ethylbenzene	602	624, 1624		
58. Fluoranthene	610	625, 1625	610	
59. Fluorene	610	625, 1625	610	
60. Hexachlorobenzene	612	625, 1625		
61. Hexachlorobutadiene	612	625, 1625		
62. Hexachlorocyclopentadiene	612	[4] 625, 1625		
63. Hexachloroethane	612	625, 1625		
64. Indeno(1,2,3-cd)pyrene	610	625, 1625	610	
65. Isophorone	609	625, 1625		
66. Methylene Chloride	601	624, 1624		Note 3, p. 130;
67. 2-Methyl-4,6-Dinitrophenol	604	625, 1625		
68. Naphthalene	610	625, 1625		
69. Nitrobenzene	609	625, 1625		
70. 2-Nitrophenol	604	625, 1625		
71. 4-Nitrophenol	604	625, 1625		
72. N-Nitrosodimethylamine	607	625, 1625		
73. N-Nitroso-di-n-propylamine	607	[4] 625, 1625		
74. N-Nitrosodiphenylamine	607	[4] 625, 1625		
75. 2,2-oxybis(1-chloropropane)	611	625, 1625		
76. PCB-1016	608		625.	Note 3, p. 43;
77. PCB-1221	608		625.	Note 3, p. 43;
78. PCB-1232	608		625.	Note 3, p. 43;
79. PCB-1242	608		625.	Note 3, p. 43;
80. PCB-1248	608		625.	Note 3, p. 43;
81. PCB-1254	608		625.	Note 3, p. 43;
82. PCB-1260	608		625.	Note 3, p. 43;
83. Pentachlorophenol	604	625, 1625		Note 3, p. 140;
84. Phenanthrene	610	625, 1625	610	
85. Phenol	604	625, 1625		
86. Pyrene	610	625, 1625	610	
87. 2,3,7,8-Tetrachlorodibenzo-p-dioxin		[5] 613		
88. 1,1,2,2-Tetrachloroethane	601	624, 1624		Note 3, p. 130;
89. Tetrachloroethene	601	624, 1624		Note 3, p. 130;
90. Toluene	602	624, 1624		
91. 1,2,4-Trichlorobenzene	612	625, 1625		Note 3, p. 130;
92. 1,1,1-Trichloroethane	601	624, 1624		
93. 1,1,2-Trichloroethane	601	624, 1624		Note 3, p. 130;
94. Trichloroethene	601	624, 1624		
95. Trichlorofluoromethane	601	624,		
96. 2,4,6-Trichlorophenol	604	625, 1625		
97. Vinyl Chloride	601	624, 1624		

Table IC Notes

[1] All parameters are expressed in micrograms per liter (µg/L).

[2] The full test of Methods 601-613, 624, 625, 1624, and 1625, are given at Appendix A, "Test Procedures for Analysis of Organic Pollutants," of this Part 136. The standardized test procedure to be used to determine the method detection limit (MDL) for these test procedures is given at Appendix B, "Definition and Procedure for the Determination of the Method Detection Limit," of this Part 136.

[3] "Methods for Benzidine: Chlorinated Organic Compounds, Pentachlorophenol and Pesticides in Water and Wastewater," U.S. Environmental Protection Agency, September, 1978.

[4] Method 624 may be extended to screen samples for Acrolein and Acrylonitrile. However, when they are known to be present, the preferred method for these two compounds is Method 603 or Method 1624.

[5] Method 625 may be extended to include benzidine, hexachlorocyclopentadiene, N-nitrosodimethylamine, and N-nitrosodiphenylamine. However, when they are known to be present, Methods 605, 607, and 612, or Method 1625, are preferred methods for these compounds.

[6] 625, Screening only.

[7] "Selected Analytical Methods Approved and Cited by the United States Environmental Protection Agency," Supplement to the Fifteenth Edition of *Standard Methods for the Examination of Water and Wastewater* (1981).

[8] Each analyst must make an initial, one-time, demonstration of their ability to generate acceptable precision and accuracy with Methods 601-613, 624, 625, 1624, and 1625 (See Appendix A of this Part 136) in accordance with procedures each in section 8.2 of each of these Methods. Additionally, each laboratory, on an on-going bases must spike and analyze 10% (5% for Methods 624 and 625 and 100% for methods 1624, and 1625) of all samples to monitor and evaluate laboratory data quality in accordance with sections 8.3 and 8.4 of these Methods. When the recovery of any parameter falls outside the warning limits, the analytical results for that parameter in the unspiked sample are suspect and cannot be reported to demonstrate regulatory compliance.

Note.—These warning limits are promulgated as an "interim final action with a request for comments."

TABLE ID.—LIST OF APPROVED TEST PROCEDURES FOR PESTICIDES [1]

Parameter µg/L	Method	EPA [2, 3]	Standard Methods 15th Ed	ASTM	Other
1. Aldrin	GC	608	508A	D3086	Note 3, p. 7; Note 4, p. 30.
	GC/MS	625			
2. Ametryn	GC				Note 3, p. 83; Note 6, p. S88.
3. Aminocarb	TLC				Note 3, p. 94; Note 6, p. S16.
4. Atratan	GC				Note 3, p. 83; Note 6, p. S88.
5. Atrazine	GC				Note 3, p. 83; Note 6, p. S88.
6. Azinphos methyl	GC				Note 3, p. 25; Note 6, p. S51.
7. Barban	TLC				Note 3, p. 104; Note 6, p. S84.
8. α-BHC	GC	608	508A	D3086	Note 3, p. 7
	GC/MS	[4] 625			
9. β-BHC	GC	608		D3086	
	GC/MS	625			
10. δ-BHC	GC	608		D3086	

TABLE ID.—LIST OF APPROVED TEST PROCEDURES FOR PESTICIDES [1]—Continued

Parameter µg/L	Method	EPA [2]	"Standard Methods" 15th Ed	ASTM	Other
11. γ-BHC (Lindane)	GC/MS	[6] 625			
	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30.
	GC/MS	625			
12. Captan	GC		509A		Note 3, p. 7
13. Carbaryl	TLC				Note 3, p. 94, Note 6, p. S80.
14. Carbophenothion	GC				Note 4, p. 30; Note 6, p. S73.
15. Chlordane	GC	608	509A	D3086	Note 3, p. 7.
	GC-MS	625			
16. Chlorpropham	TLC				Note 3, p. 104, Note 6, p. S64.
17. 2,4-D	GC		509B		Note 3, p. 115, Note 4, p. 35.
18. 4,4'-DDD	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30.
	GC-MS	625			
19. 4,4'-DDE	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30.
	GC/MS	625			
20. 4,4'-DDT	GC	608	509A	D3086	Note 3, p. 7; Note 4, p. 30.
	GC/MS	625			
21. Diazinon-O	GC				Note 3, p. 25; Note 6, p. S51.
22. Diazinon-S	GC				Note 3, p. 25, Note 6, p. S51
23. Dicamba	GC				Note 3, p. 25, Note 4, p. 30, Note 6, p. S51
24. Dicamba	GC				Note 3, p. 115
25. Dichlofenthion	GC				Note 4, p. 30, Note 6, p. S73
26. Dichloran	GC		509A		Note 3, p. 7
27. Dicofol	GC			D3086	
28. Dieldrin	GC	608	509A		Note 3, p. 7; Note 4, p. 30.
	GC/MS	625			
29. Dioxathion	GC				Note 4, p. 30; Note 6, p. S73.
30. Diquat	GC				Note 3, p. , Note 6, p. S51.
31. Diuron	TLC				Note 3, p. 104; Note 6, p. S64.
32. Endosulfan I	GC	608	509A	D3086	Note 3, p. 7.
	GC/MS	[6] 625			
33. Endosulfan II	GC	608	509A	D3086	Note 3, p. 7.
	GC/MS	[6] 625			
34. Endosulfan sulfate	GC	608			
	GC/MS	625			
35. Endrin	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30.
	GC/MS	[6] 625			
36. Endrin aldehyde	GC	608			
	GC/MS	625			
37. Ethion	GC				Note 4, p. 30, Note 6, p. S73.
38. Famphur	TLC				Note 3, p. 104; Note 6, p. S64.
39. Famphur-TCA	TLC				Note 3, p. 104, Note 6, p. S64.
40. Heptachlor	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30.
	GC/MS	625			
41. Heptachlor epoxide	GC	608	509A	D3086	Note 3, p. 7; Note 4, p. 30; Note 6, p. S73.
	GC/MS	625			
42. Isodrin	GC				Note 4, p. 30; Note 6, p. S73.
43. Linuron	TLC				Note 3, p. 104, Note 6, p. S64.
44. Malathion	GC		509A		Note 3, p. 25, Note 4, p. 30; Note 6, p. S51.
45. Methiocarb	TLC				Note 3, p. 94, Note 6, p. S80.
46. Methoxychlor	GC		509A	D3086	Note 3, p. 7, Note 4, p. 30.
47. Mexacarbate	TLC				Note 3, p. 94, Note 6, p. S80.
48. Mirex	GC		509A		Note 3, p. 7.
49. Monuron	TLC				Note 3, p. 104; Note 6, p. S64.
50. Monuron-TCA	TLC				Note 3, p. 104, Note 6, p. S64.
51. Neburon	TLC				Note 3, p. 104, Note 6, p. S64.
52. Parathion methyl	GC		509A		Note 3, p. 25; Note 4, p. 30.
53. Parathion ethyl	GC		509A		Note 3, p. 25.
54. PCNB	GC		509A		Note 3, p. 7.
55. Perthane	GC			D3086	
56. Prometon	GC				Note 3, p. 83; Note 6, p. S68.
57. Prometryn	GC				Note 3, p. 83, Note 6, p. S68.
58. Propazine	GC				Note 3, p. 83, Note 6, p. S68.
59. Propham	TLC				Note 3, p. 104, Note 6, p. S64.
60. Propoxur	TLC				Note 3, p. 94, Note 6, p. S80
61. Secbumeton	TLC				Note 3, p. 83; Note 6, p. S68.
62. Siduron	TLC				Note 3, p. 104; Note 6, p. S64.
63. Simazine	GC				Note 3, p. 83, Note 6, p. S68.
64. Strobane	GC		509A		Note 3, p. 7
65. Swep	TLC				Note 3, p. 104, Note 6, p. S64.
66. 2,4,5-T	GC		509B		Note 3, p. 115, Note 4, p. 35.
67. 2,4,5-TP (Silvex)	GC		509B		Note 3, p. 115
68. Terbuthylazine	GC				Note 3, p. 83, Note 6, p. S68
69. Terraphene	GC	608	509A	D3086	Note 3, p. 7, Note 4, p. 30
	GC/MS	625			
70. Trifluralin	GC		509A		Note 3, p. 7

Table ID Notes

[1] Pesticides are listed in this table by common name for the convenience of the reader. Additional pesticides may be found under Table IC, where entries are listed by chemical name.

[2] The full text of methods 608 and 625 are given at Appendix A, "Test Procedures for Analyses of Organic Pollutants," of this Part 136. The standardized test procedure to be used to determine the method detection limit (MDL) for these test procedures is given at Appendix B, "Definition and Procedure for the Determination of the Method Detection Limit", of this Part 136.

[3] "Methods for Benzidine, Chlorinated Organic Compounds, Pentachlorophenol and Pesticides in Water and Wastewater," U.S. Environmental Protection Agency, September, 1978. This EPA publication includes thin-layer chromatography (TLC) methods.

[4] "Methods for Analyses of Organic Substances in Water," U.S. Geological Survey, Techniques of Water-Resources Investigations, Book 5, Chapter A3 (1972).

[5] This method may be extended to include α-BHC, β-BHC, endosulfan I, endosulfan II, and endrin. However, when they are known to exist, Method 608 is the preferred method.

[6] "Selected Analytical Methods Approved and Cited by the United States Environmental Protection Agency," Supplement to the Fifteenth Edition of *Standard Methods for the Examination of Water and Wastewater* (1981).

[7] Each analyst must make an initial, one-time, demonstration of their ability to generate acceptable precision and accuracy with Methods 608 and 625 (See Appendix A of this Part 136) in accordance with procedures given in Section 8.2 of each of these methods. Additionally, each laboratory, on an on-going basis, must spike and analyze 10% of all samples analyzed with

Method 608 or 5% of all samples analyzed with Method 625 to monitor and evaluate laboratory data quality in accordance with Sections 8.3 and 8.4 of these methods. When the recovery of any parameter falls outside the warning limits, the analytical results for that parameter in the unspiked sample are suspect and cannot be reported to demonstrate regulatory compliance.

Note.—These warning limits are promulgated as an "interim final action with a request for comments."

TABLE IE.—LIST OF APPROVED RADIOLOGICAL TEST PROCEDURES

Parameter and units	Methods	Reference (method No. or page)			
		EPA [1]	Standard Methods 15th Ed.	ASTM	USGS [2]
1. Alpha-Total, pCi^{a} per liter	Proportional or scintillation counter	900.0	703	D1943-66	pp. 75 and 78.[3]
2. Alpha-Counting error, pCi^{a} per liter	Proportional or scintillation counter	Appendix B	703	D1943-66	p. 79.
3. Alpha-Counting error, pCi^{a} per liter	Proportional counter	900.0	703	D1890-66	pp. 75 and 78.[3]
4. Beta-Counting error, pCi^{a} per liter	Proportional counter	Appendix B	703	D1890-66	p. 79.
5. (a) Radium-Total, pCi^{a} per liter	Proportional counter	903.0	705	D2460-70	
(b) ^{226}Ra, pCi^{a} per liter	Scintillation counter	903.1	706	D3454-79	p. 81.

Table IE Notes

[1] "Prescribed Procedures for Measurement of Radioactivity in Drinking Water," EPA-600/4-80-032 (1980 update), U.S. Environmental Protection Agency, August 1980.
[2] Fishman, M.J. and Brown, Eugene, "Selected Methods of the U.S. Geological Survey of Analysis of Wastewaters," U.S. Geological Survey, Open-File Report 76-177 (1976).
[3] The method found on p. 75 measures only the dissolved portion while the method on p. 78 measures only the suspended portion. Therefore, the two results must be added to obtain the "total."

5. In § 136.3, paragraph (a) is revised to show that the full text of approved test procedures have been incorporated by reference, into the regulation to read as follows:

§ 136.3 Identification of test procedures.

(a) Parameters or pollutants, for which methods are approved, are listed together with test procedure descriptions and references in Tables IA, IB, IC, ID, and IE. The full text of the referenced test procedures are incorporated by reference into Tables IA, IB, IC, ID, and IE. The references and the sources from which they are available are given in paragraph (b) of this section. These test procedures are incorporated as they exist on the day of approval and a notice of any change in these test procedures will be published in the Federal Register. The discharge parameter values for which reports are required must be determined by one of the standard analytical test procedures incorporated by reference and described in Tables IA, IB, IC, ID, and IE, or by any alternate test procedure which has been approved by the Administrator under the provisions of paragraph (d) of this section and sections 136.4 and 136.5 of this Part 136. Under certain circumstances (§§ 136.3 (b) or (c) or 40 CFR Part 401.13) other test procedures may be used that may be more advantageous when such other test procedures have been previously approved by the Regional Administrator of the Region in which the discharge will occur, and providing the Director of the State in which such discharge will occur does not object to the use of such alternate test procedure.

6. In § 136.3, paragraphs (b) and (c) are redesignated as (c) and (d) and a new paragraph (b) is added to itemize the references which are "incorporated by reference" and to identify the sources from which they may be obtained. As added, the new paragraph (b) reads as follows:

§ 136.3 Identification of test procedures.

* * * * *

(b) The full texts of the methods from the following references which are cited in Tables IA, IB, IC, ID, and IE are incorporated by reference into this regulation and may be obtained from the sources identified. All costs cited are subject to change and must be verified from the indicated sources.

REFERENCES, SOURCES, AND COSTS

Table	Parameters	Reference, source and cost
IA—EPA	1-5	"Microbiological Methods for Monitoring the Environment, Water and Wastes," United States Environmental Protection Agency, EPA-600/8-78-017, 1978. Available from ORD Publications, CERI, U.S. Environmental Protection Agency, Cincinnati, Ohio 45268
IA—Standard Methods	1-5	*Standard Methods for the Examination of Water and Wastewater*, Joint Editorial Board, American Public Health Association, American Water Works Association, and Water Pollution Control Federation, 15th Edition, 1981. Available from: American Public Health Association, 1015 Fifteenth Street, N.W., Washington, D.C. 20036. Cost: $50.00 including the Supplement to the Fifteenth Edition. Ibid., 14th Edition
IB—Standard	1-10, 12-46, 50-75	
ID—Standard Methods	1, 8, 11, 12, 15, 17-20, 26, 28, 32, 33, 35, 40, 41, 44, 46, 48, 52-54, 64, 66, 67, 69, 70	
IE—Standard Methods	1-5	
IB—Standard Methods	48	
IB—Other (Standard Methods Supplement)	11, 47	"Selected Analytical Methods approved and Cited by the United States Environmental Protection Agency," Supplement to the 15th Edition of *Standard Methods for the Examination of Water and Wastewater* (1981). Available from: American Public Health Association, 1015 Fifteenth Street, N.W., Washington, D.C. 20036. Cost: Included with the 15th Edition of *Standard Methods for the Examination of Water and Wastewater*
IC—Other (Standard Methods Supplement)	13, 56	
ID—Other (Standard Methods Supplement)	2-7, 13, 14, 16, 21-23, 25, 29-31, 37, 38, 39, 41-45, 47, 49, 50, 51, 56-63, 65, 68	
IA—U.S. Geological Survey (USGS)	1, 3, 5	"Methods for Collection and Analysis of Aquatic Biological and Microbiological Samples," edited by P.E. Greeson, T.A. Ehlke, G.A. Irwin, B.W. Lium, and K.V. Slack. U.S. Geological Survey, Techniques of Water-Resources Investigation (USGS TWRI), Book 5, Chapter A4 (1977). Revised edition, 332 pages. Available from: U.S. Geological Survey, Branch of Distribution, 1200 South Eads Street, Arlington, VA 22202 (Authorized agent of the Superintendent of Documents, Government Printing Office.) Cost: $9.25. Prices are subject to change.
IB—EPA	1-13, 15-48, 50-75	"Methods for Chemical Analysis of Water and Wastes", EPA-600/4-79-020, United States Environmental Protection Agency, March, 1979. Available from ORD Publications, CERI, U.S. Environmental Protection Agency, Cincinnati, Ohio 45268
IB—ASTM	1, 2, 4, 6, 8, 11-13, 15-17, 19, 20, 22-25, 27, 28, 30-35, 37-40, 42-44, 46, 48, 50, 52, 60, 61, 63-65, 67, 68, 73-75	"Annual Book of Standards, Part 31, Water", American Society for Testing and Materials, 1980. Available from: American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103. Cost: available from publisher
ID—ASTM	1, 8-11, 15, 18-20, 27, 32, 33, 35, 40, 41, 46, 55, 69	
IE—ASTM	1-5	

REFERENCES, SOURCES, AND COSTS—Continued

Table	Parameters	Reference, source and cost
IB—USGS	2, 3, 4, 6–13, 15, 16, 18–23, 25, 27, 28, 30–40, 43, 44, 46, 50, 52–55, 57, 60–66, 71, 73, 75.	"Methods for determination of inorganic substances in water and fluvial sediments," N.W. Skougstad and others, editors USGS—TWRI Book 5, Chapter A1, 1979. $10.00. Available from U.S. Geological Survey, Branch of Distribution, 1200 South Eads Street, Arlington, VA 22202 (Authorized agent of the Superintendent of Documents, Government Printing Office). Prices are subject to change
IB—Other (AOAC)	2, 4, 9, 12, 15, 16, 19, 22, 30–35, 38, 42–44, 46, 50, 52, 62–65, 75.	Official Methods of Analysis of the Association of Official Analytical Chemists, methods manual, 13th Edition (1980). Price: $78.00. Available from: The Association of Official Analytical Chemists, 1111 N. 19th St., Suite 210, Arlington, VA 22209
IB—Other (ANSI)	9, 12, 15, 20, 22, 23, 38, 62, 75	"American National Standard on Photographic Processing Effluents," April 2, 1975. Available from American National Standards Institute, 1430 Broadway, New York, New York 10018.
IB—Other (EPA)	3, 5–8, 10, 12, 13, 19, 20, 22, 27, 30, 32–34, 36, 37, 52, 60, 63, 70, 74, 75	The full text of the inductively coupled plasma optical emission spectroscopic test procedure, Method 200.7, is printed in Appendix C of this Part 136
IB—Other	71	"An Investigation of Improved Procedures for Measurement of Mill Effluent and Receiving Water Color," NCASI Technical Bulletin No. 253, December, 1971. Available from National Council of the Paper Industry for Air and Stream Improvements, Inc., [illegible] Madison Avenue. Cost available from publisher
IB—Other	4	Ammonia, Automated Electrode Method, Industrial Method Number 379-75WE, dated February 19, 1976, Technicon AutoAnalyzer II. Method and price available from Technicon Industrial Systems, Tarrytown, New York 10591
IB—Other	15	Chemical Oxygen Demand, Method 8000, Hach Handbook of Water Analysis, 1979. Method and price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537
IB—Other	15	OIC Chemical Oxygen Demand Method. Method and price available from Oceanography International Corporation, 512 West Loop, P.O. Box 2980, College Station, Texas 77840.
IB—Other	17	ORION Research Instruction Manual, Residual Chlorine Electrode Model 97-70, 1977. Method and price available from Orion Research Incorporated, 840 Memorial Drive, Cambridge, Massachusetts 02138.
IB—Other	22	Bicinchoninate Method for Copper, Method 8506, Hach Handbook of Water Analysis, 1979. Method and price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.
IB—Other	28	Hydrogen Ion (pH) Automated Electrode Method, Industrial Method Number 378-75WA, October 1976, Technicon AutoAnalyzer II. Method and Price available from Technicon Industrial Systems, Tarrytown, New York 10591.
IB—Other	30	1, 10-Phenanthroline Method for Iron, Hach Method 8008. Method and price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.
IB—Other	34	Periodate Oxidation Method for Manganese, Method 8034, Hach Handbook for Water Analysis, 1979. Method and Price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537
IB—Other	40	Nitrite Nitrogen, Hach Method 8507. Method and price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537.
IB—Other	75	Zincon Method for Zinc, Method 8009, Hach Handbook for Water Analysis, 1979. Method and price available from Hach Chemical Company, P.O. Box 389, Loveland, Colorado 80537
IB—Other	49	"Direct Determination of Elemental Phosphorus by Gas-Liquid Chromatography", by R.F. Addison and R.G. Ackman, Journal of Chromatography, Volume 47, No. 3, pp. 421–426, 1970. Available in most public libraries. Back volumes of the Journal of Chromatography are available from Elsevier/North-Holland, Inc., Journal Information Centre, 52 Vanderbilt Avenue, New York, NY 10164. Cost available from publisher
IB—Other (USGS)	69	"Water temperature-influential factors, field measurement, and data presentation," by H.H. Stevens, Jr., J. Ficke, and G.F. Smoot: USGS-TWRI Book 1, Chapter D1, 1975. 65 pages, $1.60. Available from U.S. Geological Survey, Branch of Distribution, 1200 South Eads Street, Arlington, VA 22202. Prices are subject to change
IB—Other (USGS) ID—Other (USGS)	42 1, 11, 14, 17–20, 23, 25, 28, 29, 35, 37, 40–42, 44, 46, 52, 66, 68	"Methods for analysis of organic substances in water," by D. F. Goerlitz and Eugene Brown. USGS-TWRI. Book 5, Chapter A3, 1972, 40 pages, $.90. Available from U.S. Geological Survey, Branch of Distribution, 1200 South Eads Street, Arlington, VA 22202. Prices are subject to change.
IC—EPA ID—EPA	1–12, 14–55, 57–87 1, 8–11, 15, 18, 19, 20, 28, 32–38, 40, 41, 68	The full texts of Methods 601–613, 624, 625, 1624, and 1625 are printed in appendix A of this Part 136. The full text for determining the method detection limit when using the test procedures is given in Appendix B of this Part 136.
IC—Other (EPA) ID—Other	7, 13, 22, 24, 27, 56, 66, 76–83, 86, 88, 91, 93 1–8, 11–13, 15–24, 26, 28, 30–33, 35, 38–41, 43–54, 56–70	"Methods for Benzidine, Chlorinated Organic Compounds, Pentachlorophenol and Pesticides in Water and Wastewater," Environmental Monitoring and Support Laboratory, United States Environmental Protection Agency, Cincinnati, Ohio 1978. Available from ORD Publications, CERI, U.S. Environmental Protection Agency, Cincinnati, Ohio 45268.
IE—EPA	1–5	"Prescribed Procedures for Measurement of Radioactivity in Drinking Water," EPA-600/4-80-032 (1980 Update), United States Environmental Protection Agency, 1980. Available from ORD Publications, CERI, U.S. Environmental Protection Agency, Cincinnati, Ohio 45268
IE—USGS	1–5	"Selected Methods of the U.S. Geological Survey of Analysis of Wastewaters," by M.J. Fishman and Eugene Brown, U.S. Geological Survey Open File Report 76-77 (1976). $13.50. Available from: U.S. Geological Survey, Branch Distribution, 1200 South Eads Street, Arlington, VA 22202

The full texts of all the test procedures cited are available for inspection at the Office of the Federal Register Information Center, Room 8301, 1110 L Street, N.W., Washington, D.C. 20408.

7. In section 136.3 a new paragraph (e) is added together with a new Table II entitled, "Table II, Required Containers, Preservation Techniques, and Holding Times," to read as follows:

§ 136.3 Identification of test procedures.

* * * * *

(e) Sample preservation procedures, container materials, and maximum allowable holding times for parameters cited in Tables IA, IB, IC, ID, and IE are

prescribed in Table II. Any person may apply for a variance from the prescribed preservation techniques, container materials, and maximum holding times applicable to samples taken from a specific discharge. Applications for variances may be made by letters to the Regional Administrator in the Region in which the discharge will occur. Sufficient data should be provided to assure such variance does not adversely affect the integrity of the sample. Such data will be forwarded by the Regional Administrator to the Director of the Environmental Monitoring and Support Laboratory in Cincinnati, Ohio for technical review and recommendations for action on the variance application. Upon receipt of the recommendations from the Director of the Environmental Monitoring and Support Laboratory, the Regional Administrator may grant a variance applicable to the specific discharge to the applicant. A decision to approve or deny a variance will be made within 90 days of receipt of the application by the Regional Administrator.

• • • • •

TABLE II.—REQUIRED CONTAINERS, PRESERVATION TECHNIQUES, AND HOLDING TIMES

Parameter No./name	Container [1]	Preservation [2,3]	Maximum holding time [4]
Table IA—Bacterial Tests:			
1-4. Coliform, fecal and total	P, G	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5]	6 hours.
5. Fecal streptococci	P, G	do	Do.
Table IB—Inorganic Tests:			
1. Acidity	P, G	Cool, 4°C	14 days.
2. Alkalinity	P, G	do	Do.
4. Ammonia	P, G	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
5. Biochemical oxygen demand	P, G	Cool, 4°C	48 hours.
11. Bromide	P, G	None required	28 days.
14. Biochemical oxygen demand, carbonaceous	P, G	Cool, 4°C	48 hours.
15. Chemical oxygen demand	P, G	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
16. Chloride	P, G	None required	Do.
17. Chlorine, total residual	P, G	do	Analyze immediately.
21. Color	P, G	Cool, 4°C	48 hours.
23-24. Cyanide, total and amenable to chlorination	P, G	Cool, 4°C, NaOH to pH > 12, 0.6g ascorbic acid [6]	14 days [7]
25. Fluoride	P	None required	28 days.
27. Hardness	P, G	HNO_3 to pH < 2, H_2SO_4 to pH < 2	6 months.
28. Hydrogen ion (pH)	P, G	None required	Analyze immediately.
31, 43. Kjeldahl and organic nitrogen	P, G	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
Metals: [8]			
18. Chromium VI	P, G	Cool, 4°C	24 hours.
35. Mercury	P, G	HNO_3 to pH < 2	28 days.
3, 5-8, 10, 12, 13, 19, 20, 22, 26, 29, 30, 32-34, 36, 37, 45, 47, 51, 52, 58-60, 62, 63, 70-72, 74, 75 Metals, except chromium VI and mercury	P, G	do	6 months.
38. Nitrate	P, G	Cool, 4°C	48 hours.
39. Nitrate-nitrite	P, G	Cool, 4°C, H_2SO_4 to pH < 2	28 days
40. Nitrite	P, G	Cool, 4°C	48 hours.
41. Oil and grease	G	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
42. Organic carbon	P, G	Cool, 4°C, HCl or H_2SO_4 to pH < 2	Do.
44. Orthophosphate	P, G	Filter immediately, Cool, 4°C	48 hours.
46. Oxygen, Dissolved Probe	G Bottle and top	None required	Analyze immediately.
47. Winkler	do	Fix on site and store in dark	8 hours.
48. Phenols	G only	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
49. Phosphorus (elemental)	G	Cool, 4°C	48 hours.
50. Phosphorus, total	P, G	Cool, 4°C, H_2SO_4 to pH < 2	28 days.
53. Residue, total	P, G	Cool, 4°C	7 days.
54. Residue, Filterable	P, G	do	48 hours.
55. Residue, Nonfilterable (TSS)	P, G	do	7 days.
56. Residue, Settleable	P, G	do	48 hours.
57. Residue, volatile	P, G	do	7 days.
61. Silica	P	do	28 days.
64. Specific conductance	P, G	do	Do.
65. Sulfate	P, G	do	Do.
66. Sulfide	P, G	Cool, 4°C add zinc acetate plus sodium hydroxide to pH > 9	7 days.
67. Sulfite	P, G	None required	Analyze immediately.
68. Surfactants	P, G	Cool, 4°C	48 hours.
69. Temperature	P, G	None required	Analyze.
73. Turbidity	P, G	Cool, 4°C	48 hours.
Table IC—Organic Tests [9]			
13, 18-20, 22, 24-28, 34-37, 39-43, 45-47, 56, 66, 68, 69, 92-95, 97 Purgeable Halocarbons	G, Teflon-lined septum	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5]	14 days
6, 57, 60. Purgeable aromatic hydrocarbons	do	Cool, 4°C, 0.008% $Na_2S_2O_3$, HCl to pH 2 [10]	Do
3, 4. Acrolein and acrylonitrile	do	Cool, 4°C, 0.008% $Na_2S_2O_3$, Adjust pH to 4-5 [10]	Do.
23, 30, 44, 49, 53, 67, 70, 71, 83, 85, 96. Phenols [11]	G, Teflon-lined cap	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5]	7 days until extraction, 40 days after extraction.
7, 38 Benzidines [11]	do	do	7 days until extraction. [12]
14, 17, 48, 50-52 Phthalate esters [11]	do	Cool, 4°C	7 days until extraction, 40 days after extraction
72-74 Nitrosamines [11,13]	do	Cool, 4°C store in dark, 0.008% $Na_2S_2O_3$ [5]	Do
76-82 PCBs [11] acrylonitrile	do	Cool, 4°C	Do.
54, 55, 65, 69 Nitroaromatics and isophorone [11]	do	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5] store in dark	Do
1, 2, 5, 8-12, 32, 33, 58, 59, 64, 68, 84, 86 Polynuclear aromatic hydrocarbons [11]	do	do	Do
15, 16, 21, 31, 75 Haloethers [11]	do	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5]	Do
29, 35-37, 60-63, 81 Chlorinated hydrocarbons [11]	do	Cool, 4°C	Do
87 TCDD [11]	do	Cool, 4°C, 0.008% $Na_2S_2O_3$ [5]	Do
Table ID—Pesticides Tests:			
1-70 Pesticides [11]	do	Cool, 4°C, pH 5-9 [14]	Do
Table IE—Radiological Tests			
1-5 Alpha, beta and radium	P, G	HNO_3 to pH < 2	6 months.

Table II Notes

[1] Polyethylene (P) or Glass (G)

[1] Sample preservation should be performed immediately upon sample collection. For composite chemical samples each aliquot should be preserved at the time of collection. When use of an automated sampler makes it impossible to preserve each aliquot, then chemical samples may be preserved by maintaining at 4°C until compositing and sample splitting is completed.

[2] When any sample is to be shipped by common carrier or sent through the United States Mails, it must comply with the Department of Transportation Hazardous Materials Regulations (49 CFR Part 172). The person offering such material for transportation is responsible for ensuring such compliance. For the preservation requirements of Table II, the Office of Hazardous Materials, Materials Transportation Bureau, Department of Transportation has determined that the Hazardous Materials Regulations do not apply to the following materials: Hydrochloric acid (HCl) in water solutions at concentrations of 0.04% by weight or less (pH about 1.96 or greater); Nitric acid (HNO_3) in water solutions at concentrations of 0.15% by weight or less (pH about 1.82 or greater); Sulfuric acid (H_2SO_4) in water solutions at concentrations of 0.35% by weight or less (pH about 1.15 or greater); and Sodium hydroxide ($NaOH$) in water solutions at concentrations of 0.080% by weight or less (pH about 12.30 or less).

[3] Samples should be analyzed as soon as possible after collection. The times listed are the maximum times that samples may be held before analysis and still be considered valid. Samples may be held for longer periods only if the permittee, or monitoring laboratory, has data on file to show that the specific types of samples under study are stable for the longer time, and has received a variance from the Regional Administrator under § 136.3(e). Some samples may not be stable for the maximum time period given in the table. A permittee, or monitoring laboratory, is obligated to hold the sample for a shorter time if knowledge exists to show that this is necessary to maintain sample stability. See § 136.3(e) for details.

[4] Should only be used in the presence of residual chlorine.

[5] Maximum holding time is 24 hours when sulfide is present. Optionally, all samples may be tested with lead acetate paper before pH adjustments in order to determine if sulfide is present. If sulfide is present, it can be removed by the addition of cadmium nitrate powder until a negative spot test is obtained. The sample is filtered and then NaOH is added to pH 12.

[6] Samples should be filtered immediately on-site before adding preservative for dissolved metals.

[7] Guidance applies to samples to be analyzed by GC, LC, or GC/MS for specific compounds.

[8] Samples receiving no pH adjustment must be analyzed within seven days of sampling.

[9] The pH adjustment is not required if acrolein will not be measured. Samples for acrolein receiving no pH adjustment must be analyzed within 3 days of sampling.

[10] When the extractable analytes of concern fall within a single chemical category, the specified preservative and maximum holding times should be observed for optimum safeguard of sample integrity. When the analytes of concern fall within two or more chemical categories, the sample may be preserved by cooling to 4°C, reducing residual chlorine with 0.008% sodium thiosulfate, storing in the dark, and adjusting the pH to 6–9; samples preserved in this manner may be held for seven days before extraction and for forty days after extraction. Exceptions to this optional preservation and holding time procedure are noted in footnote 5 (re the requirement for thiosulfate reduction of residual chlorine), and footnotes 12, 13 (re the analyses of benzidine).

[11] If 1,2-diphenylhydrazine is likely to be present, adjust the pH of the sample to 4.0±0.2 to prevent rearrangement to benzidine.

[12] Extracts may be stored up to 7 days before analysis if storage is conducted under an inert (solvent-free) atmosphere.

[13] For the analysis of diphenylnitrosamine, add 0.008% $Na_2S_2O_3$ and adjust pH to 7–10 with NaOH within 24 hours of sampling.

[14] This pH adjustment may be performed upon receipt at the laboratory and may be omitted if the samples are extracted within 72 hours of collection. For the analysis of aldrin, add 0.008% $Na_2S_2O_3$.

8. Appendices A, B, and C are added to Part 136 to read as follows:

APPENDIX A TO PART 136—METHODS FOR ORGANIC CHEMICAL ANALYSIS OF MUNICIPAL AND INDUSTRIAL WASTEWATER.

Method 601—Purgeable Halocarbons

1. Scope and Application

1.1 This method covers the determination of 29 purgeable halocarbons.

The following parameters may be determined by this method:

Parameter	STORET No.	CAS No.
Bromodichloromethane	32101	75-27-4
Bromoform	32104	75-25-2
Bromomethane	34413	74-83-9
Carbon tetrachloride	32102	56-23-5
Chlorobenzene	34301	108-90-7
Chloroethane	34311	75-00-3
2-Chloroethylvinyl ether	34576	100-75-8
Chloroform	32106	67-66-3
Chloromethane	34418	74-87-3
Dibromochloromethane	32105	124-48-1
1,2-Dichlorobenzene	34536	95-50-1
1,3-Dichlorobenzene	34566	541-73-1
1,4-Dichlorobenzene	34571	106-46-7
Dichlorodifluoromethane	34668	75-71-8
1,1-Dichloroethane	34496	75-34-3
1,2-Dichloroethane	34531	107-06-2
1,1-Dichloroethene	34501	75-35-4
trans-1,2-Dichloroethene	34546	156-60-5
1,2-Dichloropropane	34541	78-87-5
cis-1,3-Dichloropropene	34704	10061-01-5
trans-1,3-Dichloropropene	34699	10061-02-6
Methylene chloride	34423	75-09-2
1,1,2,2-Tetrachloroethane	34516	79-34-5
Tetrachloroethene	34475	127-18-4
1,1,1-Trichloroethane	34506	71-55-6
1,1,2-Trichloroethane	34511	79-00-5
Trichloroethene	39180	79-01-6
Trichlorofluoromethane	34488	75-69-4
Vinyl chloride	39715	75-01-4

1.2 This is a purge and trap gas chromatographic (GC) method applicable to the determination of the compounds listed above in municipal and industrial discharges as provided under 40 CFR 136.1. When this method is used to analyze unfamiliar samples for any or all of the compounds above, compound identifications should be supported by at least one additional qualitative technique. This method describes analytical conditions for a second gas chromatographic column that can be used to confirm measurements made with the primary column. Method 624 provides gas chromatograph/mass spectrometer (GC/MS) conditions appropriate for the qualitative and quantitative confirmation of results for most of the parameters listed above.

1.3 The method detection limit (MDL, defined in Section 12.1)[1] for each parameter is listed in Table 1. The MDL for a specific wastewater may differ from those listed, depending upon the nature of interferences in the sample matrix.

1.4 Any modification of this method, beyond those expressly permitted, shall be considered as a major modification subject to application and approval of alternate test procedures under 40 CFR 136.4 and 136.5.

1.5 This method is restricted to use by or under the supervision of analysts experienced in the operation of a purge and trap system and a gas chromatograph and in the interpretation of gas chromatograms. Each analyst must demonstrate the ability to generate acceptable results with this method using the procedure described in Section 8.2.

2. Summary of Method

2.1 An inert gas is bubbled through a 5-mL water sample contained in a specially-designed purging chamber at ambient temperature. The halocarbons are efficiently transferred from the aqueous phase to the vapor phase. The vapor is swept through a sorbent trap where the halocarbons are trapped. After purging is completed, the trap is heated and backflushed with the inert gas to desorb the halocarbons onto a gas chromatographic column. The gas chromatograph is temperature programmed to separate the halocarbons which are then detected with a halide-specific detector.[2,3]

2.2 The method provides an optional gas chromatographic column that may be helpful in resolving the compounds of interest from interferences that may occur.

3. Interferences

3.1 Impurities in the purge gas and organic compounds outgassing from the plumbing ahead of the trap account for the majority of contamination problems. The analytical system must be demonstrated to be free from contamination under the conditions of the analysis by running laboratory reagent blanks as described in Section 8.1.3. The use of non-Teflon plastic tubing, non-Teflon thread sealants, or flow controllers with rubber components in the purge and trap system should be avoided.

3.2 Samples can be contaminated by diffusion of volatile organics (particularly fluorocarbons and methylene chloride) through the septum seal into the sample during shipment and storage. A field reagent blank prepared from reagent water and carried through the sampling and handling protocol can serve as a check on such contamination.

3.3 Contamination by carry-over can occur whenever high level and low level samples are sequentially analyzed. To reduce carry-over, the purging device and sample syringe must be rinsed with reagent water between sample analyses. Whenever an unusually concentrated sample is encountered, it should be followed by an analysis of reagent water to check for cross contamination. For samples containing large amounts of water-soluble materials, suspended solids, high boiling compounds or high organohalide levels, it may be necessary to wash out the purging device with a detergent solution, rinse it with distilled water, and then dry it in a 105°C oven between analyses. The trap and other parts of the system are also subject to contamination; therefore, frequent bakeout and purging of the entire system may be required.

4. Safety

4.1 The toxicity or carcinogenicity of each reagent used in this method has not been precisely defined; however, each chemical compound should be treated as a potential health hazard. From this viewpoint, exposure to these chemicals must be reduced to the lowest possible level by whatever means available. The laboratory is responsible for maintaining a current awareness file of OSHA regulations regarding the safe handling of the chemicals specified in this method. A reference file of material data handling sheets should also be made available to all personnel involved in the chemical analysis. Additional references to laboratory safety are available and have been identified [4-6] for the information of the analyst.

4.2 The following parameters covered by this method have been tentatively classified as known or suspected, human or mammalian carcinogens: carbon tetrachloride, chloroform, 1,4-dichlorobenzene, and vinyl chloride. Primary standards of these toxic compounds should be prepared in a hood. A NIOSH/MESA approved toxic gas respirator should be worn when the analyst handles high concentrations of these toxic compounds.

5. Apparatus and Materials

5.1 Sampling equipment, for discrete sampling.

5.1.1 Vial—25-mL capacity or larger, equipped with a screw cap with a hole in the center (Pierce #13075 or equivalent). Detergent wash, rinse with tap and distilled water, and dry at 105 °C before use.

5.1.2 Septum—Teflon-faced silicone (Pierce #12722 or equivalent). Detergent wash, rinse with tap and distilled water, and dry at 105 °C for 1 h before use.

5.2 Purge and trap system—The purge and trap system consists of three separate pieces of equipment: a purging device, trap, and desorber. Several complete systems are now commercially available.

5.2.1 The purging device must be designed to accept 5-mL samples with a water column at least 3 cm deep. The gaseous head space between the water column and the trap must have a total volume of less than 15 mL. The purge gas must pass through the water column as finely divided bubbles with a diameter of less than 3 mm at the origin. The purge gas must be introduced no more than 5 mm from the base of the water column. The purging device illustrated in Figure 1 meets these design criteria.

5.2.2 The trap must be at least 25 cm long and have an inside diameter of at least 0.105 in. The trap must be packed to contain the following minimum lengths of adsorbents: 1.0 cm of methyl silicone coated packing (Section 6.3.3), 7.7 cm of 2,6-diphenylene oxide polymer (Section 6.3.2), 7.7 cm of silica gel (Section 6.3.4), 7.7 cm of coconut charcoal (Section 6.3.1). If it is not necessary to analyze for dichlorodifluoromethane, the charcoal can be eliminated, and the polymer section lengthened to 15 cm. The minimum specifications for the trap are illustrated in Figure 2.

5.2.3 The desorber must be capable of rapidly heating the trap to 180 °C. The polymer section of the trap should not be heated higher than 180 °C and the remaining sections should not exceed 200 °C. The desorber illustrated in Figure 2 meets these design criteria.

5.2.4 The purge and trap system may be assembled as a separate unit or be coupled to a gas chromatograph as illustrated in Figures 3 and 4.

5.3 Gas chromatograph—An analytical system complete with a temperature programmable gas chromatograph suitable for on-column injection and all required accessories including syringes, analytical columns, gases, detector, and strip-chart recorder. A data system is recommended for measuring peak areas.

5.3.1 Column 1—8 ft long x 0.1 in. ID stainless steel or glass, packed with 1% SP-1000 on Carbopack B (60/80 mesh) or equivalent. This column was used to develop the method performance statements in Section 12. Guidelines for the use of alternate column packings are provided in Section 10.1.

5.3.2 Column 2—8 ft long x 0.1 in. ID stainless steel or glass, packed with chemically bonded n-octane on Porasil-C (100/120 mesh) or equivalent.

5.3.3 Detector—Electrolytic conductivity or microcoulometric detector. These types of detectors have proven effective in the analysis of wastewaters for the parameters listed in the scope (Section 1.1). The electrolytic conductivity detector was used to develop the method performance statements in Section 12. Guidelines for the use of alternate detectors are provided in Section 10.1.

5.4 Syringes—5-mL glass hypodermic with Luerlok tip (two each), if applicable to the purging device.

5.5 Micro syringes—25-μL, 0.006 in. ID needle.

5.6 Syringe valve—2-way, with Luer ends (three each).

5.7 Syringe—5-mL, gas-tight with shut-off valve.

5.8 Bottle—15-mL, screw-cap, with Teflon cap liner.

5.9 Balance—Analytical, capable of accurately weighing 0.0001 g.

6. Reagents

6.1 Reagent water—Reagent water is defined as a water in which an interferent is not observed at the MDL of the parameters of interest.

6.1.1 Reagent water can ge generated by passing tap water through a carbon filter bed containing about 1 lb of activated carbon (Filtrasorb-300, Calgon Corp., or equivalent).

6.1.2 A water purification system (Millipore Super-Q or equivalent) may be used to generate reagent water.

6.1.3 Reagent water may also be prepared by boiling water for 15 min. Subsequently, while maintaining the temperature at 90 °C, bubble a contaminant-free inert gas through the water for 1 h. While still hot, transfer the water to a narrow mouth screw-cap bottle and seal with a Teflon-lined septum and cap.

6.2 Sodium thiosulfate—(ACS) Granular.

6.3 Trap Materials:

6.3.1 Coconut charcoal—6/10 mesh sieved to 26 mesh, Barnebey Cheney, CA-580-26 lot # M-2649 or equivalent.

6.3.2 2,6-Diphenylene oxide polymer—Tenax, (60/80 mesh), chromatographic grade or equivalent.

6.3.3 Methyl silicone packing—3% OV-1 on Chromosorb-W (60/80 mesh) or equivalent.

6.3.4 Silica gel—35/60 mesh, Davison, grade-15 or equivalent.

6.4 Methanol—Pesticide quality or equivalent.

6.5 Stock standard solutions—Stock standard solutions may be prepared from pure standard materials or purchased as certified solutions. Prepare stock standard solutions in methanol using assayed liquids or gases as appropriate. Because of the toxicity of some of the organohalides, primary dilutions of these materials should be prepared in a hood. A NIOSH/MESA approved toxic gas respirator should be used when the analyst handles high concentrations of such materials.

6.5.1 Place about 9.8 mL of methanol into a 10 mL ground glass stoppered volumetric flask. Allow the flask to stand, unstoppered, for about 10 min or until all alcohol wetted surfaces have dried. Weigh the flask to the nearest 0.1 mg.

6.5.2 Add the assayed reference material:

6.5.2.1 Liquid—Using a 100 μL syringe, immediately add two or more drops of assayed reference material to the flask, then reweigh. Be sure that the drops fall directly into the alcohol without contacting the neck of the flask.

6.5.2.2 Gases—To prepare standards for any of the six halocarbons that boil below 30 °C (bromomethane, chloroethane, chloromethane, dichlorodifluoromethane, trichlorofluoromethane, vinyl chloride), fill a 5-mL valved gas-tight syringe with the reference standard to the 5.0-mL mark. Lower the needle to 5 mm above the methanol meniscus. Slowly introduce the reference standard above the surface of the liquid (the heavy gas will rapidly dissolve into the methanol).

6.5.3 Reweigh, dilute to volume, stopper, then mix by inverting the flask several times. Calculate the concentration in μg/μL from the net gain in weight. When compound purity is assayed to be 96% or greater, the weight can be used without correction to calculate the concentration of the stock standard. Commercially prepared stock standards can be used at any concentration if they are certified by the manufacturer or by an independent source.

6.5.4 Transfer the stock standard solution into a Teflon-sealed screw-cap bottle. Store, with minimal headspace, at −10 to −20 °C and protect from light.

6.5.5 Prepare fresh standards weekly for the six gases and 2-chloroethylvinyl ether. All other standards must be replaced after one month, or sooner if comparison with check standards indicates a problem.

6.6 Secondary dilution standards—Using stock standard solutions, prepare secondary dilution standards in methanol that contain the compounds of interest, either singly or mixed together. The secondary dilution standards should be prepared at concentrations such that the aqueous calibration standards prepared in Sections 7.3.1 or 7.4.1 will bracket the working range of the analytical system. Secondary dilution standards should be stored with minimal headspace and should be checked frequently for signs of degradation or evaporation, especially just prior to preparing calibration standards from them.

6.7 Quality control check sample concentrate—See Section 8.2.1.

7. Calibration

7.1 Assemble a purge and trap system that meets the specifications in Section 5.2. Condition the trap overnight at 180 °C by backflushing with an inert gas flow of at least 20 mL/min. Condition the trap for 10 min once daily prior to use.

7.2 Connect the purge and trap system to a gas chromatograph. The gas chromatograph must be operated using temperature and flow

rate conditions equivalent to those given in Table 1. Calibrate the purge and trap-gas chromatographic system using either the external standard technique (Section 7.3) or the internal standard technique (Section 7.4).

7.3 External standard calibration procedure:

7.3.1 Prepare calibration standards at a minimum of three concentration levels for each parameter by carefully adding 20.0 µL of one or more secondary dilution standards to 100, 500, or 1000 mL of reagent water. A 25-µL syringe with a 0.006 in. ID needle should be used for this operation. One of the external standards should be at a concentration near, but above, the MDL (Table 1) and the other concentrations should correspond to the expected range of concentrations found in real samples or should define the working range of the detector. These aqueous standards can be stored up to 24 h, if held in sealed vials with zero headspace as described in Section 8.2. If not so stored, they must be discarded after 1 h.

7.3.2 Analyze each calibration standard according to Section 10, and tabulate peak height or area responses versus the concentration in the standard. The results can be used to prepare a calibration curve for each compound. Alternatively, if the ratio of response to concentration (calibration factor) is a constant over the working range (<10% relative standard deviation, RSD), linearity through the origin can be assumed and the average ratio or calibration factor can be used in place of a calibration curve.

7.4 Internal standard calibration procedure—To use this approach, the analyst must select one or more internal standards that are similar in analytical behavior to the compounds of interest. The analyst must further demonstrate that the measurement of the internal standard is not affected by method or matrix interferences. Because of these limitations, no internal standard can be suggested that is applicable to all samples. The compounds recommended for use as surrogate spikes in Section 8.7 have been used successfully as internal standards, because of their generally unique retention times.

7.4.1 Prepare calibration standards at a minimum of three concentration levels for each parameter of interest as described in Section 7.3.1.

7.4.2 Prepare a spiking solution containing each of the internal standards using the procedures described in Sections 6.5 and 6.6. It is recommended that the secondary dilution standard be prepared at a concentration of 15 µg/mL of each internal standard compound. The addition of 10 µL of this standard to 5.0 mL of sample or calibration standard would be equivalent to 30 µg/L.

7.4.3 Analyze each calibration standard according to Section 10, adding 10 µL of internal standard spiking solution directly to the syringe (Section 10.4). Tabulate peak height or area responses against concentration for each compound and internal standard, and calculate response factors (RF) for each compound using Equation 1.

Equation 1.

$$RF = \frac{(A_s)(C_{is})}{(A_{is})(C_s)}$$

where:

A_s = Response for the parameter to be measured.

A_{is} = Response for the internal standard.

C_{is} = Concentration of the internal standard.

C_s = Concentration of the parameter to be measured.

If the RF value over the working range is a constant (<10% RSD), the RF can be assumed to be invariant and the average RF can be used for calculations. Alternatively, the results can be used to plot a calibration curve of response ratios, A_s/A_{is}, vs. RF.

7.5 The working calibration curve, calibration factor, or RF must be verified on each working day by the measurement of a QC check sample.

7.5.1 Prepare the QC check sample as described in Section 8.2.2.

7.5.2 Analyze the QC check sample according to Section 10.

7.5.3 For each parameter, compare the response (Q) with the corresponding calibration acceptance criteria found in Table 2. If the responses for all parameters of interest fall within the designated ranges, analysis of actual samples can begin. If any individual Q falls outside the range, proceed according to Section 7.5.4.

Note: The large number of parameters in Table 2 present a substantial probability that one or more will not meet the calibration acceptance criteria when all parameters are analyzed.

7.5.4 Repeat the test only for those parameters that failed to meet the calibration acceptance criteria. If the response for a parameter does not fall within the range in this second test, a new calibration curve, calibration factor, or RF must be prepared for that parameter according to Section 7.3 or 7.4.

8. Quality Control

8.1 Each laboratory that uses this method is required to operate a formal quality control program. The minimum requirements of this program consist of an initial demonstration of laboratory capability and an ongoing analysis of spiked samples to evaluate and document data quality. The laboratory must maintain records to document the quality of data that is generated. Ongoing data quality checks are compared with established performance criteria to determine if the results of analyses meet the performance characteristics of the method. When results of sample spikes indicate atypical method performance, a quality control check standard must be analyzed to confirm that the measurements were performed in an in-control mode of operation.

8.1.1 The analyst must make an initial, one-time, demonstration of the ability to generate acceptable accuracy and precision with this method. This ability is established as described in Section 8.2.

8.1.2 In recognition of advances that are occurring in chromatography, the analyst is permitted certain options (detailed in Section 10.1) to improve the separations or lower the cost of measurements. Each time such a modification is made to the method, the analyst is required to repeat the procedure in Section 8.2.

8.1.3 Each day, the analyst must analyze a reagent water blank to demonstrate that interferences from the analytical system are under control.

8.1.4 The laboratory must, on an ongoing basis, spike and analyze a minimum of 10% of all samples to monitor and evaluate laboratory data quality. This procedure is described in Section 8.3.

8.1.5 The laboratory must, on an ongoing basis, demonstrate through the analyses of quality control check standards that the operation of the measurement system is in control. This procedure is described in Section 8.4. The frequency of the check standard analyses is equivalent to 10% of all samples analyzed but may be reduced if spike recoveries from samples (Section 8.3) meet all specified quality control criteria.

8.1.6 The laboratory must maintain performance records to document the quality of data that is generated. This procedure is described in Section 8.5.

8.2 To establish the ability to generate acceptable accuracy and precision, the analyst must perform the following operations.

8.2.1 A quality control (QC) check sample concentrate is required containing each parameter of interest at a concentration of 10 µg/mL in methanol. The QC check sample concentrate must be obtained from the U.S. Environmental Protection Agency, Environmental Monitoring and Support Laboratory in Cincinnati, Ohio, if available. If not available from that source, the QC check sample concentrate must be obtained from another external source. If not available from either source above, the QC check sample concentrate must be prepared by the laboratory using stock standards prepared independently from those used for calibration.

8.2.2 Prepare a QC check sample to contain 20 µg/L of each parameter by adding 200 µL of QC check sample concentrate to 100 mL of reagent water.

8.2.3 Analyze four 5-mL aliquots of the well-mixed QC check sample according to Section 10.

8.2.4 Calculate the average recovery ($\bar{X}$) in µg/L, and the standard deviation of the recovery (s) in µg/L, for each parameter of interest using the four results.

8.2.5 For each parameter compare s and $\bar{X}$ with the corresponding acceptance criteria for precision and accuracy, respectively, found in Table 2. If s and $\bar{X}$ for all parameters of interest meet the acceptance criteria, the system performance is acceptable and analysis of actual samples can begin. If any individual s exceeds the precision limit or any individual $\bar{X}$ falls outside the range for accuracy, then the system performance is unacceptable for that parameter.

Note: The large number of parameters in Table 2 present a substantial probability that one or more will fail at least one of the acceptance criteria when all parameters are analyzed.

8.2.6 When one or more of the parameters tested fail at least one of the acceptance

criteria, the analyst must proceed according to Section 8.2.6.1 or 8.2.6.2.

8.2.6.1 Locate and correct the source of the problem and repeat the test for all parameters of interest beginning with Section 8.2.3.

8.2.6.2 Beginning with Section 8.2.3, repeat the test only for those parameters that failed to meet criteria. Repeated failure, however, will confirm a general problem with the measurement system. If this occurs, locate and correct the source of the problem and repeat the test for all compounds of interest beginning with Section 8.2.3.

8.3 The laboratory must, on an ongoing basis, spike at least 10% of the samples from each sample site being monitored to assess accuracy. For laboratories analyzing one to ten samples per month, at least one spiked sample per month is required.

8.3.1 The concentration of the spike in the sample should be determined as follows:

8.3.1.1 If, as in compliance monitoring, the concentration of a specific parameter in the sample is being checked against a regulatory concentration limit, the spike should be at that limit or 1 to 5 times higher than the background concentration determined in Section 8.3.2, whichever concentration would be larger.

8.3.1.2 If the concentration of a specific parameter in the sample is not being checked against a limit specific to that parameter, the spike should be at 20 μg/L or 1 to 5 times higher than the background concentration determined in Section 8.3.2, whichever concentration would be larger.

8.3.2 Analyze one 5-mL sample aliquot to determine the background concentration (B) of each parameter. If necessary, prepare a new QC check sample concentrate (Section 8.2.1) appropriate for the background concentrations in the sample. Spike a second 5-mL sample aliquot with 10 μL of the QC check sample concentrate and analyze it to determine the concentration after spiking (A) of each parameter. Calculate each percent recovery (P) as 100(A–B)%/T, where T is the known true value of the spike.

8.3.3 Compare the percent recovery (P) for each parameter with the corresponding QC acceptance criteria found in Table 2. These acceptance criteria were calculated to include an allowance for error in measurement of both the background and spike concentrations, assuming a spike to background ratio of 5:1. This error will be accounted for to the extent that the analyst's spike to background ratio approaches 5:1.[7] If spiking was performed at a concentration lower than 20 μg/L, the analyst must use either the QC acceptance criteria in Table 2, or optional QC acceptance criteria calculated for the specific spike concentration. To calculate optional acceptance criteria for the recovery of a parameter: (1) Calculate accuracy (X') using the equation in Table 3, substituting the spike concentration (T) for C; (2) calculate overall precision (S') using the equation in Table 3, substituting X' for $\bar{X}$; (3) calculate the range for recovery at the spike concentration as (100 X'/T)±2.44(100 S'/T)%.[7]

8.3.4 If any individual P falls outside the designated range for recovery, that parameter has failed the acceptance criteria. A check standard containing each parameter that failed the criteria must be analyzed as described in Section 8.4.

8.4 If any parameter fails the acceptance criteria for recovery in Section 8.3, a QC check standard containing each parameter that failed must be prepared and analyzed.

Note: The frequency for the required analysis of a QC check standard will depend upon the number of parameters being simultaneously tested, the complexity of the sample matrix, and the performance of the laboratory. If the entire list of parameters in Table 2 must be measured in the sample in Section 8.3, the probability that the analysis of a QC check standard will be required is high. In this case the QC check standard should be routinely analyzed with the spiked sample.

8.4.1 Prepare the QC check standard by adding 10 μL of QC check sample concentrate (Sections 8.2.1 or 8.3.2) to 5 mL of reagent water. The QC check standard needs only to contain the parameters that failed criteria in the test in Section 8.3.

8.4.2 Analyze the QC check standard to determine the concentration measured (A) of each parameter. Calculate each percent recovery (P_s) as 100 (A/T)%, where T is the true value of the standard concentration.

8.4.3 Compare the percent recovery (P_s) for each parameter with the corresponding QC acceptance criteria found in Table 2. Only parameters that failed the test in Section 8.3 need to be compared with these criteria. If the recovery of any such parameter falls outside the designated range, the laboratory performance for that parameter is judged to be out of control, and the problem must be immediately identified and corrected. The analytical result for that parameter in the unspiked sample is suspect and may not be reported for regulatory compliance purposes.

8.5 As part of the QC program for the laboratory, method accuracy for wastewater samples must be assessed and records must be maintained. After the analysis of five spiked wastewater samples as in Section 8.3, calculate the average percent recovery ($\bar{P}$) and the standard deviation of the percent recovery (s_p). Express the accuracy assessment as a percent recovery interval from $\bar{P}-2s_p$ to $\bar{P}+2s_p$. If p = 90% and s_p = 10%, for example, the accuracy interval is expressed as 70–110%. Update the accuracy assessment for each parameter on a regular basis (e.g. after each five to ten new accuracy measurements).

8.6 It is recommended that the laboratory adopt additional quality assurance practices for use with this method. The specific practices that are most productive depend upon the needs of the laboratory and the nature of the samples. Field duplicates may be analyzed to assess the precision of the environmental measurements. When doubt exists over the identification of a peak on the chromatogram, confirmatory techniques such as gas chromatography with a dissimilar column, specific element detector, or mass spectrometer must be used. Whenever possible, the laboratory should analyze standard reference materials and participate in relevant performance evaluation studies.

8.7 The analyst should monitor both the performance of the analytical system and the effectiveness of the method in dealing with each sample matrix by spiking each sample, standard, and reagent water blank with surrogate halocarbons. A combination of bromochloromethane, 2-bromo-1-chloropropane, and 1,4-dichlorobutane is recommended to encompass the range of the temperature program used in this method. From stock standard solutions prepared as in Section 8.5, add a volume to give 750 μg of each surrogate to 45 mL of reagent water contained in a 50-mL volumetric flask, mix and dilute to volume for a concentration of 15 ng/μL. Add 10 μL of this surrogate spiking solution directly into the 5-mL syringe with every sample and reference standard analyzed. Prepare a fresh surrogate spiking solution on a weekly basis. If the internal standard calibration procedure is being used, the surrogate compounds may be added directly to the internal standard spiking solution (Section 7.4.2).

9. Sample Collection, Preservation, and Handling

9.1 All samples must be iced or refrigerated from the time of collection until analysis. If the sample contains free or combined chlorine, add sodium thiosulfate preservative (10 mg/40 mL is sufficient for up to 5 ppm Cl_2) to the empty sample bottle just prior to shipping to the sampling site. EPA Methods 330.4 and 330.5 may be used for measurement of residual chlorine.[8] Field test kits are available for this purpose.

9.2 Grab samples must be collected in glass containers having a total volume of at least 25 mL. Fill the sample bottle just to overflowing in such a manner that no air bubbles pass through the sample as the bottle is being filled. Seal the bottle so that no air bubbles are entrapped in it. If preservative has been added, shake vigorously for 1 min. Maintain the hermetic seal on the sample bottle until time of analysis.

9.3 All samples must be analyzed within 14 days of collection.[3]

10. Procedure

10.1 Table 1 summarizes the recommended operating conditions for the gas chromatograph. Included in this table are estimated retention times and MDL that can be achieved under these conditions. An example of the separations achieved by Column 1 is shown in Figure 5. Other packed columns, chromatographic conditions, or detectors may be used if the requirements of Section 8.2 are met.

10.2 Calibrate the system daily as described in Section 7.

10.3 Adjust the purge gas (nitrogen or helium) flow rate to 40 mL/min. Attach the trap inlet to the purging device, and set the purge and trap system to purge (Figure 3). Open the syringe valve located on the purging device sample introduction needle.

10.4 Allow the sample to come to ambient temperature prior to introducing it to the syringe. Remove the plunger from a 5-mL syringe and attach a closed syringe valve. Open the sample bottle (or standard) and carefully pour the sample into the syringe barrel to just short of overflowing. Replace the syringe plunger and compress the sampl Open the syringe valve and vent any residu

air while adjusting the sample volume to 5.0 mL. Since this process of taking an aliquot destroys the validity of the sample for future analysis, the analyst should fill a second syringe at this time to protect against possible loss of data. Add 10.0 μL of the surrogate spiking solution (Section 8.7) and 10.0 μL of the internal standard spiking solution (Section 7.4.2), if applicable, through the valve bore, then close the valve.

10.5 Attach the syringe-syringe valve assembly to the syringe valve on the purging device. Open the syringe valves and inject the sample into the purging chamber.

10.6 Close both valves and purge the sample for 11.0 ± 0.1 min at ambient temperature.

10.7 After the 11-min purge time, attach the trap to the chromatograph, adjust the purge and trap system to the desorb mode (Figure 4), and begin to temperature program the gas chromatograph. Introduce the trapped materials to the GC column by rapidly heating the trap to 180 °C while backflushing the trap with an inert gas between 20 and 60 mL/min for 4 min. If rapid heating of the trap cannot be achieved, the GC column must be used as a secondary trap by cooling it to 30 °C (subambient temperature, if poor peak geometry or random retention time problems persist) instead of the initial program temperature of 45 °C.

10.8 While the trap is being desorbed into the gas chromatograph, empty the purging chamber using the sample introduction syringe. Wash the chamber with two 5-mL flushes of reagent water.

10.9 After desorbing the sample for 4 min, recondition the trap by returning the purge and trap system to the purge mode. Wait 15 s then close the syringe valve on the purging device to begin gas flow through the trap. The trap temperature should be maintained at 180 °C. After approximately 7 min, turn off the trap heater and open the syringe valve to stop the gas flow through the trap. When the trap is cool, the next sample can be analyzed.

10.10 Identify the parameters in the sample by comparing the retention times of the peaks in the sample chromatogram with those of the peaks in standard chromatograms. The width of the retention time window used to make identifications should be based upon measurements of actual retention time variations of standards over the course of a day. Three times the standard deviation of a retention time for a compound can be used to calculate a suggested window size; however, the experience of the analyst should weigh heavily in the interpretation of chromatograms.

10.11 If the response for a peak exceeds the working range of the system, prepare a dilution of the sample with reagent water from the aliquot in the second syringe and reanalyze.

11. Calculations

11.1 Determine the concentration of individual compounds in the sample.

11.1.1 If the external standard calibration procedure is used, calculate the concentration of the parameter being measured from the peak response using the calibration curve or calibration factor determined in Section 7.3.2.

11.1.2 If the internal standard calibration procedure is used, calculate the concentration in the sample using the response factor (RF) determined in Section 7.4.3 and Equation 2.

Equation 2.

$$\text{Concentration } (\mu g/L) = \frac{(A_s)(C_{is})}{(A_{is})(RF)}$$

where:

A_s = Response for the parameter to be measured.

A_{is} = Response for the internal standard.

C_{is} = Concentration of the internal standard.

11.2 Report results in μg/L without correction for recovery data. All QC data obtained should be reported with the sample results.

12. Method Performance

12.1 The method detection limit (MDL) is defined as the minimum concentration of a substance that can be measured and reported with 99% confidence that the value is above zero.[1] The MDL concentrations listed in Table 1 were obtained using reagent water.[9] Similar results were achieved using representative wastewaters. The MDL actually achieved in a given analysis will vary depending on instrument sensitivity and matrix effects.

12.2 This method is recommended for use in the concentration range from the MDL to 1000 x MDL. Direct aqueous injection techniques should be used to measure concentration levels above 1000 × MDL.

12.3 This method was tested by 20 laboratories using reagent water, drinking water, surface water, and three industrial wastewaters spiked at six concentrations over the range 8.0 to 500 μg/L.[9] Single operator precision, overall precision, and method accuracy were found to be directly related to the concentration of the parameter and essentially independent of the sample matrix. Linear equations to describe these relationships are presented in Table 3.

References

1. 40 CFR Part 136, Appendix B.

2. Bellar, T.A., and Lichtenberg, J.J. "Determining Volatile Organics at Microgram-per-Litre-Levels by Gas Chromatography," *Journal of the American Water Works Association, 66*, 739 (1974).

3. Bellar, T.A., and Lichtenberg, J.J. "Semi-Automated Headspace Analysis of Drinking Waters and Industrial Waters for Purgeable Volatile Organic Compounds," Proceedings from Symposium on Measurement of Organic Pollutants in Water and Wastewater, American Society for Testing and Materials, STP 686, C.E. Van Hall, editor, 1978.

4. "Carcinogens—Working With Carcinogens," Department of Health, Education, and Welfare, Public Health Service, Center for Disease Control, National Institute for Occupational Safety and Health, Publication No. 77-206, August 1977.

5. "OSHA Safety and Health Standards, General Industry" (29 CFR 1910), Occupational Safety and Health Administration, OSHA 2206 (Revised, January 1976).

6. "Safety in Academic Chemistry Laboratories," American Chemical Society Publication, Committee on Chemical Safety, 3rd Edition, 1979.

7. Provost, L.P., and Elder, R.S. "Interpretation of Percent Recovery Data," *American Laboratory, 15*, 58-63 (1983). (The value 2.44 used in the equation in Section 8.3.3 is two times the value 1.22 derived in this report.)

8. "Methods 330.4 (Titrimetric, DPD-FAS) and 330.5 (Spectrophotometric, DPD) for Chlorine, Total Residual," Methods for Chemical Analysis of Water and Wastes, EPA 600/4-79-020, U.S. Environmental Protection Agency, Environmental Monitoring and Support Laboratory, Cincinnati, Ohio 45268, March 1979.

9. "EPA Method Validation Study 23, Method 601 (Purgeable Halocarbons)," Report for EPA Contract 68-03-2856 (in preparation).

10. "Method Validation Data for EPA Method 601," Memorandum from B. Potter, U.S. Environmental Protection Agency, Environmental Monitoring and Support Laboratory, Cincinnati, Ohio 45268, November 10, 1983.

TABLE 1.—CHROMATOGRAPHIC CONDITIONS AND METHOD DETECTION LIMITS

Parameter	Retention time (min)		Method detection limit (μg/L)
	Column 1	Column 2	
Chloromethane	1.50	5.28	0.08
Bromomethane	2.17	7.05	1.18
Dichlorodifluoromethane	2.62	nd	1.81
Vinyl chloride	2.67	5.28	0.18
Chloroethane	3.33	8.68	0.52
Methylene chloride	5.25	10.1	0.25
Trichlorofluoromethane	7.18	nd	nd
1,1-Dichloroethene	7.83	7.72	0.13
1,1-Dichloroethane	8.30	12.6	0.07
trans-1,2-Dichloroethene	10.1	9.38	0.10

TABLE 1.—CHROMATOGRAPHIC CONDITIONS AND METHOD DETECTION LIMITS—Continued

Parameter	Retention time (min)		Method detection limit (µg/L)
	Column 1	Column 2	
Chloroform	10.7	12.1	0.05
1,2-Dichloroethane	11.4	15.4	0.03
1,1,1-Trichloroethane	12.6	13.1	0.03
Carbon tetrachloride	13.0	14.4	0.12
Bromodichloromethane	13.7	14.6	0.10
1,2-Dichloropropene	14.9	16.6	0.04
cis-1,3-Dichloropropene	15.2	16.6	0.34
Trichloroethene	15.8	13.1	0.12
Dibromochloromethane	16.5	16.6	0.08
1,1,2-Trichloroethane	16.5	18.1	0.02
trans-1,3-Dichloropropene	16.5	18.0	0.20
2-Chloroethylvinyl ether	18.0	nd	0.13
Bromoform	19.2	19.2	0.20
1,1,2,2-Tetrachloroethane	21.8	nd	0.03
Tetrachloroethene	21.7	15.0	0.03
Chlorobenzene	24.2	18.8	0.25
1,3-Dichlorobenzene	34.0	22.4	0.32
1,2-Dichlorobenzene	34.9	23.5	0.15
1,4-Dichlorobenzene	35.4	22.3	0.24

Column 1 conditions: Carbopack B (60/80 mesh) coated with 1% SP-1000 packed in an 8 ft x 0.1 in. ID stainless steel or glass column with helium carrier gas at 40 mL/min flow rate. Column temperature held at 45 °C for 3 min then programmed at 8 °C/min to 220 °C and held for 15 min.

Column 2 conditions: Porasil-C (100/120 mesh) coated with n-octane packed in a 6 ft x 0.1 in. ID stainless steel or glass column with helium carrier gas at 40 mL/min flow rate. Column temperature held at 50 °C for 3 min then programmed at 6 °C/min to 170 °C and held for 4 min.

nd = not determined.

TABLE 2.—CALIBRATION AND QC ACCEPTANCE CRITERIA—METHOD 601 [a]

Parameter	Range for Q (µg/L)	Limit for s (µg/L)	Range for $\bar{X}$ (µg/L)	Range P, P_s (%)
Bromodichloromethane	15.2-24.8	4.3	10.7-32.0	42-172
Bromoform	14.7-25.3	4.7	5.0-29.3	13-158
Bromomethane	11.7-28.3	7.6	3.4-24.5	D-144
Carbon tetrachloride	13.7-26.3	5.6	11.8-25.3	43-143
Chlorobenzene	14.4-25.6	5.0	10.2-27.4	38-150
Chloroethane	15.4-24.6	4.4	11.3-25.2	46-137
2-Chloroethylvinyl ether	12.0-28.0	8.3	4.5-35.5	14-186
Chloroform	15.0-25.0	4.5	12.4-24.0	48-133
Chloromethane	11.9-28.1	7.4	D-34.9	D-169
Dibromochloromethane	13.1-26.9	6.3	7.9-35.1	24-191
1,2-Dichlorobenzene	14.0-26.0	5.5	1.7-38.9	D-208
1,3-Dichlorobenzene	8.9-30.1	9.1	8.2-32.6	7-187
1,4-Dichlorobenzene	13.9-26.1	5.5	11.5-25.5	42-143
1,1-Dichloroethane	16.9-23.2	3.2	11.2-24.8	47-132
1,2-Dichloroethane	14.3-25.7	5.2	13.0-26.5	51-147
1,1-Dichloroethene	12.8-27.4	6.6	10.2-27.3	28-167
trans-1,2-Dichloroethene	12.8-27.2	6.4	11.4-27.1	36-156
1,2-Dichloropropane	14.8-25.2	5.2	10.1-29.9	44-156
cis-1,3-Dichloropropene	12.8-27.2	7.3	6.2-33.8	22-178
trans-1,3-Dichloropropene	12.8-27.2	7.3	6.2-33.8	22-178
Methylene chloride	15.5-24.5	4.0	7.0-27.6	25-162
1,1,2,2-Tetrachloroethane	9.8-30.2	9.2	6.6-31.8	8-184
Tetrachloroethene	14.0-26.0	5.4	8.1-29.5	26-162
1,1,1-Trichloroethane	14.2-25.8	4.9	10.8-24.8	41-138
1,1,2-Trichloroethane	15.7-24.3	3.9	9.6-25.4	39-136
Trichloroethene	15.4-24.6	4.2	9.2-26.6	35-146
Trichlorofluoromethane	13.3-26.7	6.0	7.4-28.1	21-156
Vinyl chloride	13.7-26.3	5.7	8.2-29.9	29-183

Q = Concentration measured in QC check sample, in µg/L (Section 7.5.3).
s = Standard deviation of four recovery measurements, in µg/L (Section 8.2.4).
$\bar{X}$ = Average recovery for four recovery measurements, in µg/L (Section 8.2.4).
P, P_s = Percent recovery measured (Section 8.3.2, Section 8.4.2).
D = Detected, result must be greater than zero.
[a] Criteria were calculated assuming a QC check sample concentration of 20 µg/L.

Note: These criteria are based directly upon the method performance data in Table 3. Where necessary, the limits for recovery have been broadened to assure applicability of the limits to concentrations below those used to develop Table 3.

TABLE 3.—METHOD ACCURACY AND PRECISION AS FUNCTIONS OF CONCENTRATION—METHOD 601

Parameter	Accuracy, as recovery, X' (µg/L)	Single analyst precision, s_r (µg/L)	Overall precision, S' (µg/L)
Bromodichloromethane	1.12C - 1.02	0.11$\bar{X}$ + 0.04	0.20$\bar{X}$ + 1.00
Bromoform	0.98C - 2.05	0.12$\bar{X}$ + 0.58	0.21$\bar{X}$ + 2.41
Bromomethane	0.78C - 1.27	0.26$\bar{X}$ + 0.27	0.36$\bar{X}$ + 0.94
Carbon tetrachloride	0.98C - 1.04	0.15$\bar{X}$ + 0.38	0.20$\bar{X}$ + 0.39
Chlorobenzene	1.00C - 1.23	0.15$\bar{X}$ - 0.02	0.18$\bar{X}$ + 1.21
Chloroethane	0.99C - 1.53	0.14$\bar{X}$ - 0.13	0.17$\bar{X}$ + 0.83
2-Chloroethylvinyl ether [a]	1.00C	0.20$\bar{X}$	0.35$\bar{X}$
Chloroform	0.93C - 0.39	0.13$\bar{X}$ + 0.15	0.19$\bar{X}$ - 0.02
Chloromethane	0.77C + 0.18	0.28$\bar{X}$ - 0.31	0.52$\bar{X}$ + 1.31
Dibromochloromethane	0.94C - 2.72	0.11$\bar{X}$ + 1.10	0.24$\bar{X}$ + 1.68
1,2-Dichlorobenzene	0.93C - 1.70	0.20$\bar{X}$ + 0.97	0.13$\bar{X}$ + 6.13

TABLE 3.—METHOD ACCURACY AND PRECISION AS FUNCTIONS OF CONCENTRATION—METHOD 601—Continued

Parameter	Accuracy, as recovery, $\bar{X}'$ (µg/L)	Single analyst precision, s_r' (µg/L)	Overall precision, S' (µg/L)
1,3-Dichlorobenzene	0.96C + 0.43	0.14$\bar{X}$ + 2.35	0.26$\bar{X}$ + 2.34
1,4-Dichlorobenzene	0.97C - 0.09	0.15$\bar{X}$ + 0.29	0.20$\bar{X}$ + 0.41
1,1-Dichloroethane	0.96C - 1.08	0.08$\bar{X}$ + 0.17	0.14$\bar{X}$ + 0.84
1,2-Dichloroethane	1.04C - 1.08	0.11$\bar{X}$ + 0.70	0.15$\bar{X}$ + 0.84
1,1-Dichloroethene	0.98C - 0.87	0.21$\bar{X}$ - 0.23	0.29$\bar{X}$ - 0.40
trans-1,2-Dichloroethene	0.87C - 0.16	0.11$\bar{X}$ + 1.46	0.17$\bar{X}$ + 1.46
1,2-Dichloropropane *	1.00C	0.12$\bar{X}$	0.23$\bar{X}$
cis-1,3-Dichloropropene *	1.00C	0.18$\bar{X}$	0.32$\bar{X}$
trans-1,3-Dichloropropene *	1.00C	0.18$\bar{X}$	0.32$\bar{X}$
Methylene chloride	0.81C - 0.83	0.11$\bar{X}$ + 0.33	0.21$\bar{X}$ + 1.43
1,1,2,2-Tetrachloroethane	0.95C + 0.19	0.14$\bar{X}$ + 2.41	0.23$\bar{X}$ + 2.79
Tetrachloroethene	0.94C + 0.06	0.14$\bar{X}$ + 0.38	0.18$\bar{X}$ + 2.21
1,1,1-Trichloroethane	0.90C - 0.16	0.15$\bar{X}$ + 0.04	0.20$\bar{X}$ + 0.37
1,1,2-Trichloroethane	0.96C + 0.20	0.12$\bar{X}$ - 0.14	0.19$\bar{X}$ + 0.87
Trichloroethene	0.87C + 0.48	0.13$\bar{X}$ - 0.03	0.23$\bar{X}$ + 0.30
Trichlorofluoromethane	0.89C - 0.07	0.15$\bar{X}$ + 0.67	0.26$\bar{X}$ + 0.91
Vinyl chloride	0.97C - 0.36	0.13$\bar{X}$ + 0.65	0.27$\bar{X}$ + 0.40

$\bar{X}'$ = Expected recovery for one or more measurements of a sample containing a concentration of C, in µg/L
s_r' = Expected single analyst standard deviation of measurements at an average concentration found of $\bar{X}$, in µg/L
S' = Expected interlaboratory standard deviation of measurements at an average concentration found of $\bar{X}$, in µg/L
C = True value for the concentration, in µg/L
$\bar{X}$ = Average recovery found for measurements of samples containing a concentration of C, in µg/L
* Estimates based upon the performance in a single laboratory.[19]

BILLING CODE 6560-50-M

Power Pole 1

OUTLINE OF NEW SIMA BUILDING

FORMER BUILDING 503

TRANSFORMER PAD

HUNTERS POINT AVENUE

North

AREA I

AREA II

AREA III

PUMP STATION

NW

SW

Edge of Excavation

Power Pole 2

Grid Point	Symbol/Area	Distance (ft.) to Power Pole: Power Pole 1	Distance (ft.) to Power Pole: Power Pole 2	Distance (ft.) to Pumping Station: NW Corner	Distance (ft.) to Pumping Station: SW Corner
X1	△/I	62.0	82.5	-	-
X2	△/I	58.5	97.0	-	-
D3	△/I	72.0	88.7	-	-
2C-1	●/II	-	-	107.0	97.5
2C-6	●/II	-	-	98.5	99.0
2H-1	●/II	-	-	68.0	56.0
3E-11	□/III	-	-	31.9	30.0
3D-18	□/III	-	-	39.3	20.5
3G-5	□/III	-	-	46.2	51.3

Key Plan

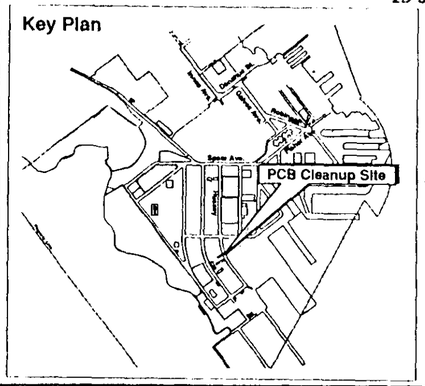

Figure 3-2

Verification Sample Locations

PCB Cleanup Near Former Building #503

Huntor's Point Naval Shipyard, CA

0 5 10 20

Scale in feet 1" = 10 ft.

ERM-West

472.01/JPT/10.4.88